

DEENDAYAL PORT AUTHORITY
(Erstwhile: DEENDAYAL PORT TRUST)



Administrative Office Building
Post Box NO. 50
GANDHIDHAM (Kutch).
Gujarat: 370 201.
Fax: (02836) 220050
Ph.: (02836) 220038

www.deendayalport.gov.in
EG/WK/4660 (EC)/ Part-V/ 05

Date: 17/01/2025

To,
The Deputy Director General of Forests,
Ministry of Environment, Forest & Climate Change,
Integrated Regional Office,
Gandhinagar, A wing-407 & 409
Aranya Bhavan Near CH-3 Circle
Sector 10A, Gandhinagar - 382010
Email: iro.gandhingr-mefcc@gov.in

Sub: "Construction of 13th to 16th Cargo Berths at Kandla" by M/s Deendayal Port Authority (Erstwhile Deendayal Port Trust) - **Compliance Report of conditions stipulated in Environmental & CRZ Clearance and Monitoring Report in Data Sheet req.**

- Ref.:** 1) EC & CRZ Clearance granted by MoEFF, GoI vide F.No. 11-70/2006-IA-III dated 1/10/2008.
2) KPT letter no. EG/WK/4660 (EC)/654 dated 6/10/2010.
3) KPT letter no. EG/WK/4660 (EC)/ 112 dated 4/2/2012.
4) KPT letter no. EG/WK/4660(EC)/223 dated 4/9/2012.
5) KPT letter no. EG/WK/4660(EC)/144 dated 16 (17) /5/2013.
6) KPT letter no. EG/WK/4660 (EC)/Part 111/1087 dated 9/12/2013.
7) KPT letter no. EG/WK/4660 (EC)/Part 111/250 dated 17/05/2014.
8) KPT letter no. EG/WK/4660 (EC)/Part 111/198 dated 14/11/2014.
9) KPT letter no. EG/WK/4660 (EC)/Part 111/256 dated 11/05/2015.
10) KPT letter no. EG/WK/4660 (EC)/Part 111/162 dated 15/10/2015.
11) KPT letter no. EG/WK/4660 (EC)/Part 111/133 dated 09/05/2016.
12) KPT letter no. EG/WK/4660 (EC)/Part IV/167 dated 26/12/2016.
13) DPT letter no. EG/WK/4660 (EC)/Part IV/325 dated 26/06/2018.
14) DPT letter no. EG/WK/4660 (EC)/Part V/53 dated 14(16)/2/2019.
15) DPT letter no. EG/WK/4660 (EC)/Part V/205 dated 30(6)/11 (12)/2019.
16) DPT letter no. EG/WK/4660 (EC)/Part V dated 15/01/2021.
17) DPT letter no. EG/WK/4660 (EC)/Part V/92 dated 30(07)/9(10)/2021.
18) DPT letter no. EG/WK/4660 (EC)/Part V dated 28/03/2022
19) DPA letter no. EG/WK/4660 (EC)/Part V/149 dated 19/07/2022
20) DPA letter no. EG/WK/4660 (EC)/Part V/230 dated 02/02/2023
21) DPA letter no. EG/WK/4660 (EC)/Part V/350 dated 14/08/2023
22) DPA letter no. EG/WK/4660 (EC)/Part V/37 dated 19/03/2024
23) DPA letter no. EG/WK/4660 (EC)/Part V/93 dated 24/07/2024

Sir,

It is requested to kindly refer above cited references for the said subject.

.....cont.....

In this connection, it is to state that, as directed under above referred letter dated 5/8/2009 of MoEF, Regional Office, Gandhinagar, Deendayal Port Authority (Erstwhile Deendayal Port Trust) vide above referred letters had regularly submitted Six Monthly compliance report of stipulated conditions and Monitoring report in Data Sheet, in connection with subject project.

Now, as directed in above referred letter dated 5/8/2009 of MoEF, GoI, please find enclosed herewith point wise compliance to various stipulation in Environmental & CRZ Clearance granted by MoEF, GoI vide letter 11-70/2006-IA.III dated Sept, 2008 (**Annexure 1**) & Monitoring Report in Data Sheet (**Annexure 2**), for the period upto September, 2024 for kind information and record please.

Further, as per the MoEF&CC, Notification S.O.5845 (E) dated 26.11.2018, stated that **"In the said notification, in paragraph 10, in sub-paragraph (ii), for the words "hard and soft copies" the words "soft copy" shall be substituted"**. Accordingly, we are submitting herewith soft copy of the same via e-mail ID iro.gandhingr-mefcc@gov.in

This has the approval of the Chief Engineer, Deendayal Port Authority.

Thanking You.

Yours faithfully,



Dy. Chief Engineer & EMC(I/c)
Deendayal Port Authority

Copy along with point wise compliance of stipulated conditions, to:

1) Shri Amardeep Raju, MoEF&CC, GoI and Member Secretary (EAC-Infra.1), Indira Paryavaran Bhavan, Ministry of Environment, Forest and Climate Change
Jor Bagh Road, Aliganj,
New Delhi-110003.
Email: ad.raju@nic.in

2) Shri Prasoon Gargav,
Scientist E & Regional Director,
Central Pollution Control Board,
Parivesh Bhawan, Opp. VMC Ward
Office No.10, Subhanpura,
Vadodara - 390 023.
Email: prasoon.cpcb@nic.in

3) Shri T. C. Patel,
Unit Head, Kachchh,
Gujarat Pollution Control Board,
Paryavaran Bhavan,
Sector 10A, Gandhinagar- 382 010.
Email-kut-uh-gpcb@gujarat.gov.in

4) The Regional Officer,
Gujarat Pollution Control Board,
Regional Office (East Kutch),
Administrative Office Building,
Deendayal Port Trust, Gandhidham.
Email Id. ro-gpcb-kute@gujarat.gov.in

Annexure -1

Compliance Report for the period upto September 2024

Subject: - Compliance of conditions stipulated in Environmental & CRZ Clearance granted by the MoEF&CC, GoI for "Construction of 13th to 16th Cargo Berths at Deendayal Port Authority (Erstwhile: Deendayal Port Trust)".

- The MoEF, GoI granted Environmental & CRZ Clearance for the subject project vide no. F. No. 11-70/2006-IA-III dated Sep 2008.
- 7/2/2014 – The MoEF&CC, GoI extended the validity period of Environmental & CRZ Clearance for a further period of 5 years, i.e. up to 30/9/2018.

STATUS OF Berths:

13th Cargo Berth: Under operation since 18/2/2013.

15th Cargo Berth: Under Operation since 16/11/2013.

14th Cargo Berth: Under Operation since 8/4/2019.

16th Cargo Berth: Under Operation since 10/3/2019.

CONSENT TO OPERATE:

Consolidated Consent & Authorization (CC&A) issued by the GPCB (Consent Order no-AWH-110594 dated of issue-8/12/2020, with a validity period upto 21/7/2025)- Detailed Order issued by the GPCB vide outward no. 581914 dated 22/1/2021 & subsequently, issued Correction in CC&A order vide letter no. PC/CCA-KUTCH-812(5)/GPCB ID 28494/588116 dated 9/4/2021.

Sr. No.	Conditions	Remarks
A	Specific Condition	
1	All measures indicated in the letter dated 4/8/2008 shall be strictly complied with.	Compliance Report of conditions stipulated in the CRZ recommendation granted by Forest & Environment Department, GoG vide letter dated 14/02/2008 is placed in Annexure A .
2	Necessary clearances from the Gujarat State Pollution Control Board shall be obtained before initiating the project.	<p>GPCB vide order no. PCC/CCA-BHUI-179(3)/575 dated 9/1/2009 granted a No Objection Certificate to the said project.</p> <p>Currently, all the 4 berths are under operation.</p> <p>Further, GPCB vide order dated 22/1/2021 has issued Consolidated Consent & Authorization (Valid up to 21/7/2025). Subsequently, GPCB issued a Correction in the CC&A order vide letter no. PC/CCA-KUTCH-812(5)/GPCB ID 28494/ 588116 dated 9/4/2021. A copies of the above have already been communicated with the earlier compliance reports submitted.</p>
3	The project proponent shall not undertake any destruction of mangroves during construction and operation of project.	<p>Point noted. All the 4 berths are under operation.</p> <p>As per the directions of the GCZMA and MoEF&CC, GoI, to date, DPA has undertaken a Mangrove Plantation in an area of 1600 Hectares since the year 2005. The details have already been communicated with the earlier compliance reports submitted.</p> <p>It is also relevant to mention here that, as per the direction of the Gujarat Coastal Zone Management Authority, DPA has already prepared & submitted a report on the mangrove conservation and management plan formulated by the Gujarat Institute of Desert Ecology during the study period of Jan-April, 2015 (Report already submitted along with earlier compliance reports submitted).</p> <p>For regular monitoring, DPA vide work order dated 3/5/2021 has assigned work to M/s GUIDE, Bhuj for Monitoring of mangrove plantation carried out by DPA (Period from</p>

		<p>24/5/2021 to 23/5/2022). The final report submitted by M/s GUIDE has already been communicated with the earlier compliance report submitted.</p> <p>Further DPA has assigned work to M/s GUIDE, Bhuj vide work order dated 10/06/2024 for "Monitoring of Mangrove Plantation 1600 Ha carried out by DPA" for the Period of 10/06/2024 to 09/06/2025. The inception report submitted by GUIDE, Bhuj is attached herewith as Annexure B.</p>
4	<p>Sewage arising in the Port area shall be treated to conform to the standards stipulated by Gujarat State Pollution Control Board and shall be utilized/ recycled or gardening, plantation and irrigation.</p>	<p>The sewage generated in the port area is treated in the 1.5 MLD STP at Kandla. The treated wastewater is utilized for gardening and plantation purposes. In addition to that, it also has septic tanks at places where STP is inaccessible.</p> <p>DPA has been appointing a NABL-accredited laboratory to monitor environmental parameters, and reports are being submitted from time to time to the GPCB, IRO, MoEF&CC, GoI. Recently, DPA appointed GEMI, Gandhinagar, to regularly monitor environmental parameters vide Work Order dated 15/02/2023. The work is in progress, and the latest environmental monitoring report submitted by GEMI, Gandhinagar, is attached herewith as Annexure C.</p>
5	<p>Project proponent shall prepare Disaster Management Plan covering emergency evacuation mechanisms etc. deal with natural disaster events and regularly update from time to time.</p>	<p>DPA is already having a Disaster Management Plan. A copy of the same has been communicated with earlier submitted compliance reports.</p>
6	<p>There shall be no withdrawal of groundwater in the COASTAL REGULATION ZONE area for this project.</p> <p>The proponent shall ensure that as a result of the proposed constructions, ingress of saline water into ground water does not take place. Piezometers shall be installed for regular monitoring for this purpose at appropriate</p>	<p>All the 4 berths are currently under operation.</p>

	locations on the project site.	
7	The facilities to be constructed in the COASTAL REGULATION ZONE area as part of this project shall be strictly in conformity with the provisions of the COASTAL REGULATION ZONE Notification, 1991 as amended subsequently.	All the 4 berths are currently under operation.
8	Green belt area shall be developed along the project and budget earmarked.	<p>DPA had entrusted the work to the Forest Department, Gujarat, for developing a green belt in and around the Port area at a cost of Rs. 352 lakhs in an area of about 32 hectares, and the work is already completed.</p> <p>Further, DPA has appointed the Gujarat Institute of Desert Ecology (GUIDE) for "Green belt development in Deendayal Port Authority and its Surrounding Areas, Charcoal site' (Phase-I)" vide Work Order No.EG/WK/4757/Part [Greenbelt GUIDE], dated 31st May 2022. The final report has already been communicated with the last compliance report.</p> <p>DPA has assigned the Greenbelt development in Deendayal Port Authority and its surrounding areas, Phase II, to M/s GUIDE vide Work order EG/WK/4751/Part (Greenbelt)/327 dated 23.06.2023. The Final Report is attached here with as Annexure D</p>
9	No product other than those permissible in the COASTAL REGULATION ZONE Notification, 1991 shall be stored in the COASTAL REGULATION ZONE area.	<p>Point Noted.</p> <p>Cargo is being stored at the backup area of berths, viz. 13th to 16th CB, as per the EC & CRZ Clearance accorded by the MoEF&CC, GoI.</p>
B	General Conditions	
I	Construction of the proposed structures shall be undertaken meticulously conforming to the existing Central/Local rules and regulations including COASTAL REGULATION ZONE Notification, 1991 & its amendments. All the construction design/drawings relating to the proposed construction activities must have approvals of the	Currently, all the 4 berths are under operation.

	concerned State Government Department/Agencies.	
ii	Adequate provisions for infrastructure facilities such as water supply, fuel, sanitation etc. shall be ensured for construction workers during the construction phase of the project so as to avoid feeling of trees / mangroves and pollution of water and surroundings.	All the 4 berths are currently under operation.
iii	<p>The project authorities must make necessary arrangement for disposal of solid wastes and for the treatment of Effluents by providing a proper wastewater treatment plant outside the COASTAL REGULATION ZONE area.</p> <p>The quality of treated effluents, solid wastes and noise level etc. must conform to the standards laid down by the competent authorities including the Central/State Pollution Control Board and the Union Ministry of Environment and Forests under the Environment (Protection) Act, 1986, whichever are more stringent.</p>	<p>Companies authorized by the State Pollution Control Board (SPCB) have been awarded the work of collecting, transporting, and disposing of solid waste by the Deendayal Port Authority.</p> <p>Further, DPA has appointed GEMI, Gandhinagar, for the work of "Preparation of Plan for Management of Plastic Wastes, Solid Waste, including C&D waste, E-waste, Hazardous waste, including Biomedical and Non-Hazardous Waste in the Deendayal Port Authority" vide Work Order dated 24/01/2023. The work is in progress.</p> <p>Generated sewage is treated in DPA's existing STP (1.5 MLD capacity). In addition to that, it also has septic tanks at places where STP is inaccessible.</p> <p>DPA has been appointing a NABL-accredited laboratory to monitor environmental parameters, and reports are being submitted from time to time to the GPCB, IRO, MoEF&CC, GoI, and Gandhinagar. Recently, DPA appointed GEMI, Gandhinagar, to regularly monitor environmental parameters vide Work Order dated 15/02/2023. The work is in progress, and the latest environmental monitoring report submitted by GEMI, Gandhinagar, is attached herewith as Annexure C.</p>
iv	<p>The proponents shall provide for a regular monitoring mechanism as to ensure that the treated effluents conform to the prescribed standards.</p> <p>The records of analysis reports must be properly maintained and made available for inspection to the concerned State/Central officials</p>	<p>DPA has been appointing a NABL-accredited laboratory to monitor environmental parameters, and reports are being submitted from time to time to the GPCB, IRO, MoEF&CC, GoI, and Gandhinagar. Recently, DPA appointed GEMI, Gandhinagar, to regularly monitor environmental parameters vide Work Order dated 15/02/2023. The work is in progress, and the latest environmental monitoring</p>

	during their visits.	report submitted by GEMI, Gandhinagar, is attached herewith as Annexure C .
V	In order to carry out the environmental monitoring during the operational phase of the project, the project authorities shall provide an environmental laboratory well equipped with standard equipment and facilities and qualified manpower to carry out the testing of various environmental parameters.	DPA has been appointing a NABL-accredited laboratory to monitor environmental parameters, and reports are being submitted from time to time to the GPCB, IRO, MoEF&CC, GoI, and Gandhinagar. Recently, DPA appointed GEMI, Gandhinagar, to regularly monitor environmental parameters vide Work Order dated 15/02/2023. The work is in progress, and the latest environmental monitoring report submitted by GEMI, Gandhinagar, is attached herewith as Annexure C .
vi	The sand dunes if any on the site shall not be disturbed in any way.	No sand dunes at project site prevail.
Vii	A copy of the clearance letter will be marked to the concerned Panchayat/local NGO, if any from whom any suggestion/representation has been received while processing the proposal.	No suggestion/ representation has been received while processing the proposal.
Viii	The Gujarat Pollution Control Board shall display a copy of the clearance letter at the Regional Office, District Industries Centre and Controller's Office/Tehsildar's Office for 30 days.	-----
ix	The funds earmarked for environment protection measures shall be maintained, in a separate account and there shall be no diversion of these funds for any other purpose. A year-wise expenditure on environmental safeguards shall be reported to this Ministry's Regional Office at Bhopal and the State Pollution Control Board.	Point noted. The allocation made under the scheme of "Environmental Services & Clearance thereof other related Expenditure" during BE 2024-25 is Rs. 657 Lakhs. The expenditure made under the "Environmental Services & Clearance of other related Expenditure" is Rs. 172 Lakhs from up to September 2024. The yearly expenditure on environmental safeguards is regularly submitted in the monitoring datasheet to the Ministry's Regional Office at Bhopal (Now Gandhinagar).

X	Full support shall be extended to the officers of this Ministry's Regional Office at Bhopal and the officers of the central and State Pollution Control Board by the project proponents during their inspection for monitoring purpose, by furnishing full details and action plans including the action taken reports in respect of mitigate measures and other environment protection activities.	DPA had given the required support to the officer of the Ministry's Regional Office, Bhopal, during a site inspection carried out on 29/12/2016 for the purpose of certifying EC Conditions. DPA has also given required support to the officials of the Gujarat Pollution Control Board during their visits to DPA for inspection, etc. Further, it is also assured that DPA shall extend full support in future to the officials of the Ministry's Regional Office at Bhopal (Now Gandhinagar) and the officers of the Central and State Pollution Control Board during their inspection.
xi	In case of deviation of alteration in the project including the implementing agency, a fresh reference shall be made to this Ministry for modification in the clearance conditions or imposition of new ones for ensuring environment protection.	Point Noted.
Xii	This ministry reserves the right to revoke this clearance, if any of the conditions stipulated are not complied with to satisfaction of this ministry.	Point Noted.
Xiii	This Ministry or any other competent authority may stipulate any other additional conditions subsequently, if deemed necessary, for environment protection, which shall be complied with.	Point Noted.
Xiv	The project proponent shall advertise in at least two local newspapers widely circulated in the region around the project, one of which shall be in the vernacular language of the locality Concerned, informing that the project has been accrued environment clearance and copies of clearance letters are available with the State Pollution Control Board and may also be seen at website of the Ministry of Environment & Forests at http://www.envfornic.in . The advertisement shall be made within 7 days from the date of issue	Advertisements had already been made in Kutch Mitra on 21/10/2008 and Kutch Uday on 22/10/2008. Further, Newspaper cuttings had already been sent to the Regional Office, MoEF&CC, Bhopal, vide DPA letter No.: EG/WK/4660(EC)/01 dated 31/10/2008.

	of the clearance letter and a copy of the same shall be forwarded to the Regional office of this Ministry at Bangalore.	
xv	The project proponent shall inform the Regional office at Bhopal as well as the Ministry the date of financial closer and final approval of the Project by the concerned authorities and the date of Start of Land Development work.	The necessary details have already been provided by the DPA from time to time, along with the earlier compliance reports submitted. Now, all the 4 berths are under operation.
10	<p>The above-mentioned stipulations will be enforced among others under the water (Prevention and Control of Pollution) Act, 1974, the Air (Prevention and Control of Pollution) Act, 1981, the Environment (Protection) Act 1986, the Hazardous Chemicals (Manufactures, storage and Import) Rules, 1989, the Coastal Regulation Zone Notification, 1991 and its subsequent amendments and the Public Liability Insurance Act, 1991 and the Rules made there under from time to time.</p> <p>The project proponents shall also ensure that the proposal complies with the provisions of the approved Coastal Zone Management Plan of Gujarat State.</p>	<p>DPA has obtained consolidated consent and authorization vide GPCB (Consent Order no-AWH-110594 dated of issue-8/12/2020, with a validity period up to 21/7/2025)- Detailed Order issued by the GPCB vide outward no. 581914 dated 22/1/2021 & subsequently, issued Correction in CC&A order vide letter no. PC/CCA-KUTCH-812(5)/GPCB ID 28494/588116 dated 9/4/2021. A copy of the same has already been communicated with the earlier compliance reports submitted. Further an amendment has issued by GPCB vide letter no. PC/CCA-KUTCH-812(6)/GPCB ID-28494/781072 dated 11/01/2024.</p> <p>DPA has been appointing a NABL-accredited laboratory to monitor environmental parameters, and reports are being submitted from time to the GPCB, IRO, MoEF&CC, GoI, and Gandhinagar. Recently, DPA appointed GEMI, Gandhinagar, to regularly monitor environmental parameters vide Work Order dated 15/02/2023. The work is in progress, and the latest environmental monitoring report submitted by GEMI, Gandhinagar, is attached herewith as Annexure C</p> <p>Public Liability Insurance is renewed from time to time as required. The Public Liability Insurance has been renewed and is valid till 23/07/2024. A copy of the same has already been communicated with the earlier compliance report submitted.</p> <p>Deendayal Port Authority had already obtained Coastal Regulation Zone Recommendations dated 14/02/2008 from the State Forest &Environment Department, Government of Gujarat, for the project.</p>

		All the 4 berths are under operation.
--	--	---------------------------------------

Annexure -A

DEENDAYAL PORT AUTHORITY
(Erstwhile: DEENDAYAL PORT TRUST)



www.deendayalport.gov.in

Administrative Office Building
Post Box NO. 50
GANDHIDHAM (Kutch).
Gujarat: 370 201.
Fax: (02836) 220050
Ph.: (02836) 220038

EG/WK/4660 (EC)/ Part V/ 06

Dated: 17/01/2025

To,
The Director (Env.) & Member Secretary,
Forest & Environment Department,
Govt. of Gujarat,
Gujarat Coastal Zone Management Authority,
Block No.14, 8th floor, Sachivalaya,
Gandhinagar – 382 010.

Sub: "Construction of 13th to 16th Cargo Berths at Kandla" by M/s Deendayal Port Authority (Erstwhile Deendayal Port Trust) – **Point wise Compliance to the stipulations in CRZ Recommendations req.**

Ref.: 1) Director (Env.)'s letter no.ENV-10-2006-138- P dated 14/2/2008
2) KPT letter no. EG/WK/4660 (EC)/Part III/1088 dated 9/12/2013
3) KPT letter no. EG/WK/4660 (EC)/Part III/252 dated 19/5/2014
4) KPT letter no. EG/WK/4660 (EC)/Part III/199 dated 14/11/2014
5) KPT letter no. EG/WK/4660 (EC)/Part III/255 dated 11/05/2015
6) KPT letter no. EG/WK/4660 (EC)/Part III/163 dated 15/10/2015
7) KPT letter no. EG/WK/4660 (EC)/Part III/132 dated 09/05/2016
8) KPT letter no. EG/WK/4660(EC)/Part IV/168 dated 26/12/2016
9) DPT letter no. EG/WK/4660(EC)/Part V/324 dated 26/06/2018
10) DPT letter no. EG/WK/4660(EC)/Part V/54 dated 14(16)/02/2019
11) DPT letter no. EG/WK/4660(EC)/Part V/206 dated 30(6)/11(12)/2019
12) DPT letter no. EG/WK/4660(EC)/Part V/108 dated 15/01/2021
13) DPT letter no. EG/WK/4660(EC)/Part V/91 dated 07/10/2021
14) DPA letter no. EG/WK/4660 (EC)/Part V dated 28/03/2022
15) DPA letter no. EG/WK/4660 (EC)/Part V/150 dated 19/07/2022
16) DPA letter no. EG/WK/4660 (EC)/Part V/231 dated 02/02/2023
17) DPA letter no. EG/WK/4660 (EC)/Part V/351 dated 14/08/2023
18) DPA letter no. EG/WK/4660 (EC)/Part V/38 dated 19/03/2024
19) DPA letter no. EG/WK/4660 (EC)/Part V/94 dated 24/07/2024

Sir,

It is requested to kindly refer the above cited references for the said subject.

In this connection, it is to state, that Director (Environment), Forest & Environment Department, GoG vide above referred letter dated 14/2/2008 had granted CRZ Recommendations for the subject proposal. Accordingly, Deendayal Port Authority (Erstwhile Deendayal Port Trust) had regularly submitted point wise compliance report to the stipulated conditions in CRZ Recommendations.

...Cont.....


In this regard, as requested under General condition no. 21 in the above referred letter dated 14/2/2008 i.e. A six-monthly report on compliance of the conditions mentioned in this letter shall have to be furnished by the DPA on a regular basis to this Department and MoEF&CC, GoI, please find enclosed herewith compliance report of Deendayal Port Authority along with necessary annexure (**Annexure 1**) for the period upto September, 2024 for kind information and record please.

Further, as per the MoEF&CC, Notification S.O.5845 (E) dated 26.11.2018, stated that "**In the said notification, in paragraph 10, in sub-paragraph (ii), for the words "hard and soft copies" the words "soft copy" shall be substituted**". Accordingly, we are submitting herewith soft copy of the same via e-mail ID gczma.crz@gmail.com & direnv@gujarat.gov.in.

This has the approval of the Chief Engineer, Deendayal Port Authority.

Thanking you.

Yours faithfully,

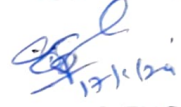

Dy. Chief Engineer & EMC(I/c)
Deendayal Port Authority

Copy to:

Shri Amardeep Raju,
Scientist E, Ministry of Environment Forests & Climate change,
& Member Secretary (EAC-Infra 1),
Indira Paryavaran Bhavan,
3rd Floor, Vayu Wing, Jor Bagh Road, Aliganj,
New Delhi - 110 003.
Email Id: ad.raju@nic.in

Annexure 1

Compliance Report for the Period up to September 2024.

Name of Work: Construction of 13th to 16th Cargo Berth at Kandla, District Kachchh.

CRZ Recommendations: Letter No. ENV-I0-2006-138-P dated 14/02/2008 of Director (Environment), Forest & Environment Department, GoG. Further, the Ministry of Environment & Forest–New Delhi, Govt. of India accorded the Environmental/ CRZ clearance vide letter no. 11-70/2006-IA.III dated Sep 2008 & the validity of the same had been extended by MoEF, GoI vide letter No.F.NO.11–70/2006–IA.III dated 7th February, 2014 for a further period of 5 years.

STATUS OF Berths:

13th Cargo Berth: Under operation since 18/2/2013.

15th Cargo Berth: Under Operation since 16/11/2013.

14th Cargo Berth: Under Operation since 8/4/2019.

16th Cargo Berth: Under Operation since 10/3/2019.

CONSENT TO OPERATE:

Consolidated Consent & Authorization (CC&A) issued by the GPCB (Consent Order no. AWH-110594 dated issue-8/12/2020, with a validity period up to 21/7/2025)– Detailed Order issued by the GPCB vide outward no. 581914 dated 22/1/2021 & subsequently, issued Correction in CC&A order vide letter no. PC/CCA-KUTCH-812(5)/GPCB ID 28494/588116 dated 9/4/2021.

Sr. No.	Conditions in CRZ Recommendation Letter	Compliance
Specific Conditions		
1	The provisions of the CRZ notification of 1991 and subsequent amendments issued from time to time shall be strictly adhered to by the KPT. No activity in contradiction to the Provisions of the CRZ Notification shall be carried out by the KPT.	All the 4 berths are under operation. The provisions of the CRZ notification of 1991 and subsequent amendments issued from time to time are being strictly followed by Deendayal Port Authority (Erstwhile Deendayal Port Trust).
2	The KPT shall participate financially for installing and operating the Vessel Traffic Management System in the Gulf of Kachchh and shall also take lead in preparing and operationalizing and updating regularly after getting it vetted by the Indian Coast Guard.	DPA had already contributed an amount of Rs. 41.25 Crores for installing and operating the VTMS in the Gulf of Kachchh. VTMS has been handed over to the Directorate General of Lighthouse and Lightships, Ministry of Shipping, and GoI for operating and updating regularly to statutory authorities.
3	The KPT shall strictly ensure that no creeks or rivers are blocked due to any activity at Kandla.	All the four berths are under operation
4	Mangrove plantation in an area of 1000 ha. Shall be carried out by the KPT within 5 years in time bound manner on Gujarat coastline either within or outside the Kandla port Trust area at an appropriate place in consultation with the Forest and Environment Department. A six-monthly compliance report along with the satellite images shall be submitted to the Ministry of Environment and Forest as well as to this Department without fail.	As per the directions of the GCZMA and MoEF&CC, GoI, to date, DPA has undertaken a Mangrove Plantation in an area of 1600 Hectares since the year 2005. The details have already been communicated with the earlier compliance reports submitted. It is also relevant to submit here that, as per the direction of the Gujarat Coastal Zone Management Authority, DPA had already prepared & submitted a report on mangrove conservation and management plan formulated by Gujarat Institute of Desert Ecology during the study period of Jan-April, 2015 (Report already submitted along with earlier compliance reports submitted). For regular monitoring, DPA vide work order dated 3/5/2021 has assigned work to M/s GUIDE, Bhuj, for Monitoring of mangrove plantation carried out by DPA (Period from 24/5/2021 to 23/5/2022). The final report submitted by GUIDE, Bhuj has already been communicated with the earlier compliance report submitted. Further DPA has assigned work to M/s GUIDE, Bhuj vide work order dated 10/06/2024 for "Monitoring of Mangrove Plantation 1600 Ha carried out by DPA" for the Period of 10/06/2024 to 09/06/2025. The Inception report submitted by GUIDE,

		Bhuj is attached here as Annexure A
5	No activities other than those permitted by the competent authority under the CRZ Notification shall be carried out in the CRZ area.	All the four berths are under operation
6	No groundwater shall be tapped for any purpose during the proposed expansion modernization activities.	All the four berths are under operation
7	All necessary permissions from different Government Departments / agencies shall be obtained by the KPT before commencing the expansion activities.	DPA obtained Consolidated Consent & Authorization (CC&A) from the GPCB vide Consent Order no AWH-110594 date of issue-8/12/2020, with a validity period up to 21/7/2025- Detailed Order issued by the GPCB vide outward no. 581914 dated 22/1/2021 & subsequently, issued Correction in CC&A order vide letter no. PC/CCA-KUTCH-812(5)/GPCB ID 28494/588116 dated 9/4/2021 (The copy of the Order has already been communicated with the earlier compliance report submitted).
8	No effluent or sewage shall be discharged into the sea/creek or in the CRZ area and It shall be treated to conform to the Norms prescribed by Gujarat Pollution Control Board and would be reused/recycled within the plant premises to the extent possible.	<p>Generated sewage is treated in DPA's existing STP (1.5 MLD capacity). In addition to that, it also has septic tanks at places where STP is inaccessible.</p> <p>The treated sewage is being used for gardening and plantation purposes.</p> <p>DPA has been appointing a NABL-accredited laboratory to monitor environmental parameters, and reports are being submitted from time to time to the GPCB, IRO, MoEF&CC, GoI, and Gandhinagar. Recently, DPA appointed GEMI, Gandhinagar, to regularly monitor environmental parameters vide Work Order dated 15/02/2023. The work is in progress, and the latest environmental monitoring report submitted by GEMI, Gandhinagar, is attached herewith as Annexure B.</p>
9	All the recommendations and suggestion given by the NIOT in their Comprehensive Environment Impact Assessment report for conservation / protection and betterment of environment shall be implemented strictly by the KPT.	<p>Currently, all the four berths are under operation.</p> <p>As per the directions of the GCZMA and MoEF&CC, GoI, to date, DPA has undertaken a Mangrove Plantation in an area of 1600 Hectares since the year 2005. The details have already been communicated with the earlier compliance reports submitted.</p> <p>For regular monitoring, DPA vide work order dated 3/5/2021 has assigned work</p>

to M/s GUIDE, Bhuj for "Monitoring of mangrove plantation" carried out by DPA (Period from 24/5/2021 to 23/5/2022). The final report submitted by GUIDE, Bhuj, has already been communicated with the last compliance report submitted.

Further DPA has assigned work to M/s GUIDE, Bhuj vide work order dated 10/06/2024 for "Monitoring of Mangrove Plantation 1600 Ha carried out by DPA" for the Period of 10/06/2024 to 09/06/2025. The inception report submitted by GUIDE is attached herewith as **Annexure A.**

DPA assigned work to M/s GUIDE, Bhuj for "Regular monitoring of Marine Ecology in and around Deendayal Port Authority (Erstwhile Deendayal Port Trust) and continuous Monitoring Program covering all seasons on various aspects of the Coastal Environs" since 2017. The reports are being submitted time to time along with compliance reports submitted.

In continuation of same, DPA had issued work order to GUIDE, Bhuj for "Regular Monitoring of Marine Ecology in and around Deendayal Port Authority" for the year 2024-2027. The work is in progress. The work order is attached herewith as **Annexure C.**

To control fugitive emissions, DPA has installed Mist Canon in the Port area. Further, regular sprinkling through tankers on roads and other staking yards is being done to control dust pollution in other areas.

it is relevant to mention that Pollution under Control (PUC) Certificates have been made mandatory for vehicles in the port area.

For waste generated from ships, DPA issued a Grant of License/Permission to carry out the work of collection and disposal of "Hazardous Waste/Sludge/Waste Oil" and for removal of "Dry Solid Waste (Non- Hazardous)" from Vessels calling at Deendayal Port through DPA contractors. Further, all ships are required to follow DG Shipping circulars regarding the reception facilities at the Swachh Sagar portal.

Further, DPA vide work order dated

		<p>24/01/2023 has appointed GEMI, Gandhinagar, for "Preparation of Plan for Management of Plastic Wastes, Solid Waste including C&D waste, Hazardous wastes including Biomedical and Non-Hazardous Waste in the Deendayal Port Authority area". The Final report submitted by GEMI is attached herewith as Annexure D.</p> <p>DPA has been appointing a NABL-accredited laboratory to monitor environmental parameters, and reports are being submitted from time to time to the GPCB, IRO, MoEF&CC, GoI, and Gandhinagar. Recently, DPA appointed GEMI, Gandhinagar, to regularly monitor environmental parameters vide Work Order dated 15/02/2023. The work is in progress, and the latest environmental monitoring report submitted by GEMI, Gandhinagar, is attached herewith as Annexure B.</p>
10	The construction activities and dredging shall be carried out only under the constant supervision and guidelines of the NIOT.	All the four berths are currently under operation.
11	The KPT shall contribute financially for any common study or project that may be proposed by this Department for environmental management/conservation/improvement for the Gulf of Kachchh.	Point noted
12	The construction debris and/or any other of waste shall not be disposed of into the sea, creek or the CRZ areas. The debris shall be removed from the construction site immediately after the construction is over.	All the 4 berths are currently under operation.
	General Conditions	
13	The construction camps shall be located outside the CRZ area and the construction labour shall be provided with the necessary amenities, including sanitation, water supply and fuel and it shall be ensured that the environmental conditions are not deteriorated by the construction labours.	All the 4 berths are currently under operation.
14	The KPT shall bear the cost of the external agency that may be appointed by this Department for supervision / monitoring of proposed activities and the environmental impacts of the proposed activities.	Point noted
15	The KPT shall take up massive greenbelt development activities in	Deendayal Port Authority had taken up massive greenbelt development activities

	and around Kandla and also within the KPT limits.	<p>in and around Kandla, Residential colony, administrative building, etc.</p> <p>DPA had entrusted the work to the Forest Department, Gujarat, in August 2019 for developing a green belt in and around the Port area at a cost of Rs. 352 lakhs in an area of about 32 hectares, and the work is completed.</p> <p>Further, DPA has appointed the Gujarat Institute of Desert Ecology (GUIDE) for "Green belt development in Deendayal Port Authority and its Surrounding Areas, Charcoal site' (Phase-I) (5,000 plants)" vide Work Order No.EG/WK/4757/Part [Greenbelt GUIDE, dated 31st May 2022. The work is completed.</p> <p>Further, DPA assigned work to GUIDE, Bhuj, via a work order dated 23/06/2023 for "Green belt development in Deendayal Port Authority and its Surrounding Areas (Phase II) (10,000 plants). The Final report submitted by GUIDE is attached as Annexure E.</p>
16	The KPT shall have to contribute financially for talking up the socio-economic upliftment activities in this region in construction with the Forest and Environment Department and the District Collector / District Development Officer.	The details of CSR activities undertaken /to be undertaken by DPA are placed at Annexure F
17	A separate budget shall be earmarked for environmental management and socioeconomic activities and details there of shall be furnished to this Department as well as the MoEF, GOI. The details with respect to the expenditure from this budget head shall also be furnished.	<p>The allocation made under the scheme of "Environmental Services & Clearance thereof other related Expenditure" during BE 2024-25 is Rs. 657 Lakhs.</p> <p>The expenditure made under the "Environmental Services & Clearance of other related Expenditure" is Rs. 172 Lakhs from up to September 2024.</p>
18	A separate environmental management cell with qualified personnel shall be created for environmental monitoring and management during construction and operational phases of the project.	<p>DPA already has an Environment Management Cell. Further, the DPA has also appointed an expert agency to provide Environmental Experts from time to time.</p> <p>DPA appointed M/s Precitech Laboratories, Vapi, to provide Environmental Experts via a work order dated 5/2/2021.</p> <p>In addition, it is relevant to submit here that DPA has appointed a Manager (Environment) on a contractual basis for a period of 3 years, further extendable to 2 years (A copy of the details has already</p>

		been communicated with the last compliance report submitted).
19	An Environmental report indicating the changes, if any, with respect to the baseline environmental quality in the coastal and marine environment shall be submitted every year by the KPT to this Department as well as to the MoEF, GOI.	DPA has been appointing a NABL-accredited laboratory to monitor environmental parameters, and reports are being submitted from time to time to the GPCB, IRO, MoEF&CC, GoI, and Gandhinagar. Recently, DPA appointed GEMI, Gandhinagar, to regularly monitor environmental parameters vide Work Order dated 15/02/2023. The work is in progress, and the latest environmental monitoring report submitted by GEMI, Gandhinagar, is attached herewith as Annexure B .
20	The KPT shall have to contribute financially to support the National Green Corps Scheme being implemented in Gujarat by the GEER Foundation, Gandhinagar, in construction with Forests and Environment Department	Point noted
21	Six monthly reports on compliance of the conditions mentioned in this letter shall have to be furnished by the KPT on regular basis to this department/ MoEF, GOI.	DPA has regularly submitted the compliance reports to GCZMA, Gandhinagar, MoEF&CC, and GOI. The last compliance report of the conditions stipulated in CRZ recommendations issued by GCZMA was submitted on 24/07/2024.
22	Any other condition that may be stipulated by this department from time to time for environmental protection/management purpose shall also have to be complied with by the KPT.	Point noted

Annexure -B

INCEPTION REPORT
For the Project entitled

Monitoring of Mangrove Plantation (1600 ha) carried out by
Deendayal Port Authority, Kandla

DPA Work order No. EG/WK/4751/Part (Marine Ecology Monitoring)/70. Dt. 10.06.2024

Submitted by



Gujarat Institute of Desert Ecology
Mundra Road, Bhuj-370 001
Dist: Kachchh, Gujarat

Submitted to



Deendayal Port Authority
Gandhidham, Dist: Kachchh, Gujarat-370201

August-2024

Dr. V. Vijay Kumar
Director



**Gujarat Institute
of Desert Ecology**

Certificate

This is to state that the **Inception report** of the work entitled, "**Monitoring of Mangrove Plantation (1600 ha) carried out by Deendayal Port Authority, Kandla**" has been prepared in line with the Work order issued by DPA vide No. EG/WK/4751/Part (Marine Ecology monitoring) / 70. Dt. 10.06.2024.

This work order is for a period of one year (10.06.2024 – 09.06.2025) for the above-mentioned study.

Authorized Signatory
DIRECTOR
Gujarat Institute of Desert Ecology
Bhuj - Kachchh.



Institute Seal

Project Coordinator: Dr. V. Vijay Kumar, Director

Project Personnel

Principal Investigator

Dr. B. Balaji Prasath, Senior Scientist

Co-Investigator

Dr. Kapilkumar Ingle, Project Scientist-II

Team Members

Dr. Durga Prasad Behera, Scientist

Dr. L. Prabha Devi, Advisor

Mr. Dayesh Parmar, Senior Scientific Officer

Dr. Dhara Dixit, Project Scientist-I

Mr. Ketan Kumar Yogi, Junior Research Fellow

Mr. Arjan Rabari, Lab- Cum-Field Assistant

Mr. Jayanti Barot, Lab- Cum-Field Assistant

Table of Contents

1	Background	1
1.2	Rationale	2
1.3	Objectives of the Study	4
2	Study Area	4
3	3. Methodology	6-8
	3.1 Evaluation of mangrove plantation	
	3.1.1 Analysis of Soil bulk density	
	3.1.2 Total Organic carbon in mangrove soil (El Wakeel and Riley, 1956)	
	3.2 Carbon Sequestration Potential of Planted Mangroves	
	3.2.1 Sampling of Soil and Plant Biomass	
	3.2.2 Carbon content in Mangrove Biomass	
	3.2.3 Carbon biomass	
	3.2.4 Carbon biomass per hectare	
	3.2.5 Calculation of CO₂ equivalent	
4	References	10

1. Background

Mangroves are intricate ecosystems that shield coastal habitats from natural hazards. Mangrove forests, which account for less than 0.4% of the world's forests, are being destroyed at a rate of 1% per year. In some areas this could be higher with losses reaching up to between 2% -8 % (Friess *et al.*, 2020). The decline in mangrove ecosystem by the 1970s was severe as a result of natural and human activities alike. Since the beginning of the 1980s around 20%-35% of global mangrove areas have been lost. The most quantity of mangrove loss has been recorded in developing countries where there is little space for coastal and maritime development activities of various forms including; aquaculture, tourism and trade among others (Das *et al.*, 2022). This has prompted several researchers to target their restoration so as to recover their ecological and economical values. Gujarat state is no exception on this matter. The forests within these locations serve as one of the most productive and biologically diverse types on earth. Mangroves are found at different depths of saline environments; thus, they contain breathing roots or Pneumatophores. These roots provide shelter for various macro- and micro-faunal species. Thus, it is important to note that mangroves play a crucial role in carbon sequestration due to their ability to take up four times more carbon dioxide per unit area when compared with other terrestrial forest types (Akram *et al.*, 2023). Mangroves also support fishing industries, ecotourism alongside sequestering carbon economically. Over time, the scientific community globally realized significance associated with ecological roles played by mangroves as well as services offered by them. Despite its benefits however, there has been over exploitation and degradation of mangroves for various reasons such that the area under mangrove cover declined at an alarming rate and also poorly restored. As a result researchers have eventually embarked on attempts to restore mangroves through plantation/conservation.

India has a total coastline length of 7516.6 km distributed among nine maritime states and four Union Territories where Gujarat is the longest one with 1650 km. For instance, Indian mangrove habitats contain forty-six species comprising fourteen families belonging to twenty-two genera. Approximately, about 3% of global mangrove vegetation is found in India (FSI, 2021). Gujarat is the second biggest state in India with respect to its extent of Mangrove cover (1175Km²). Being woody habitats, the mangroves act as

important carbon sinks in coastal areas. Although contentions exist around fifteen species are reported from thirteen coastal districts of Gujarat. Out of this Southern coast of Gulf of Kachchh (GoK) and South Gujarat are important districts for mangrove diversity. GoK coastal stretch in Gujarat accounts for most part of it with an extent 986 Km² out of 1140 Km². The north coast of GoK is composed of Kachchh District alone, which has 798 km² of mangroves, accounting to 70% of Gujarat's total area. Mangroves belong to a diverse taxonomic group, the majority of which are dominated by four genera: *Avicennia*, *Rhizophora*, *Sonneratia* and *Bruguiera*. However, the presence / restoration activities in Gujarat have been one of the most successful examples amongst any habitat restoration projects around the globe with respect to mangrove ecosystems being made up of mostly by single species of *Avicennia marina* in Kachchh District. Many mangrove species require periodic flooding with fresh water for their propagation. In view of topography and more specifically that associated with Kachchh region and Gujarat state as a whole, permanent sources of fresh water at all times are hard to find. The coastal belt along GoK is characterized by aridity which often makes other species than *A. marina* less promising for planting mangroves. This situation makes it difficult for plantation / restoration of mangroves especially in semi-arid regions like Kachchh.

1.2 Rationale

Deendayal Port Authority (DPA) is one of India's major ports that handles large amounts of cargo. The port encompasses a large coastal area with extensive mangroves (193.1 km²) and mudflats (312.9 km²). The port authorities are committed to preserving and enhancing these coastal habitats. However, the construction and operation of port facilities can have a substantial impact on the local ecology. Therefore, efforts are being made to conserve and protect the DPA mangrove area to maintain its ecological services. This has led DPA to undertake a 1600-hectare mangrove plantation project from 2005-2023 in locations like Sat Saida Bet, Nakti creek, Kantiyajal among others. Evaluation of this planting endeavor for which 1600 hectares the work order has been handed over to Gujarat Institute for Desert Ecology (GUIDE), Bhuj. The conservation measures have been undertaken with the involvement of state and central government departments as well as local communities towards restoring and protecting the mangrove stands.

The present study will mainly focus on the assessment of the present status of the mangrove at Sat Saida bet and Nakti creek in the Kandla (Kachchh) and Kantiyajal in the Bharuch district covering ten blocks occupying an area of 1400 ha, where plantation

activities have been conducted during the period between 2005 and 2019. However, the present study (2024-2025) will also cover the additional 200 ha plantations carried out at Sat Saida bet (100 ha) and Kantiyajal (100 ha) during 2021 and 2023 with a total coverage area of 1600ha. The primary goal of this study is to assess the survival rate of mangrove plantations and the carbon sequestration potential of the planted mangroves and suggest achievable conservation measures. The details of the mangrove plantation work carried out in a phased manner by the DPA is presented in Table 1.

Table 1. Details of the implemented mangrove plantation activities by DPA

Location	Year of Plantation	Area (ha)	Species planted	Implementing Agency
Sat Saida Bet, Kachchh district	2005-2006	20	<i>A. marina</i>	Gujarat Institute of Desert Ecology, Bhuj
	2011-2012	200	<i>A. marina</i>	Forest Department, GoG
	2012-2013	300	<i>A. marina</i>	Forest Department, GoG
	2013-2014	330	<i>A. marina</i>	Forest Department, GoG
	2018-2019	50	<i>A. marina</i>	Gujarat Ecology Commission
	2022-2023	100	<i>A. marina</i>	Gujarat Ecology Commission
Nakti Creek, Kachchh district	2008-2009	50	<i>A. marina</i>	M/s. Patel Construction Co, Gandhidham
	2010-2011	100	<i>A. marina</i> <i>R. mucronata</i> <i>C. tagal</i>	Gujarat Ecology Commission
Kantiyajal,	2015-2016	150	<i>A. marina</i>	Gujarat Ecology

Bharuch District				Commission
	2016-2017	150	<i>A. marina</i> <i>R. mucronata</i>	Gujarat Ecology Commission
	2018-2019	50	<i>A. marina</i>	Gujarat Ecology Commission
	2021-2022	100	<i>A. marina</i>	Gujarat Ecology Commission
Total		1600		

1.3 Objectives of the Study

The present study is an attempt to analyse the rate of growth and survival, of the planted mangroves following the standard protocols and determinants of their health which are very much essential in conserving them. The Specific objectives are:

- To evaluate Gujarat Ecology Commission's (GEC) 1600 Ha mangrove plantations at Sat Saida Bet, Nakti creek in the Gulf of Kachchh and Kantiyajal in Bharuch district.
- To determine the extent of plantation, sapling health, survival rate of the planted species
- Evaluation of soil composition, bulk density
- To expound on the composition and distribution of natural mangrove
- To review the below ground carbon stock potential of the surviving mangrove plantation in view of the climate change.

2. Study area

The information of geological coordinates, maps and other details of sites of mangrove plantation by DPA in previous years, will be provided by DPA authorities. The sites are located in three different places, those are Kantiyajal (Bharuch), Sat saida Bet (Kachchh) and Nakti creek (Kachchh). The plantation sites will be confirmed by DPA authorities in the site visiting. At the time of evaluation, the team members from DPA will be available to confirm the sites and location of plantations Fig. 1.

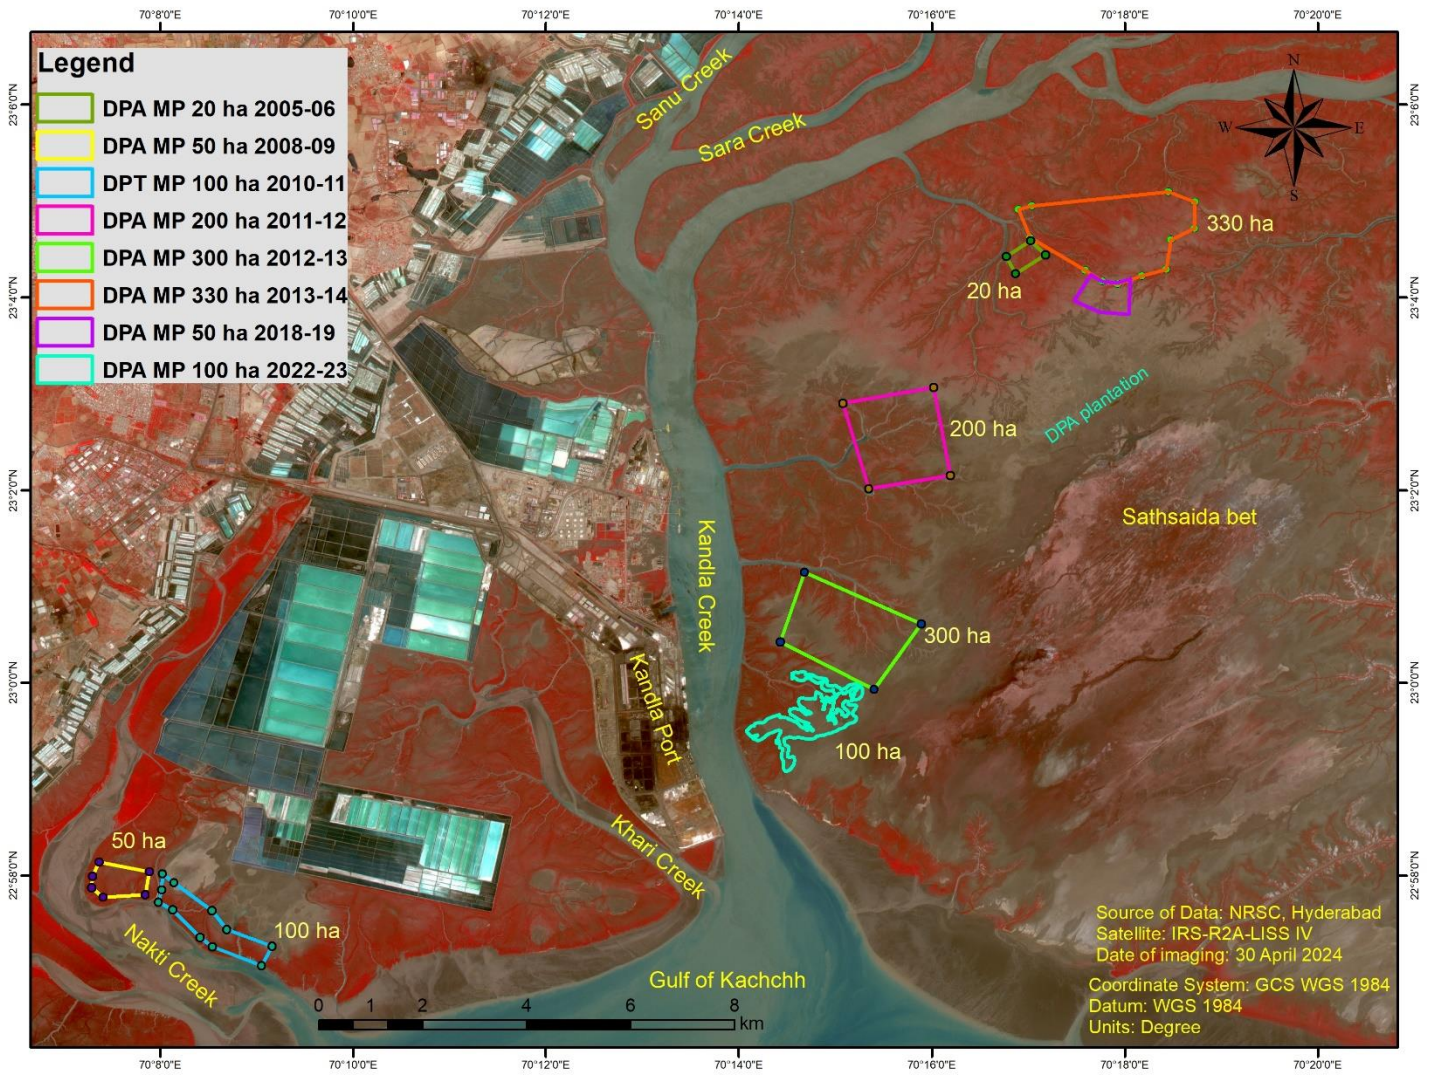


Fig. 1 Mangrove plantation Site in DPA environ

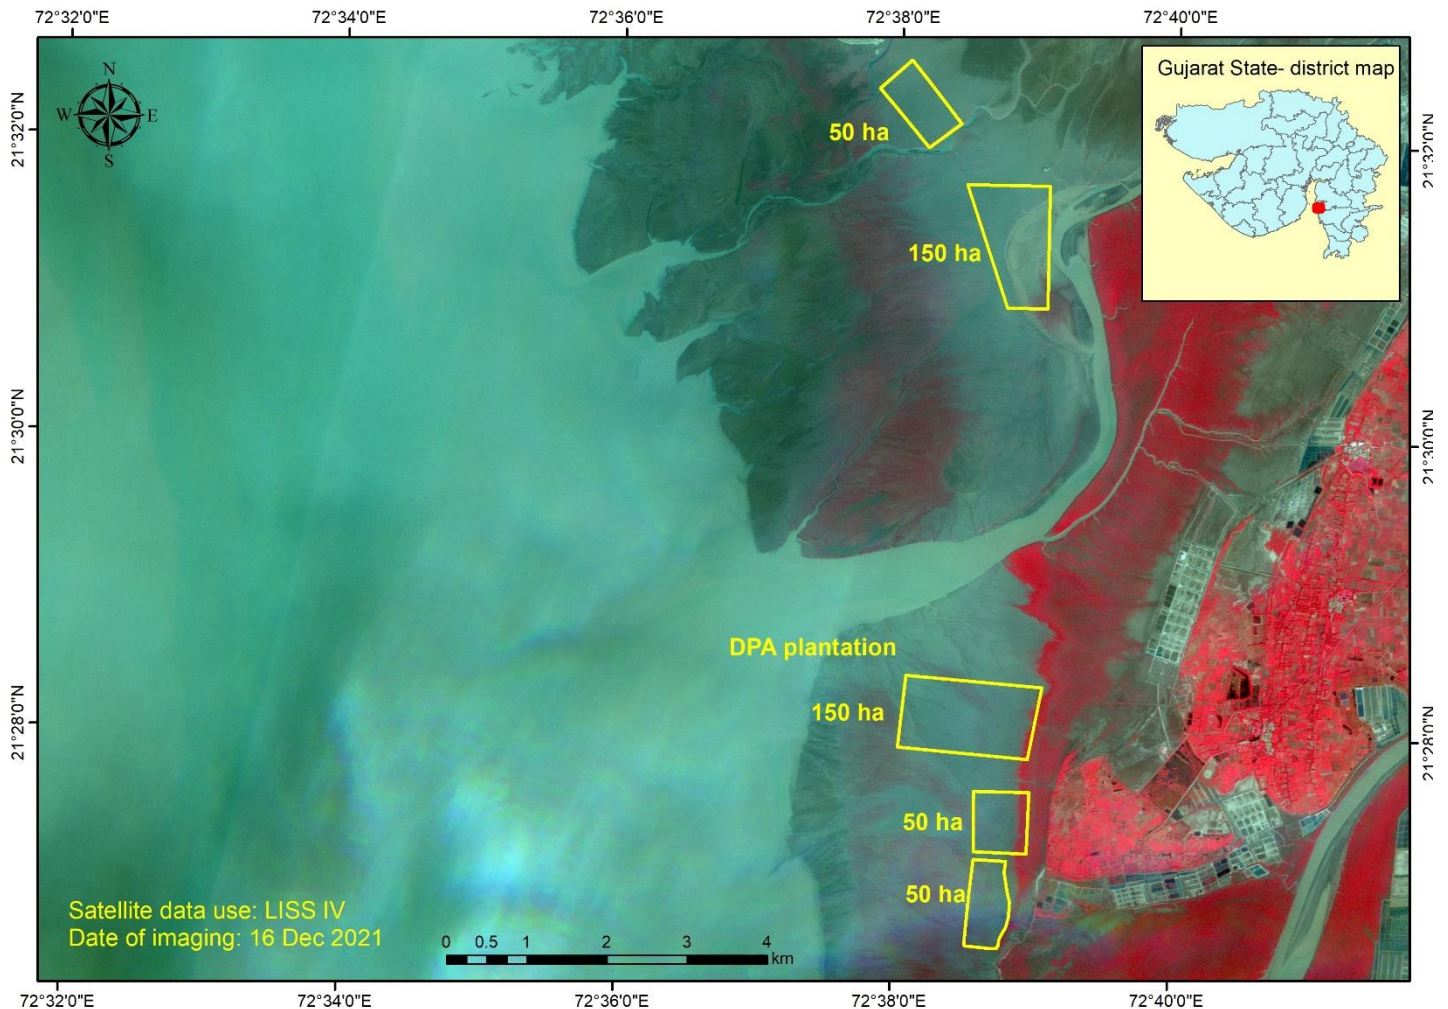


Fig. 2 Mangrove plantation Site in Kantiyajal, Bharuch

3. Methodology

3.1 Evaluation of mangrove plantation

To assess the overall plantation success at the plantation site at Sat Saida bet, Nakti creek and Kantiyajal, field surveys will be undertaken from September 2024 to April 2025. The mangrove plantation's survival percentage will be assessed by dividing the area into uniform grids. To show the survival status, density of transplanted saplings, and its grid number randomly selected areas will be counted for all surviving saplings, adopting quadrature method on the selected 10×10 m plots at the sampling sites. In all the selected sites, height and number of

stems, canopy and other characteristics will be recorded. Before the survey takes place, all these plantation sites will be marked on Google map using their GIS Co-ordinates. Similarly, once with local maps as well as other relevant information will be obtained from the DPA officials or implementing agencies including Plantation registers, along with the personnel representatives involved in the plantation. A boat survey will be undertaken to evaluate around the study location and mangrove formations along creeks systems.

3.1.1 Analysis of Soil bulk density

Volume of known amount (20 g) of dry soil sample will be noted and to this a known volume of water (50 ml) will be added. At least 5 ml of water above the soil surface and kept in an undisturbed condition for 30 minutes. The final volume of soil plus water was noted and bulk density was calculated as follows:

$$\text{Bulk density} = \text{weight of soil (g)} / \text{Volume of soil (g/ml)}$$

3.1.2 Total Organic carbon in mangrove soil (El Wakeel and Riley, 1956)

Total organic carbon (TOC) (%) will be estimated following the Chromic acid digestion and Phenonthroline indicator (El Wakeel and Riley, 1956), wherein the organic matter is oxidized with a mixture of Potassium dichromate and concentrated Sulphuric acid, utilizing the heat of dilution of the acid to speed up the process. The unspent Potassium dichromate is back titrated against Ferrous sulphate solution.

The Total carbon calculation is as follows:

$$\text{Ferrous ammonium sulphate (ml) (T)} = \text{Blank} - \text{Sample}$$

$$\text{Total organic carbon (TOC) in sediment soil (mgC/g) (X)} = 1.14 \times 0.6 \times T$$

$$\text{Total organic carbon (TOC) in sediment soil (\%)} = X / 10$$

$$\text{Total carbon in sediment soil (\%)} = \text{TOC} \div 2$$

3.1.3 Calculation of carbon stock in sediment soil

Carbon stock in sediment soil up to 100 cm was calculated as follows:

$$\text{Carbon stock in sediment (\%)} = \text{Bulk density (g.cm}^{-3}\text{)} \times \text{Total carbon (\%)} \times \text{Soil depth interval (cm)}$$

3.2 Carbon Sequestration Potential of Planted Mangroves

3.2.1 Sampling of Soil and Plant Biomass

Sampling sites for soil/sediment and mangroves will be identified through reconnaissance survey. The survey and sampling involve (i) identification of sites for sampling in and around the study area, (ii) collection of soil/sediment and mangrove (iii) processing the samples for TOC (%), bulk density and plant biomass estimations.

3.2.2 Carbon content in Mangrove Biomass

The mangrove girth is generally measured at 1.3 m height for achieving tree diameter. However, since the present stands will be young the whole plant is uprooted for assessing biomass. Mangrove samples will be collected by complete uprooting of the individual at each site. Individual plants are then packed and labeled. The plant samples will be washed thoroughly under tap water several times with deionized water, drained, and then chopped and separated into root and shoot using a plant cutter. Fresh weight of the samples will be noted and subsequently oven dried till constant weight. Total biomass will be directly estimated by summing the dry weight from the wet biomass value.

3.2.3 Carbon biomass

The biomass is then converted into carbon biomass by multiplying by a factor of 0.42, i.e.

$$\text{Carbon biomass} = \text{Total biomass} \times 0.42$$

3.2.4 Carbon biomass per hectare

Carbon biomass was calculated per hectare by multiplying the carbon biomass with tree density per hectare, i.e.

$$\text{Carbon biomass (kg/ha)} = \text{carbon biomass} \times \text{density of plants per hectare}$$

$$\text{Carbon biomass (Mg/ha)} = (\text{carbon biomass} \times \text{density of plants per hectare}) / 1000$$

3.2.5 Calculation of CO₂ equivalent

Carbon biomass value is converted into carbon dioxide equivalent by multiplying carbon biomass with 3.67

$$\text{i.e. CO}_2 \text{ equivalent (\%)} = \text{carbon biomass} \times 3.67$$

Table 2: Timeline Work plan for 12 months (Jun-24 –Jun-25)

Activity	Months											
	Jun	Jul	Aug	Sep	Oct	Nov	Dec	Jan	Feb	Mar	Apr	May
<ul style="list-style-type: none"> Review of literature related to the study Planning of the project Initiation of Inception study Submission of Inception report 												
<ul style="list-style-type: none"> Survey of mangrove plantation site at Kantiyajal (450 Ha) and analysis all parameters 												
<ul style="list-style-type: none"> Survey of mangrove plantation site at Sat Saida bet, Nakti creek (1150 Ha) and analysis all parameters 												
<ul style="list-style-type: none"> Evaluation of Mangrove Plantation 												
<ul style="list-style-type: none"> Submission of Final Report for Comments and revisions, if any. 												
<ul style="list-style-type: none"> Submission of Final Report 												

4. References

- Friess, D.A.,E.S. Yando, G.M.O. Abuchahla, J.B. Adams, S. Cannicci, S.W.J. Canty, K.C. Cavanaugh, R.M. Connolly, N. Cormier, F. Dahdouh,Guebas, K. Diele, I.C. Feller, S. Fratini, T.C. Jennerjahn, S.Y. Lee, D.E. Ogurcak, X. Ouyang, K. Rogers, J.K. Rowntree, S. Sharma, T.M. Sloey, A.K.S. Wee. Mangroves give cause for conservation optimism, for now *Curr. Biol.*, 30 (2020), pp. R153-R154.
- Das, S.C.; Das, S.; Tah, J. Mangrove Forests and People's Livelihoods. In *Mangroves: Biodiversity, Livelihoods and Conservation*; Das, S.C., Pullaiah, T., Ashton, E.C., Eds.; Springer Nature: Singapore, 2022; pp. 153–173.
- Akram H, Hussain S, Mazumdar P, Chua KO, Butt TE, Harikrishna JA. Mangrove Health: A Review of Functions, Threats, and Challenges Associated with Mangrove Management Practices. *Forests*. 2023; 14(9):1698. <https://doi.org/10.3390/f14091698>
- El Wakeel, S. K. and Riley, J. P. 1956. The determination of organic carbon in marine muds. *J. Cons.*, 22: 180–183.
- FSI, (2021). India state of forest report. Ministry of Environment Forest and Climate Change Dehradun.

Annexure -C

Environmental Monitoring Report (EMR)

prepared under

“Preparing and monitoring of environmental monitoring and management plan for Deendayal Port Authority at Kandla and Vadinar for a period of 3 years”

(Monitoring Period: June-July 2024)



Document Ref No.: GEMI/DPA/782(2)(3)/2024-25/121

Submitted to:

Deendayal Port Authority (DPA), Kandla



Gujarat Environment Management Institute (GEMI)

(An Autonomous Institute of Government of Gujarat)

GEMI Bhavan, 246-247, GIDC Electronic Estate, Sector-25, Gandhinagar-382025

“AN ISO 9001:2015, ISO 14001:2015 AND ISO 45001:2018 Certified Institute”



© Gujarat Environment Management Institute (GEMI)

All rights reserved. This “Environment Monitoring Report (June-July 2024)” is prepared as a part of the project “Preparing and monitoring of Environmental monitoring and Management plan for Deendayal Port Authority at Kandla and Vadinar for a period of 3 years”. No part of this report may be reproduced, distributed or transmitted, in any form or by any means, electronic, mechanical, photocopying, recording or otherwise, without the prior permission of Director, Gujarat Environment Management Institute (GEMI).

Disclaimer:

Gujarat Environment Management Institute (GEMI) has taken all reasonable precautions in the preparation of this report. The data presented in this report have been collected as per the relevant Standard Operating Procedures, Protocols and Guidelines. GEMI believes that the information and facts presented in the report are accurate as on the date it was written. However, it is impossible to dismiss absolutely, the possibility of errors or omissions. GEMI therefore specifically disclaims any liability resulting from the use or application of the information contained in this report. The information is not intended to serve as legal advice related to the individual situation.



About this Document

Gujarat Environment Management Institute (GEMI) has been assigned with the work of “Preparing and monitoring of Environmental monitoring and Management plan for Deendayal Port Authority (DPA) at Kandla and Vadinar for a period of 3 years” by DPA, Kandla. Under the said project the report titled “*Environment Monitoring Report (June-July 2024)*” is prepared.

- **Name of the Report:** *Environment Monitoring Report (June-July 2024)*
- **Date of Issue:** 10/09/2024
- **Version:** 1.0
- **Report Ref.:** GEMI/DPA/782(2)(3)/2024-25/121



Table of Contents

CHAPTER 1: INTRODUCTION.....	1
1.1 Introduction	2
1.2 Green Ports Initiative.....	2
1.3 Importance of EMP	3
1.4 Objectives and scope of the Study	4
CHAPTER 2: METHODOLOGY.....	6
2.1 Study Area	7
a. Kandla.....	7
b. Vadinar	7
2.2 Environmental Monitoring at Kandla and Vadinar.....	11
CHAPTER 3: METEOROLOGY MONITORING.....	13
3.1 Meteorology Monitoring.....	14
3.2 Results and discussion	16
3.3 Data Interpretation and Conclusion.....	17
CHAPTER 4: AMBIENT AIR QUALITY MONITORING	20
4.1 Ambient Air Quality.....	21
4.2 Result and Discussion	27
4.3 Data Interpretation and Conclusion.....	33
4.4 Remedial Measures:.....	35
CHAPTER 5: DG STACK MONITORING	37
5.1 DG Stack Monitoring.....	38
5.2 Result and Discussion	41
5.3 Data Interpretation and Conclusion.....	41
CHAPTER 6: NOISE MONITORING.....	42
6.1 Noise Monitoring	43
6.2 Result and Discussion	47
6.3 Data Interpretation and Conclusion.....	48
6.4 Remedial Measures.....	48
CHAPTER 7: SOIL MONITORING.....	49
7.1 Soil Quality Monitoring:	50
7.2 Result and Discussion	54



7.3	Data Interpretation and Conclusion.....	54
CHAPTER 8: DRINKING WATER MONITORING		57
8.1	Drinking Water Monitoring.....	58
8.2	Result and Discussion	63
8.3	Data Interpretation and Conclusion.....	65
8.4	Remedial Measures.....	67
CHAPTER 9: SEWAGE TREATMENT PLANT MONITORING		68
9.1	Sewage Treatment Plant (STP) Monitoring:.....	69
9.2	Result and Discussion	75
9.3	Data Interpretation and Conclusion.....	77
9.4	Remedial Measures:.....	77
CHAPTER 10: MARINE WATER QUALITY MONITORING		79
10.1	Marine Water	80
10.2	Result and Discussion	84
10.3	Data Interpretation and Conclusion.....	86
CHAPTER 11: MARINE SEDIMENT QUALITY MONITORING.....		89
11.1	Marine Sediment Monitoring.....	90
11.2	Result and Discussion	94
11.3	Data Interpretation and Conclusion.....	94
CHAPTER 12: MARINE ECOLOGY MONITORING		98
12.1	Marine Ecological Monitoring.....	99
12.2	Result and Discussion	106
Annexure 1: Photographs of the Environmental Monitoring conducted at Kandla		115
Annexure 2: Photographs of the Environmental Monitoring conducted at Vadinar.....		116

List of Tables

Table 1: Details of Automatic Weather Station.....	14
Table 2: Automatic Weather Monitoring Station details.....	14
Table 3: Meteorological data for Kandla and Vadinar.....	16
Table 4: Details of Ambient Air monitoring locations.....	21
Table 5: Parameters for Ambient Air Quality Monitoring.....	27
Table 6: Summarized results of PM ₁₀ , PM _{2.5} , SO ₂ , NO _x , VOC and CO for Ambient Air quality monitoring.....	27
Table 7: Summarized results of Benzene for Ambient Air quality monitoring	33
Table 8: Summarized results of Polycyclic Aromatic Hydrocarbons	33



Table 9: Summarized results of Non-methane VOC.....	33
Table 10: Details of DG Stack monitoring locations.....	38
Table 11: DG stack parameters.....	41
Table 12: DG monitoring data.....	41
Table 13: Details of noise monitoring locations.....	43
Table 14: Details of the Noise Monitoring.....	46
Table 15: Ambient Air Quality norms in respect of Noise.....	46
Table 16: The Results of Ambient Noise Quality.....	47
Table 17: Details of the Soil quality monitoring.....	50
Table 18: Soil parameters.....	51
Table 19: Soil Quality for the sampling period.....	54
Table 20: Details of Drinking Water Sampling Locations.....	58
Table 21: List of parameters for Drinking Water Quality monitoring.....	61
Table 22: Summarized results of Drinking Water quality.....	63
Table 23: Details of the monitoring locations of STP.....	69
Table 24: Treated effluent Standards (as per CC&A of Kandla STP).....	69
Table 25: Norms of treated effluent as per CC&A of Vadinar STP.....	72
Table 26: List of parameters monitored for STP's at Kandla and Vadinar.....	75
Table 27: Water Quality of inlet and outlet of STP of Kandla.....	76
Table 28: Water Quality of inlet and outlet of STP of Vadinar.....	76
Table 29: Details of the sampling locations for Marine water.....	80
Table 30: List of parameters monitored for Marine Water.....	83
Table 31: Results of Analysis of Marine Water Sample for the sampling period.....	85
Table 32: Details of the sampling locations for Marine Sediment.....	90
Table 33: List of parameters to be monitored for Sediments at Kandla and Vadinar.....	93
Table 34: Summarized result of Marine Sediment Quality.....	94
Table 35: Standard Guidelines applicable for heavy metals in sediments.....	96
Table 36: Comparison of Heavy metals with Standard value in Marine Sediment.....	96
Table 37: Details of the sampling locations for Marine Ecological.....	99
Table 38: List of parameters to be monitored for Marine Ecological Monitoring.....	102
Table 39: Values of Biomass, Net Primary Productivity (NPP), Gross Primary Productivity (GPP), Pheophytin and Chlorophyll for Kandla and Vadinar.....	106
Table 40: Phytoplankton variations in abundance and diversity in sub surface sampling stations.....	109
Table 41: Species richness Index and Diversity Index in Phytoplankton.....	110
Table 42: Zooplankton variations in abundance and diversity in sub surface sampling stations.....	111
Table 43: Species richness Index and Diversity Index in Zooplankton.....	111
Table 44: Benthic Fauna variations in abundance and diversity in sub surface sampling....	112
Table 45: Species richness Index and Diversity Index in Benthic Organisms.....	113



List of Maps

Map 1: Locations of Kandla and Vadinar	8
Map 2: Locations of Kandla Port.....	9
Map 3: Locations of Vadinar Port.....	10
Map 4: Locations for Ambient Air Monitoring at Kandla.....	24
Map 5: Locations for Ambient Air Monitoring at Vadinar	25
Map 6: Locations for DG Stack monitoring at Kandla.....	39
Map 7: Locations for DG Stack monitoring at Vadinar	40
Map 8: Locations for Noise Monitoring at Kandla.....	44
Map 9: Locations for Noise Monitoring at Vadinar	45
Map 10: Locations for Soil Quality Monitoring at Kandla	52
Map 11: Locations for Soil Quality Monitoring at Vadinar	53
Map 12: Locations for Drinking Water Monitoring at Kandla	59
Map 13: Locations for Drinking Water Monitoring at Vadinar.....	60
Map 14: Locations for STP Monitoring at Kandla	73
Map 15: Locations for STP Monitoring at Vadinar	74
Map 16: Locations for Marine Water Monitoring at Kandla	81
Map 17: Locations for Marine Water Monitoring at Vadinar.....	82
Map 18: Location of Marine Sediment Monitoring at Kandla.....	91
Map 19: Locations of Marine Sediment Monitoring at Vadinar.....	92
Map 20: Locations of Marine Ecological Monitoring at Kandla.....	100
Map 21: Locations of Marine Ecological Monitoring at Vadinar	101

List of Figures

Figure 1: Methodology flow chart	12
Figure 2: Photographs of Automatic Weather Monitoring Station at Kandla and Vadinar....	15
Figure 3: Process flow diagram of STP at Kandla	70
Figure 4: Process flow diagram of STP at Gopalpuri.....	71
Figure 5: Process flowchart for the STP at Vadinar.....	72

List of Graphs

Graph 1: Spatial trend in Ambient PM ₁₀ Concentration.....	32
Graph 2: Spatial trend in Ambient PM _{2.5} Concentration	31
Graph 3: Spatial trend in Ambient SO _x Concentration.....	32
Graph 4: Spatial trend in Ambient NO _x Concentration.....	31
Graph 5: Spatial trend in Ambient CO Concentration	32
Graph 6: Spatial trend in Ambient Total VOCs.....	32



List of Abbreviations

A	Acceptable Limits as per IS: 10500:2012
AAQ	Ambient Air Quality
AWS	Automatic Weather monitoring stations
BIS	Bureau of Indian Standards
BOD	Biochemical Oxygen Demand
BQL	Below Quantification Limit
CCA	Consolidated Consent & Authorization
CO	Carbon Monoxide
COD	Chemical Oxygen Demand
CPCB	Central Pollution Control Board
DO	Dissolved Oxygen
DPA	Deendayal Port Authority
EC	Electrical Conductivity
EMMP	Environmental monitoring and Management Plan
EMP	Environment Management Plan
FPS	Fine Particulate Sampler
FY	Financial Year
GEMI	Gujarat Environment Management Institute
IFFCO	Indian Farmers Fertiliser Cooperative Limited
IMD	India Meteorological Department
IOCL	Indian Oil Corporation Limited
LNG	Liquefied Natural Gas
MGO	Marine Gas Oil
MMTPA	Million Metric Tonnes Per Annum
MoEF	Ministry of Environment & Forests
MoEF&CC	Ministry of Environment, Forest and Climate Change
NAAQS	National Ambient Air Quality Standards
NO _x	Nitrogen oxides
NTU	Nephelometric Turbidity Unit
OOT	Off Shore Oil Terminal
OSR	Oil Spill Response
P	Permissible Limits as per IS: 10500:2012
PAH	Poly Aromatic Hydrocarbons
PM	Particulate Matter
PTFE	Polytetrafluoroethylene
RCC	Reinforced Concrete Cement
RDS	Respirable Dust Sampler
SAR	Sodium Adsorption Ratio
SBM	Single Bouy Mooring
SO _x	Sulfur oxides
STP	Sewage Treatment Plant
TC	Total Coliforms
TDS	Total Dissolved Solids
TOC	Total organic Carbon
TSS	Total Suspended Solids
VOC	Volatile Organic Compounds



CHAPTER 1: INTRODUCTION

1.1 Introduction

Kandla Port, also known as the Deendayal Port is a seaport in Kachchh District near the city of Gandhidham in Gujarat state in western India. Located on the Gulf of Kachchh, it is one of major ports on the western coast, and is located at 256 nautical miles southeast of the Port of Karachi in Pakistan and over 430 nautical miles north-northwest of the Port of Mumbai (Bombay). It is the largest port of India by volume of cargo handled. Deendayal Port's journey began in 1931 with the construction of RCC Jetty by Maharao Khengarji. Kandla was constructed in the 1950s as the chief seaport serving western India, after the independence of India. On 31st March 2016, Deendayal Port created history by handling 100 MMT cargo in a year and became the first Major Port to achieve this milestone. Deendayal Port Authority (DPA), India's busiest major port in recent years, is gearing up to add substantial cargo handling capacity with private sector participation. DPA has created new record by handling 137 MMTPA (at Kandla and Vadinar) during the financial year 2022-23. The DPA had commissioned the Off-shore Oil Terminal facilities at Vadinar in the year 1978, for which M/s. Indian Oil Corporation Limited (IOCL) provided Single Bouy Mooring (SBM) system, with a capacity of 54 MMTPA. Further, significant Quantum of infrastructural upgradation has been carried out & excellent maritime infrastructure has been created at Vadinar for the 32 MMTPA Essar Oil Refinery in Jamnagar District.

1.2 Green Ports Initiative

DPA is committed to sustainable development and adequate measures are being taken to maintain the Environmental well-being of the Port and its surrounding environs. Weighing in the environmental perspective for sustained growth, the Ministry of Shipping had started, Project Green Ports" which will help in making the Major Ports across India cleaner and greener. "Project Green Ports" will have two verticals - one is "Green Ports Initiatives" related to environmental issues and second is "Swachh Bharat Abhiyaan".

The Green Port Initiatives include twelve initiatives such as preparation and monitoring plan, acquiring equipment required for monitoring environmental pollution, acquiring dust suppression system, setting up of sewage/waste water treatment plants/ garbage disposal plant, setting up Green Cover area, projects for energy generation from renewable energy sources, completion of shortfalls of Oil Spill Response (OSR) facilities (Tier-I), prohibition of disposal of almost all kind of garbage at sea, improving the quality of harbour wastes etc.

DPA had also appointed GEMI as an Advisor for "Making Deendayal Port a Green Port-Intended Sustainable Development under the Green Port Initiatives. DPA has also signed MoU with Gujarat Forest Department in August 2019 for Green Belt Development in an area of 31.942 Ha of land owned by DPA. The plantation is being carried out by the Social Forestry division of Kachchh.

1.3 Importance of EMP

Port activities can cause deterioration of air and marine water quality in the surrounding areas due to multifarious activities. The pollution problems usually caused by port and harbour activities can be categorized as follows:

1. Air pollutant emissions due to ship emissions, loading and unloading activities, construction emission and emissions due to vehicular movement.
2. Coastal habitats may be destroyed and navigational channels silted due to causeway construction and land reclamation.
3. Deterioration of surface water quality may occur during both the construction and operation phases.
4. Harbour operations may produce sewage, bilge wastes, solid waste and leakage of harmful materials both from shore and ships.
5. Human and fish health may be affected by contamination of coastal water due to urban effluent discharge.
6. Oil pollution is one of the major environmental hazards resulting from port/harbour and shipping operations. This includes bilge oil released from commercial ships handling non-oil cargo as well as the more common threat from oil tankers.
7. Unregulated mariculture activities in the port and harbour areas may threaten navigation safety.

Hence, for the determination of levels of pollution, identification of pollution sources, control and disposal of waste from various point and non-point sources and for prediction of pollution levels for future, regular monitoring and assessment are required during the entire construction and operation phase of a major port. As per the Ministry of Environment, Forest and Climate Change (**MoEF&CC**), The Environmental Management Plan (EMP) is required to ensure sustainable development in the area surrounding the project. Hence, it needs to be an all encompasses plan consist of all mitigation measures for each item wise activity to be undertaken during the construction, operation and the entire life cycle to minimize adverse environmental impacts resulting from the activities of the project. for formulation, implementation and monitoring of environmental protection measures during and after commissioning of projects. The plan should indicate the details of various measures are taken and proposed to be taken for appropriate management of the environment of Deendayal Port Authority.

It identifies the principles, approach, procedures and methods that will be used to control and minimize the environmental and social impacts of operational activities associated with the port. An EMP is a required part of environmental impact assessment of a new port project but could also be evolved for existing ports. It is useful not only during the construction and operational phases of the new port but also for operation of existing ports to ensure the effectiveness of the mitigation measures implemented and to further provide guidance as to the most appropriate way of dealing with any unforeseen impacts.

It is extremely essential that port and harbour projects should have an Environmental Monitoring and Management Plan (EMMP), which incorporates monitoring of Ambient Air, Drinking Water, Noise, Soil, Marine (water, sediment, ecology) quality along with the collection of online meteorological data throughout the duration of the project.

To ensure the effective implementation of the EMP and weigh the efficiency of the mitigation measures, it is essential to undertake environmental monitoring both during construction and operation period. In view of the above, Gujarat Environment Management Institute (GEMI) has been awarded with the work “**Preparing and Monitoring of Environmental Monitoring and Management Plan for Deendayal Port Authority at Kandla and Vadinar for a period of 3 years**” vide letter No. EG/WK/EMC/1023/2011/III/239 dated: 15/02/2023 by DPA.

This document presents the Environmental Monitoring Report (EMR) for Kandla and Vadinar for the environmental monitoring done during the period from 17th March-16th April 2024.

1.4 Objectives and scope of the Study

In line with the work order, the key objective of the study is to carry out the Environmental Monitoring and preparation the Management Plan for Kandla and Vadinar for a period of 3 years". Under the project, Environmental monitoring refers to systematic assessment of ambient air, water (drinking and surface), soil, sediment, noise and ecology in order to monitor the performance and implementation of a project in compliance with Environmental quality standards and/or applicable Statutory norms.

The scope of work includes not limited to following:

1. To review the locations/stations of Ambient Air, Ambient Noise, drinking water, and Marine Water, Soil and Sediments monitoring within the impacted region in-and-around DPA establishment, in view of the developmental projects.
2. To assess the Ambient Air quality, quality at 6 stations at Kandla and 2 at Vadinar in terms of gases and particulate matter.
3. To assess the DG stack emissions (gases and particulate matter).
4. To assess Drinking water quality at twenty locations (18 at Kandla and 2 at Vadinar) in terms of Physical, Chemical and Biological parameters viz., Color, Odor, turbidity, conductivity, pH, Total Dissolved Solids, chlorides, Hardness, total iron, sulfate, NH₄, PO₄, and bacterial count on a monthly basis.
5. To assess the Marine water quality in terms of aquatic Flora and Fauna and Sediment quality in terms of benthic flora and fauna.
6. To assess Marine Water Quality and sediment in term of physical and chemical parameter.
7. To assess the trends of water quality in terms of Marine ecology by comparing the data collected over a specified time period.
8. Weekly sample collection and analysis of inlet & Outlet points of the Sewage Treatment Plant (STP) to check the water quality being discharged by DPA as per the CC&A.
9. Carrying out monthly Noise monitoring; twice a day at the representative stations for a period of 24 hours.
10. Meteorological parameters are very important from air pollution point of view, hence precise and continuous data collection is of utmost importance. Meteorological data on wind speed, wind direction, temperature, relative humidity, solar radiation and

rainfall shall be collected from one permanent station at DPA, Kandla and one permanent station at Vadinar.

11. To suggest mitigation measures, based on the findings of this study and also check compliance with Environmental quality standards, Green Port Initiatives, MIV 2030, and any applicable Statutory Compliance.
12. To recommend Environment Management Plans based on Monitoring programme and findings of the study.



CHAPTER 2: METHODOLOGY

2.1 Study Area

Under the study, the locations specified by Deendayal Port Authority for the areas of Kandla and Vadinar would be monitored. The details of the study area as follows:

a. Kandla

Deendayal Port (Erstwhile Kandla Port) is one of the twelve major ports in India and is located on the West Coast of India, in the Gulf of Kutch at 23001'N and 70013'E in Gujarat. The Major Port Authorities Act 2021 is the governing statute for Administration of Major Ports, under which, Deendayal Port Trust (DPT) has become Deendayal Port Authority (DPA). At Kandla, DPA has sixteen (16) cargo berths for handling various types of Dry Bulk Cargo viz, fertilizer, food grains, Coal, sulphur, etc.

- **Climatic conditions of Kandla**

Kandla has a semi-desert climate. Temperature varies from 25°C to 44°C during summer and 10°C to 25°C during winter. The average annual temperature is 24.8 °C. The average rainfall is 410 mm, most of which occurs during the monsoon from the months of June-to-September.

b. Vadinar


Vadinar is a small coastal town located in Devbhumi Dwarka district of the Gujarat state in India located at coordinates 22° 27' 16.20" N - 069° 40' 30.01". DPA had commissioned the Off Shore Oil Terminal (OOT) facilities at Vadinar in the year 1978, for which M/s. Indian Oil Corporation Limited (IOCL) provided Single Bouy Mooring (SBM) system, with a capacity of 54 MMTPA. The OOT of the DPA contributes in a large way to the total earnings of this port. Vadinar is now notable due to the presence of two refineries-one promoted by Reliance Industries and Essar Oil Ltd.

DPA also handled 43.30 MMT at Vadinar (which includes transshipment), the containerized cargo crossed 4.50 lakh TEU, grossing a total of 100 MMT overall. Major commodities handled by the Deendayal Port are Crude Oil, Petroleum product, Coal, Salt, Edible Oil, Fertilizer, etc.

- **Climatic conditions of Vadinar**

Vadinar has a hot semi-arid climate. The summer season lasts from March-to-May and is extremely hot, humid, but dry. The climatic conditions in Vadinar are quite similar to that recorded in its district head quarter i.e., Jamnagar. The annual mean temperature is 26.7 °C. Rainy season with extremely erratic monsoonal rainfall that averages around 630 millimetres. The winter season is from October-to-February remains hot during the day but has negligible rainfall, low humidity and cool nights.

The Kandla and Vadinar port have been depicted in the **Map 1** as follows:

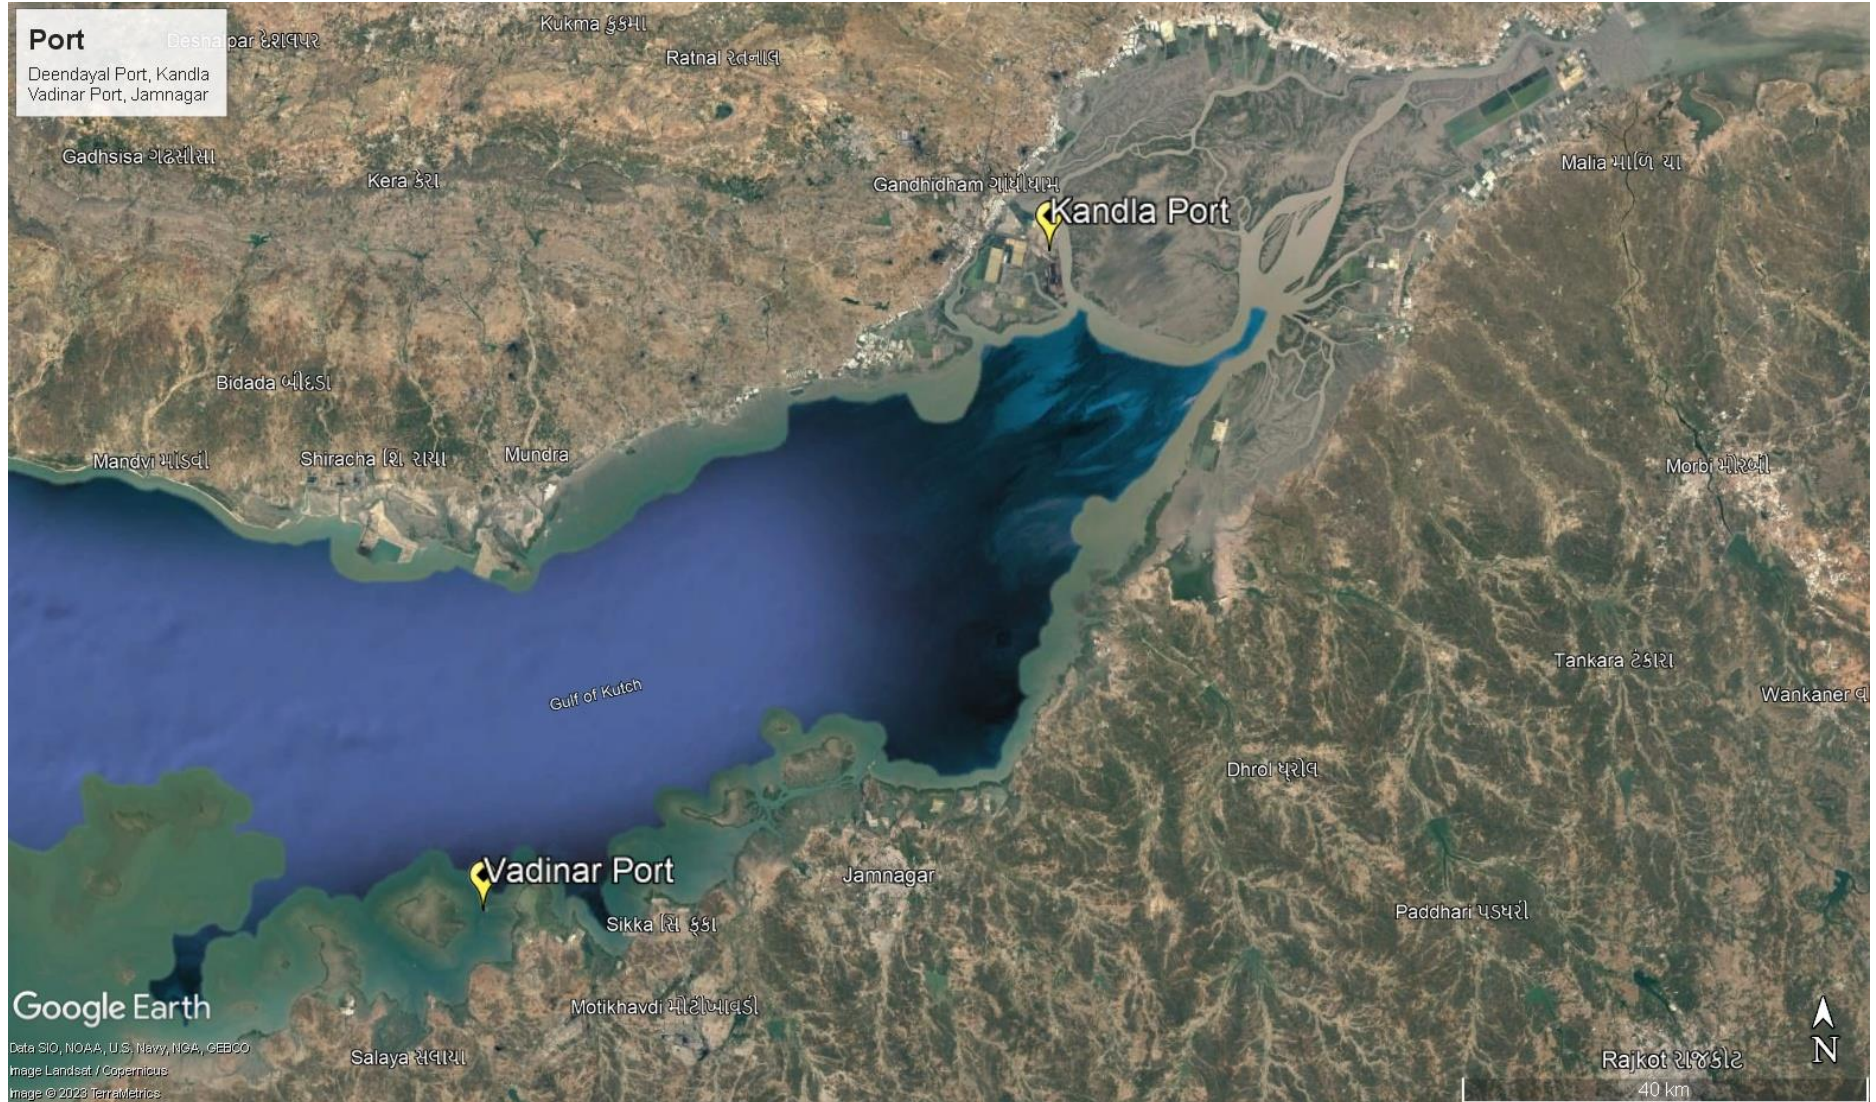

Map 1: Locations of Kandla and Vadinar Port



Map 2: Locations of Kandla Port



Map 3: Locations of Vadinar Port

2.2 Environmental Monitoring at Kandla and Vadinar

Regular monitoring of environmental parameters is of immense importance to assess the status of environment during project operation. With the knowledge of baseline conditions, the monitoring programme will serve as an indicator for identifying any deterioration in environmental conditions, thereby assist in recommending suitable mitigatory steps in time to safeguard the environment. Monitoring is as important as that of control of pollution since the efficiency of control measures can only be determined by a well-defined monitoring program. Environmental Monitoring is vital for monitoring the environmental status of the port for sustainable development. The list of main elements for which Environmental monitoring is to be carried out have been mentioned below:

- Meteorology
- Ambient Air
- DG Stack
- Noise
- Soil
- Drinking Water
- Sewage Treatment Plant
- Marine (Surface) water
- Marine Sediments
- Marine Ecology

GEMI has been entrusted by DPA to carry out the monitoring of the various aforementioned environmental aspects at the port, so as to verify effectiveness of prevailing Environment Management plan, if it confirms to the statutory and/or legal compliance; and identify any unexpected changes. Standard methods and procedures have been strictly adhered to in the course of this study. QA/QC procedures were strictly followed which covers all aspects of the study, and includes sample collection, handling, laboratory analyses, data coding, statistical analyses, interpretation and communication of results. The analysis was carried out in GEMI's NABL/MoEF accredited/recognized laboratory.

Methodology adopted for the study

Methodology is a strictly defined combination of practices, methods and processes to plan, develop and control a project along the continuous process of its implementation and successful completion. The aim of the project management methodology is to allow the control of whole process of management through effective decision-making and problem solving. The methodology adopted for the present study is shown in **Figure 1** as given below:

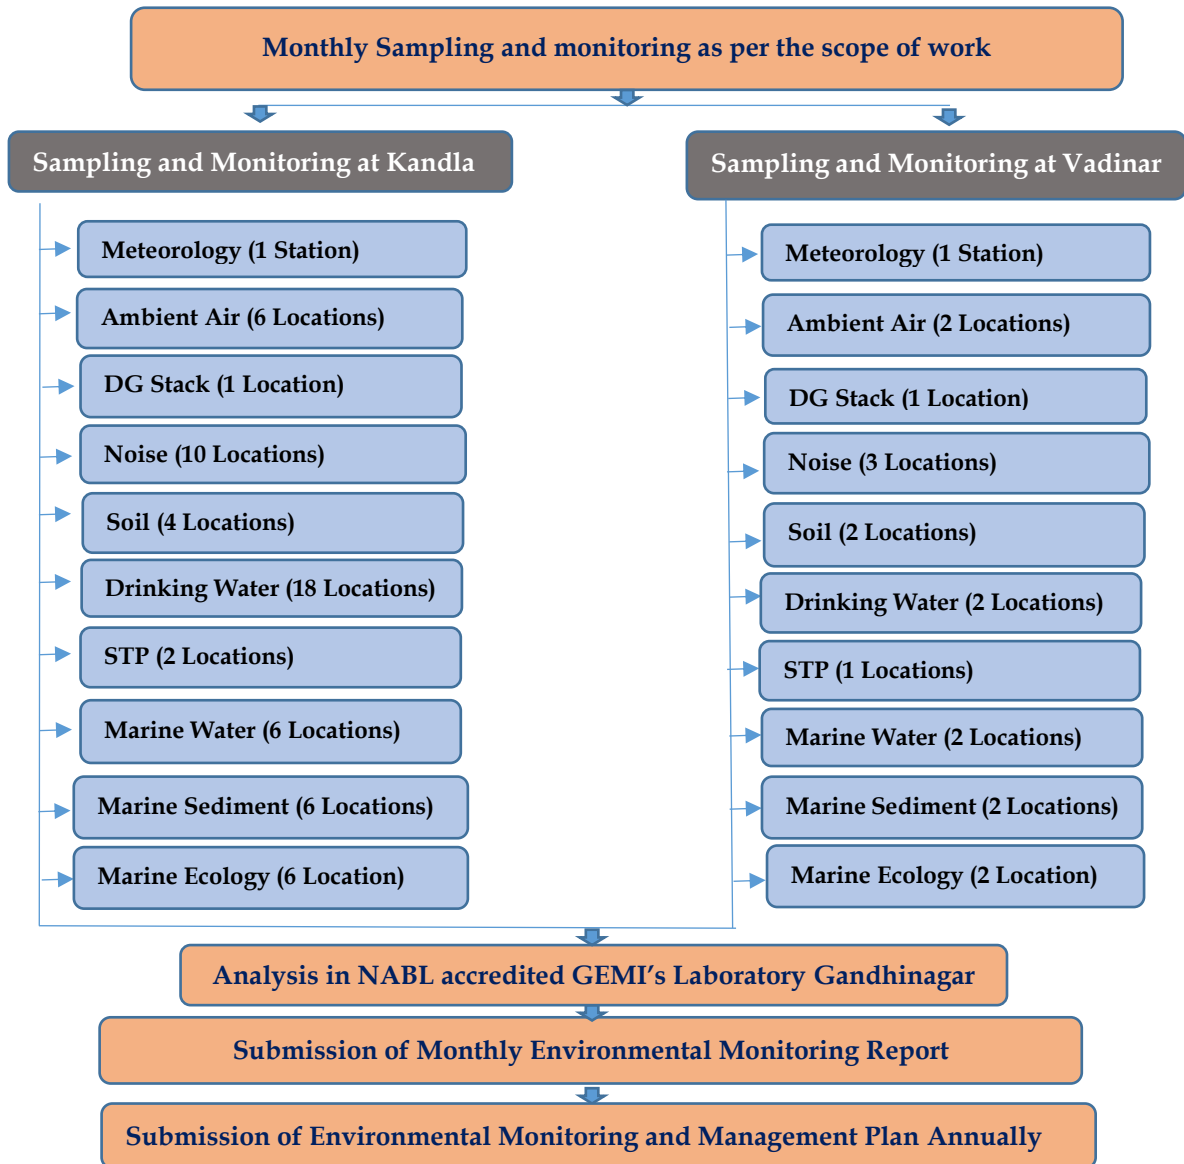


Figure 1: Methodology flow chart

The details of various sectors of Environment monitoring are described in subsequent chapters.



CHAPTER 3: METEOROLOGY MONITORING

3.1 Meteorology Monitoring

Meteorological conditions play a crucial role in dispersion of air pollutants as well as in environmental pollution studies particularly in pollutant transport irrespective of their entry into the environment. The wind speed and direction play a major role in dispersion of environment pollutants. In order to determine the prevailing micro-meteorological conditions at the project site an Automatic Weather Monitoring Stations (AWS) of Envirotech make (Model: WM280) were installed at both the sites of Kandla and Vadinar at 10 m above the ground. The details of the AWS installed have been mentioned in **Table 1** as follows:

Table 1: Details of Automatic Weather Station

Sr. No.	Site	Location Code	Location Name	Latitude Longitude
1.	Kandla	AWS-1	Environment Laboratory (DPA)	23.00996N 70.22175E
2.	Vadinar	AWS-2	Canteen Area	22.39994N 69.716608E

Methodology

During the study, a continuous automatic weather monitoring station was installed at both the sites to record climatological parameters such as Wind speed, Wind Direction, Relative Humidity, Solar Radiation, Rainfall and Temperature to establish general meteorological regime of the study area. The methodology adopted for monitoring meteorological data shall be as per the standard norms laid down by Bureau of Indian Standards (BIS) and the India Meteorological Department (IMD). The details of Automatic Weather Monitoring Station have been mentioned in **Table 2**.

Table 2: Automatic Weather Monitoring Station details

Sr. No.	Details of Meteorological Data	Unit of Measurement	Instrument	Frequency
1.	Wind Direction	degree	Automatic Weather Monitoring Station (Envirotech WM280)	Hourly Average
2.	Wind Speed	Km/hr		
3.	Rainfall	mm/hr		
4.	Relative Humidity	% RH		
5.	Temperature	°C		
6.	Solar Radiation	W/m ²		

The Meteorological parameters were recorded at an interval of 1 hour in a day and the average value for all the Meteorological parameters were summarized for the sampling period of at both the observatory site.



Figure 2: Photographs of Automatic Weather Monitoring Station at Kandla and Vadinar



3.2 Results and discussion

The summary of hourly climatological observations recorded at Kandla and Vadinar during the monitoring period, with respect to significant parameters has been mentioned in **Table 3** as follows:

Table 3: Meteorological data for Kandla and Vadinar

Details of Micro-meteorological data at Kandla Observatory												
Monitoring Period	Wind Speed (Km/h)			Temperature (°C)			Relative humidity (%)			Solar Radiation (W/m ²)	Wind Direction (°)	Rainfall (mm)
Stat.	Mean	Max.	Min	Mean	Max	Min	Mean	Max	Min			
March-April, 2024	3.24	86	1.3	32.24	41.4	26.2	73.15	89.8	43.8	67.97	From West-South-West	3.96
Details of Micro-meteorological data at Vadinar Observatory												
Monitoring Period	Wind Speed (Km/h)			Temperature (°C)			Relative humidity (%)			Solar Radiation (W/m ²)	Wind Direction (°)	Rainfall (mm)
Stat.	Mean	Max.	Min	Mean	Max	Min	Mean	Max.	Min			
March-April, 2024	9.69	139.4	3.98	30.13	36	24.4	77.43	91.5	55.3	71.63	From South-West	0.43

3.3 Data Interpretation and Conclusion

- **Temperature**

- a. **Kandla:** The ambient temperature for the monitoring period varies between the range of 26.2 – 41.4°C for Kandla, with average temperature of 32.24°C.
- b. **Vadinar:** The ambient temperature for the monitoring period varies between the range of 24.4 -36°C for Vadinar, with average temperature of 30.13°C.

- **Relative Humidity**

- a. **Kandla:** The Relative Humidity recorded between the range of 43.8 – 89.8%, with average Humidity of 73.15%.
- b. **Vadinar:** During the study period, the Relative Humidity varies between 55.3 - 91.5%, with average Humidity of 77.43%.

- **Rainfall**

- a. **Kandla:** 3.96 rainfall was observed at Kandla.
- b. **Vadinar:** 0.43 rainfall was observed at Vadinar.

- **Wind Speed**

Wind speed and Direction play a significant role in transporting the pollutants and thus decides the air quality.

- c. **Kandla:** Wind speed recorded ranges between 1.3 – 86, with average Wind Speed of 3.24 Km/hr.
- a. **Vadinar:** During the monitoring period, the Wind speed recorded ranges between 3.98 – 139.4, with average Wind Speed of 9.69 Km/hr.


- **Solar Radiation:**


- a. **Kandla:** The average Solar Radiation for the monitoring period was recorded as 67.97 W/m².
- b. **Vadinar:** The average Solar Radiation was recorded as 71.63 W/m².

- **Wind rose diagram -**

The wind-rose diagram for the monitoring period has been drawn on the basis of hourly wind speed and direction data.

This Wind Rose Diagram reveals that at Kandla and Vadinar, during the monitoring period, the prevailing winds predominantly blow from the West South West direction at Kandla, whereas, high speed winds were also observed to blow from West direction. At Vadinar, the winds were observed to blow from From South West direction.

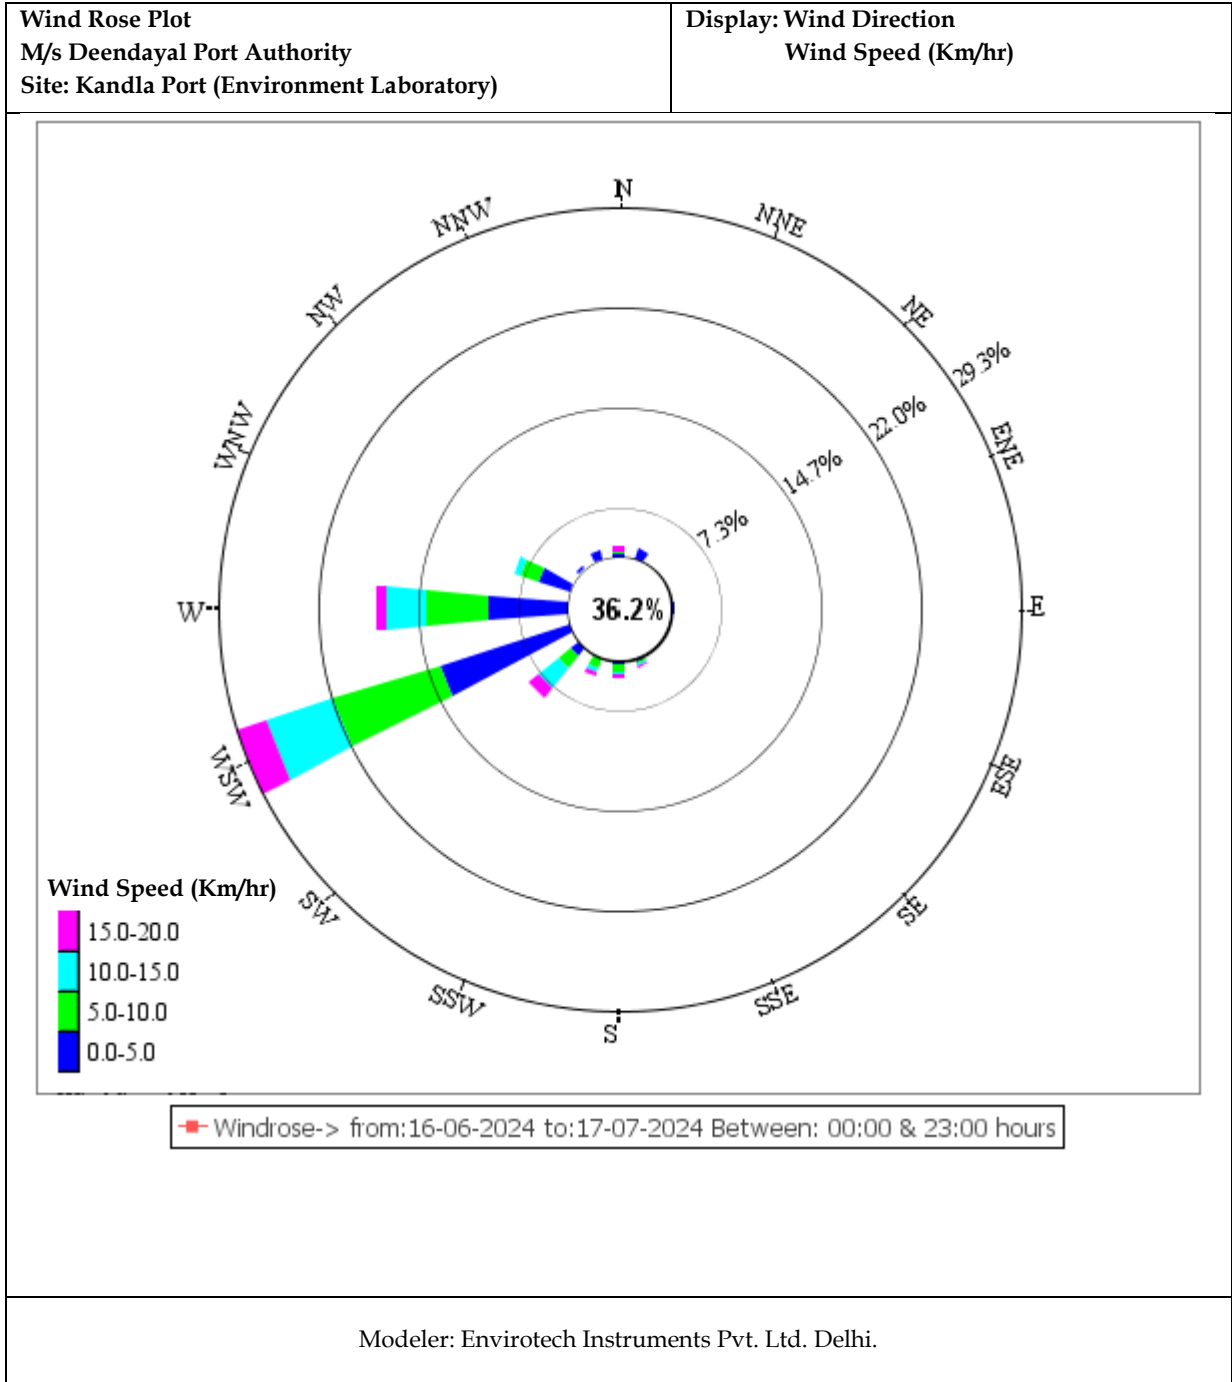

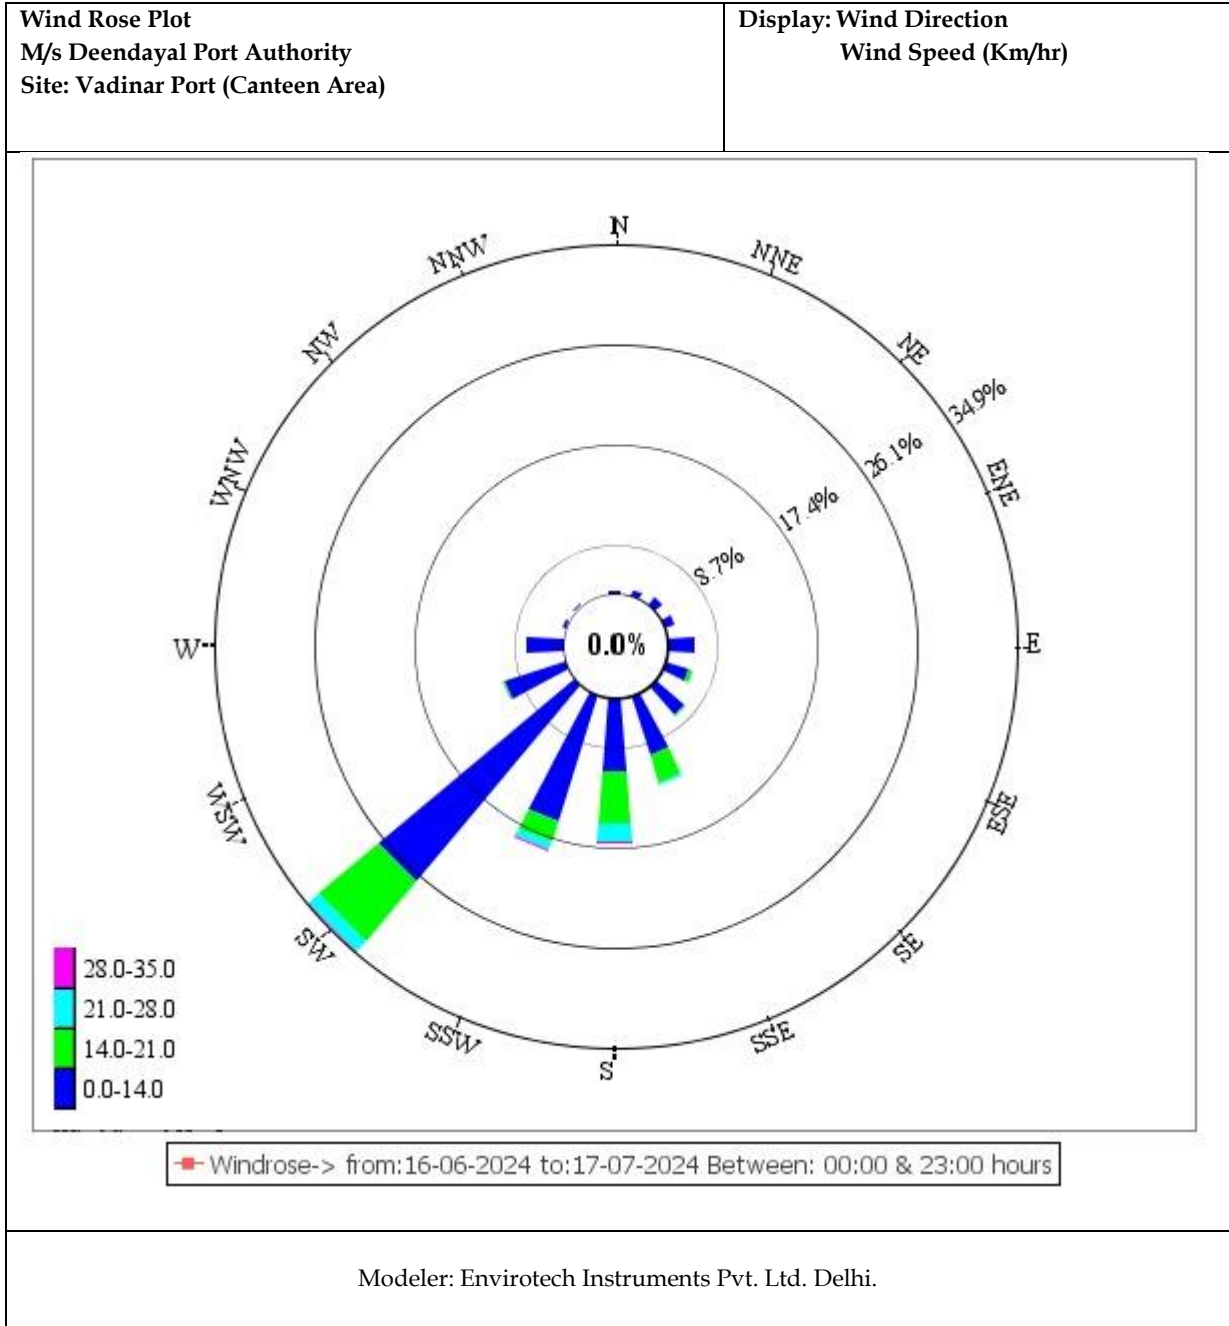



CHAPTER 4: AMBIENT AIR QUALITY MONITORING

4.1 Ambient Air Quality

It is necessary to monitor the ambient air quality of the study area, in order to determine the impact of the shipping activities and port operations on the ambient air quality. The prime objective of ambient air quality monitoring is to assess the present air quality and its conformity to National Ambient Air Quality Standards i.e. NAAQS, 2009. Ambient air quality has been monitored from 17th June to 16th July, 2024.

Methodology

The study area represents the area occupied by DPA and its associated Port area. The sources of air pollution in the region are mainly vehicular traffic, fuel burning, loading & unloading of dry cargo, fugitive emissions from storage area and dust arising from unpaved village roads. Considering the below factors, under the study, as per the scope specified by DPA eight locations wherein, 6 stations at Kandla and 2 at Vadinar have been finalized within the study area

- Meteorological conditions;
- Topography of the study area;
- Direction of wind;
- Representation of the region for establishing current air quality status
- Representation with respect to likely impact areas.

The description of various air quality stations monitored at Kandla and Vadinar have been specified in **Table 4**.



Table 4: Details of Ambient Air monitoring locations

Sr. No.	Location Code	Location Name	Latitude Longitude	Significance	
1.	Kandla	A-1	Oil Jetty No. 1	23.029361N 70.22003E	Liquid containers and emission from ship
2.		A-2	Oil Jetty No. 7	23.043538N 70.218617E	
3.		A-3	Kandla Port Colony	23.019797N 70.213536E	Vehicular activity and dust emission
4.		A-4	Marine Bhavan	23.007653N 70.222197E	Construction and vehicular activity, road dust emission,
5.		A-5	Coal Storage Area	23.000190N 70.219757E	Coal Dust, Vehicular activity
6.		A-6	Gopalpuri Hospital	23.081506N 70.135258E	Residential area, dust emission, vehicular activity
7.	Vadinar	A-7	Admin Building	22.441806N 69.677056E	Vehicular activity
8.		A-8	Vadinar Colony	22.401939N 69.716306E	Residential Area, burning waste, vehicular activity

The monitoring locations at Kandla and Vadinar have been depicted in map in **Map 4 and 5** respectively.

Ambient Air monitoring photos

Kandla

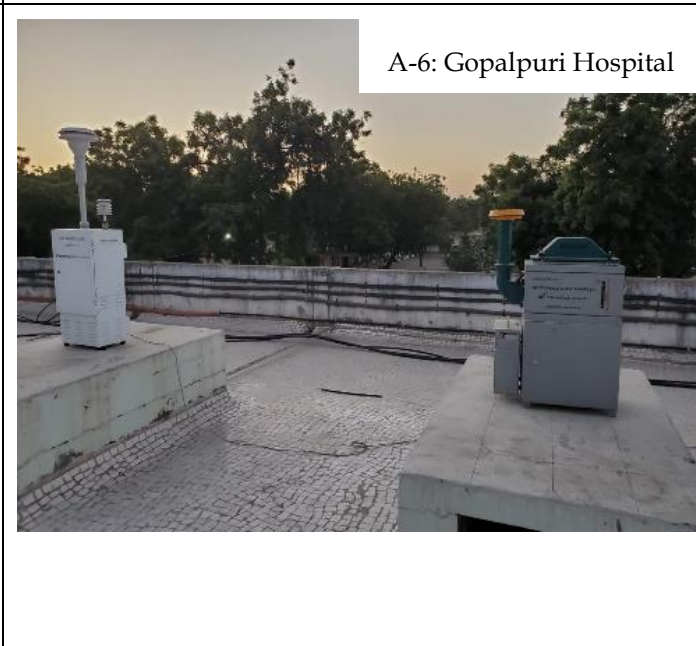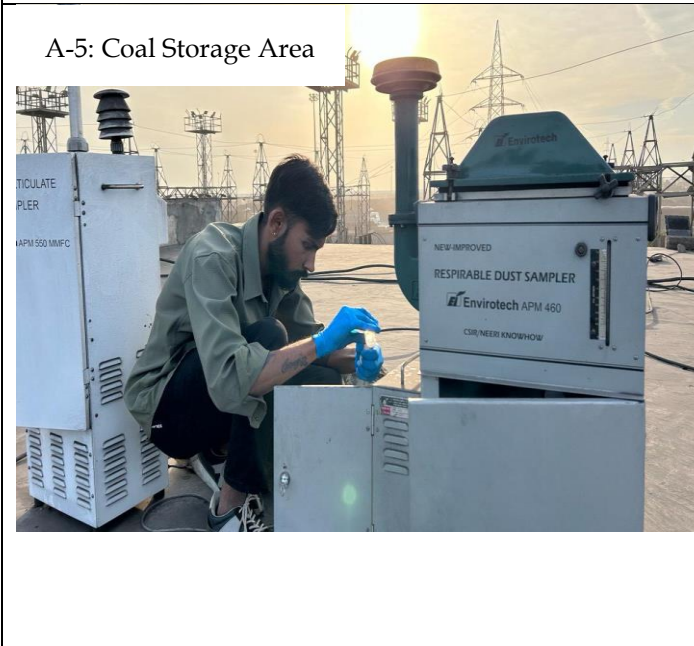

Vadinar

A-7: Admin Building




A-8: Vadinar Colony





Map 4: Locations for Ambient Air Monitoring at Kandla

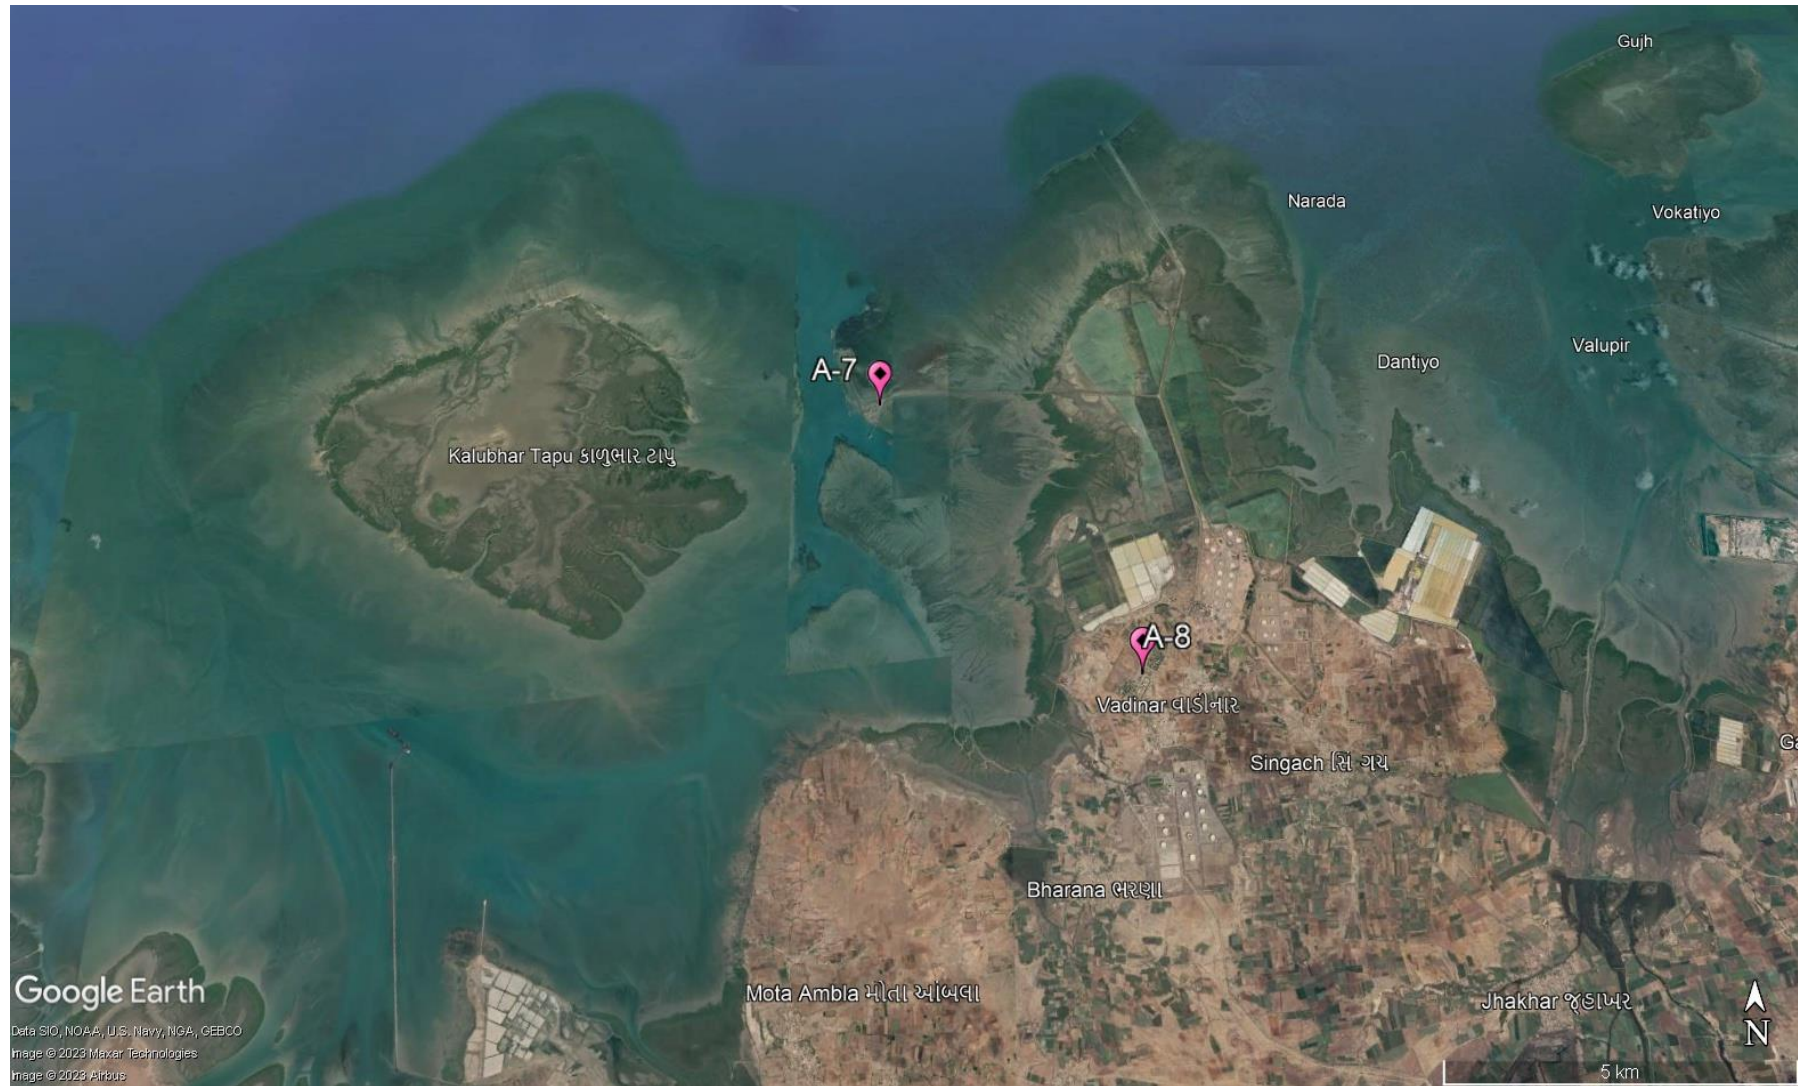

Map 5: Locations for Ambient Air Monitoring at Vadinar

Frequency

The sampling for Particulate matter i.e. PM₁₀ and PM_{2.5} and the gaseous components like SO_x, NO_x, CO as well as the Total VOCs were monitored twice in a week for a period of 24 hours a day. Whereas, the sampling for the components of PAH, Benzene and non-Methane VOCs was conducted on monthly basis.

Sampling and Analysis

The Sampling of the Ambient Air Quality parameters and analysis is conducted as per the CPCB guidelines of National Ambient Air Quality Monitoring. The sampling was performed at a height of 3.5 m (approximately) from the ground level. For the sampling of PM₁₀, calibrated 'Respirable Dust Samplers' were used, where Whatman GF/A microfiber filter paper of size 8" x 10" were utilized, where the Gaseous attachment of the make Envirotech instrument was attached with Respirable Dust Sampler for the measurement of SO_x and NO_x. The Fine Particulate Sampler for collection of PM_{2.5} was utilized for the particulate matter of size <2.5 microns. A known volume of ambient air is passed through the cyclone to the initially pre-processed filter paper. The centrifugal force in cyclone acts on particulate matter to separate them into two parts and collected as following:

- Particles <10 μ size (Respirable): GF/A Filter Paper
- Particles <2.5 μ size (Respirable): Polytetrafluoroethylene (PTFE)

Sampling and analysis of ambient SO₂ was performed by adopting the 'Improved West and Gaeke Method'. The ambient air, drawn through the draft created by the RDS, is passed through an impinger, containing a known volume of absorbing solution of Sodium tetrachloromercurate, at a pre-determined measured flow rate of 1 liter/minute (L/min). Similarly, NO_x was performed by adopting the 'Jacob Hochheister Modified' (Na arsenite) method. The impinger contains known volume of absorbing solution of Sodium Arsenite and Sodium Hydroxide.

Data has been compiled for PM₁₀, PM_{2.5}, SO_x and NO_x samples of 24-hour carried out twice a week. In case of CO, one hourly sample were taken on selected monitoring days using the sensor-based CO Meter. For the parameters Benzene, Methane & Non-methane and Volatile Organic Carbons (VOCs), the Low Volume Sampler is used, where the charcoal tubes are used as sampling media. The sampling in the Low Volume Sampler (LVS) is carried out as per IS 5182 (Part 11): 2006 RA: 2017, where the ambient air flow rate is maintained at 200 cc/min, the volume of air that passes through the LVS during two hours monitoring is approx. 24 L.

The sampling of PAHs is carried out as per IS: 5182 (Part 12): 2004. Where, the EPM 2000 Filter papers are utilized in the Respirable Dust Sampler (RDS). For the parameters, Benzene, PAH & Non-methane VOC's, monthly monitoring is carried out. The details of the parameters with their frequency monitored are mentioned in **Table 5:**

Table 5: Parameters for Ambient Air Quality Monitoring

Sr. No.	Parameters	Units	Reference method	Instrument	Frequency
1.	PM ₁₀	µg/m ³	IS 5182 (Part 23): 2006	Respirable Dust Sampler (RDS) conforming to IS:5182 (Part-23): 2006	Twice in a week
2.	PM _{2.5}	µg/m ³	IS:5182 (Part:24):2019	Fine Particulate Sampler (FPS) conforming to IS:5182 (Part-24): 2019	
3.	Sulphur Dioxide (SO _x)	µg/m ³	IS 5182 (Part:2): 2001	Gaseous Attachment conforming to IS:5182 Part-2	
4.	Oxides of Nitrogen (NO _x)	µg/m ³	IS:5182 (Part-6): 2006	Gaseous Attachment conforming to IS:5182 Part-6	
5.	Carbon Monoxide (CO)	mg/m ³	GEMI/SOP/AAQM/11 ; Issue no 01, Date 17.01.2019: 2019	Sensor based Instrument	
6.	VOC	µg/m ³	IS 5182 (Part 17): 2004	Low Flow Air Sampler	
8.	PAH	µg/m ³	IS: 5182 (Part 12): 2004	Respirable Dust Sampler (RDS) conforming to IS:5182 (Part-12): 2004	Monthly
7.	Benzene	µg/m ³	IS 5182 (Part 11): 2006 RA: 2017	Low Flow Air Sampler	
9.	Non-methane VOC	µg/m ³	IS 5182 (Part 11): 2006	Low Volume Sampler	

4.2 Result and Discussion

The summarized results of ambient air quality monitoring for the study period are presented in **Table-6 to 9** along with the graphical representation from **Graph 1 to Graph 6**. Various parameters monitored during the study have been presented by their maximum, minimum, average and Standard deviation.

Table 6: Summarized results of PM₁₀, PM_{2.5}, SO₂, NO_x, VOC and CO for Ambient Air quality monitoring

Station Code & Name	Unit of Average Concentration	Average Pollutant Concentration					
	Pollutants	PM ₁₀ (µg/m ³)	PM _{2.5} (µg/m ³)	SO ₂ (µg/m ³)	NO _x (µg/m ³)	VOC (µg/m ³)	CO (mg/m ³)
	Duration	(24 hr)				(2 hr)	(1 hr)
	NAAQS by CPCB	100	60	80	80	-	2
A-1: Oil Jetty No.1,	Monitoring days						
	17/06/2024	225.63	39.64	18.34	12.68	0.11	0.80
	19/06/2024	239.33	41.33	22.50	19.33	0.07	0.86
	24/06/2024	196.37	30.50	4.96	6.28	0.22	0.81
	27/06/2024	208.63	34.6	16.64	9.29	0.14	0.74



Station Code & Name	Unit of Average Concentration	Average Pollutant Concentration					
	Pollutants	PM ₁₀ (µg/m ³)	PM _{2.5} (µg/m ³)	SO ₂ (µg/m ³)	NO _x (µg/m ³)	VOC (µg/m ³)	CO (mg/m ³)
	Duration	(24 hr)				(2 hr)	(1 hr)
	NAAQS by CPCB Monitoring days	100	60	80	80	-	2
Kandla	2/7/2024	188.37	31.19	23.83	11.51	0.18	0.66
	4/7/2024	141.41	29.24	4.88	<6	0.12	0.84
	8/7/2024	168.27	33.12	11.45	14.2	0.07	0.82
	10/7/2024	156.88	32.79	13.38	21.37	0.14	0.79
	Minimum	141.41	29.24	11.45	6.28	0.07	0.66
	Maximum	239.33	41.33	23.83	21.37	0.22	0.86
	Average	190.61	34.05	17.69	13.52	0.13	0.79
	Std. Deviation	33.85	4.32	4.90	5.34	0.05	0.06
A-2: Oil Jetty No.7, Kandla	17/06/2024	182.61	43.13	36.12	18.21	0.08	0.81
	19/06/2024	191.11	40.62	48.62	10.74	0.03	0.79
	24/06/2024	110.57	36.00	4.92	5.93	0.11	0.78
	27/06/2024	146.32	34.38	30.40	16.77	0.16	0.74
	2/7/2024	119.29	38.64	22.56	8.38	0.09	0.77
	4/7/2024	84.43	23.11	4.89	5.96	0.12	0.75
	8/7/2024	105.63	26.14	16.21	11.41	0.18	0.76
	10/7/2024	96.47	30.22	26.33	10.16	0.05	0.78
	Minimum	84.43	23.11	4.89	5.93	0.03	0.74
	Maximum	191.11	43.13	48.62	18.21	0.18	0.81
	Average	129.55	34.03	23.76	10.95	0.10	0.77
	Std. Deviation	39.74	7.05	15.08	4.54	0.05	0.02
A-3: Kandla Port Colony, Kandla	17/06/2024	146.07	13.39	4.87	5.78	0.20	0.87
	19/06/2024	129.49	14.12	4.96	5.84	0.13	0.86
	24/06/2024	134.77	28.61	29.38	12.34	0.19	0.84
	27/06/2024	163.17	31.16	21.16	9.46	0.12	0.82
	2/7/2024	141.42	27.42	10.27	19.7	0.16	0.85
	4/7/2024	150.52	24.32	4.79	5.94	0.11	0.82
	8/7/2024	126.63	18.38	16.83	12.75	0.27	0.83
	10/7/2024	131.31	21.15	14.77	22.87	0.32	0.86
	Minimum	126.63	13.39	4.79	5.78	0.11	0.82
	Maximum	163.17	31.16	29.38	22.87	0.32	0.87
	Average	140.42	22.32	13.38	11.84	0.19	0.84
	Std. Deviation	12.40	6.67	8.92	6.52	0.07	0.02
A-4: Marine Bhavan, Kandla	17/06/2024	272.90	22.25	4.84	5.76	0.16	0.89
	19/06/2024	253.03	18.10	4.93	5.72	0.21	0.86
	24/06/2024	275.72	22.69	4.89	5.83	0.04	0.84
	27/06/2024	264.42	27.55	27.57	12.25	0.09	0.88
	2/7/2024	218.13	23.41	19.38	14.07	0.11	0.87
	4/7/2024	193.37	25.45	4.97	5.85	0.23	0.85
	8/7/2024	187.73	21.76	13.49	16.19	0.21	0.84
	10/7/2024	203.38	18.93	17.38	23.89	0.25	0.87
	Minimum	187.73	18.10	4.84	5.72	0.04	0.84
	Maximum	275.72	27.55	27.57	23.89	0.25	0.89



Station Code & Name	Unit of Average Concentration	Average Pollutant Concentration					
	Pollutants	PM ₁₀ (µg/m ³)	PM _{2.5} (µg/m ³)	SO ₂ (µg/m ³)	NO _x (µg/m ³)	VOC (µg/m ³)	CO (mg/m ³)
	Duration	(24 hr)				(2 hr)	(1 hr)
	NAAQS by CPCB Monitoring days	100	60	80	80	-	2
	Average	233.59	22.52	13.22	11.20	0.16	0.86
	Std. Deviation	36.88	3.11	8.84	6.68	0.08	0.02
A-5: Coal Storage Area, Kandla	17/06/2024	469.24	58.31	36.74	32.68	0.21	0.88
	19/06/2024	522.30	68.62	43.86	10.44	0.14	0.92
	24/06/2024	411.80	82.57	4.94	6.76	0.13	0.94
	27/06/2024	588.16	53.67	31.45	18.87	0.18	0.93
	2/7/2024	446.39	49.22	24.76	26.92	0.10	0.89
	4/7/2024	383.47	29.42	18.66	12.80	0.07	0.91
	8/7/2024	366.11	38.11	29.49	15.37	0.22	0.94
	10/7/2024	333.28	43.66	37.09	18.47	0.12	0.90
	Minimum	333.28	29.42	4.94	6.76	0.07	0.88
	Maximum	588.16	82.57	43.86	32.68	0.22	0.94
	Average	440.09	52.95	28.37	17.79	0.15	0.91
	Std. Deviation	84.90	17.01	12.27	8.56	0.05	0.02
A-6: Gopalpuri Hospital, Kandla	17/06/2024	113.68	43.07	4.97	5.87	0.11	0.73
	19/06/2024	95.01	10.01	4.88	5.92	0.22	0.67
	24/06/2024	78.76	21.78	4.79	5.68	0.19	0.67
	27/06/2024	105.1	29.38	16.23	8.37	0.13	0.7
	2/7/2024	98.34	36.44	11.74	11.33	0.08	0.75
	4/7/2024	61.27	16.27	4.85	5.94	0.16	0.85
	8/7/2024	78.58	25.71	23.58	11.96	0.24	0.78
	10/7/2024	83.67	18.87	9.68	9.79	0.20	0.82
	Minimum	61.27	10.01	4.79	5.68	0.08	0.67
	Maximum	113.68	43.07	23.58	11.96	0.24	0.85
	Average	89.30	25.19	10.09	8.11	0.17	0.75
	Std. Deviation	16.91	10.86	6.88	2.63	0.06	0.07
A-7: Admin Building, Vadinar	17/06/2024	44.86	15.69	15.82	11.76	0.12	0.71
	19/06/2024	47.70	12.78	4.98	5.98	0.10	0.70
	24/06/2024	38.91	13.49	6.68	12.09	0.19	0.68
	27/06/2024	29.72	23.66	4.88	6.33	0.14	0.69
	3/7/2024	27.40	19.44	4.93	5.89	0.04	0.72
	4/7/2024	34.3	21.66	19.73	9.63	0.09	0.7
	8/7/2024	27.08	17.55	22.32	5.91	0.23	0.73
	10/7/2024	42.52	20.69	4.85	5.73	0.11	0.72
	Minimum	27.08	12.78	4.85	5.73	0.04	0.68
	Maximum	47.70	23.66	22.32	12.09	0.23	0.73
	Average	36.56	18.12	10.52	7.92	0.13	0.71
	Std. Deviation	8.10	3.92	7.49	2.79	0.06	0.02
A-8: Vadinar Colony,	17/06/2024	49.61	13.63	9.37	16.18	0.13	0.74
	19/06/2024	52.72	10.30	4.84	5.91	0.18	0.75
	24/06/2024	51.67	28.30	8.37	19.38	0.23	0.72
	27/06/2024	35.58	25.44	4.93	6.52	0.07	0.73





Station Code & Name	Unit of Average Concentration	Average Pollutant Concentration					
	Pollutants	PM ₁₀ (µg/m ³)	PM _{2.5} (µg/m ³)	SO ₂ (µg/m ³)	NO _x (µg/m ³)	VOC (µg/m ³)	CO (mg/m ³)
	Duration	(24 hr)				(2 hr)	(1 hr)
	NAAQS by CPCB Monitoring days	100	60	80	80	-	2
Vadinar	3/7/2024	24.57	14.60	4.98	5.78	0.16	0.80
	4/7/2024	47.58	23.53	11.91	8.48	0.11	0.76
	8/7/2024	51.39	15.43	12.55	5.76	0.18	0.79
	10/7/2024	30.02	21.41	4.91	5.93	0.09	0.78
	Minimum	24.57	10.30	4.84	5.76	0.07	0.72
	Maximum	52.72	28.30	12.55	19.38	0.23	0.80
	Average	42.89	19.08	7.73	9.24	0.14	0.76
	Std. Deviation	11.13	6.45	3.28	5.41	0.05	0.03

Graphs 1-6 shows spatial trend of ambient air parameter at all the eight-monitoring location (six at Kandla and 2 at Vadinar)





Environmental Monitoring Report of Deendayal Port Authority, June-July 2024

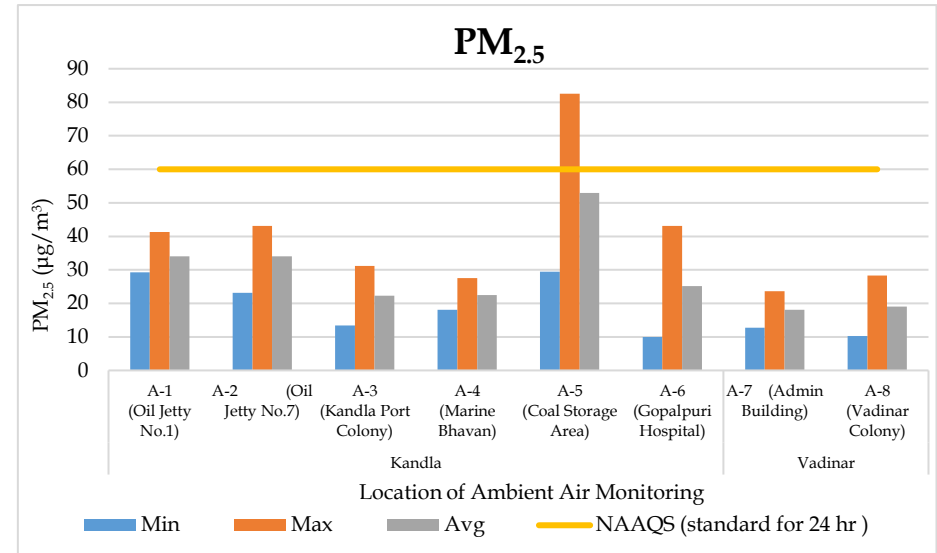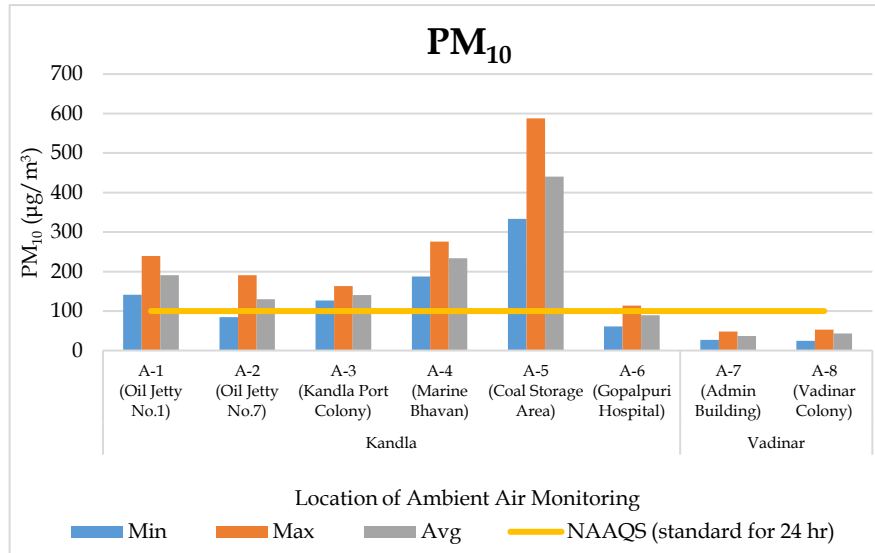


Graph 1: Spatial trend in Ambient PM₁₀ Concentration

Graph 2: Spatial trend in Ambient PM_{2.5} Concentration

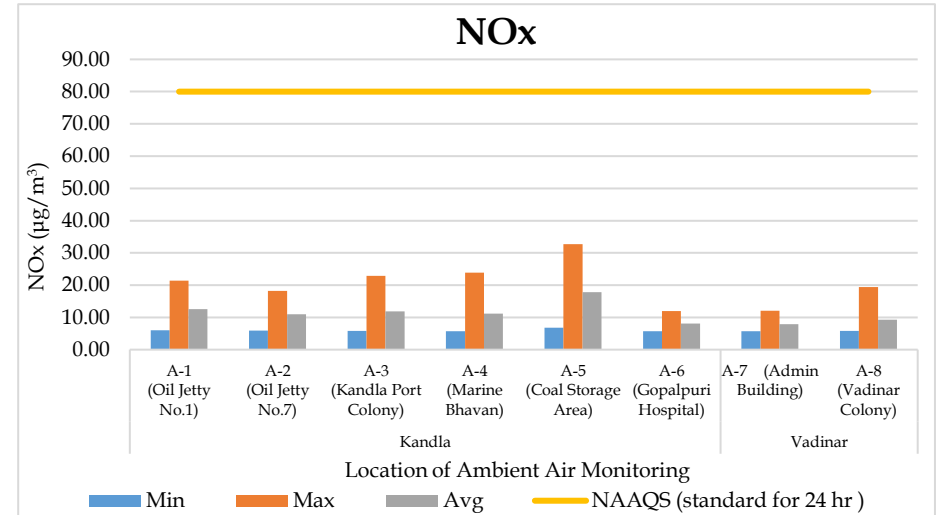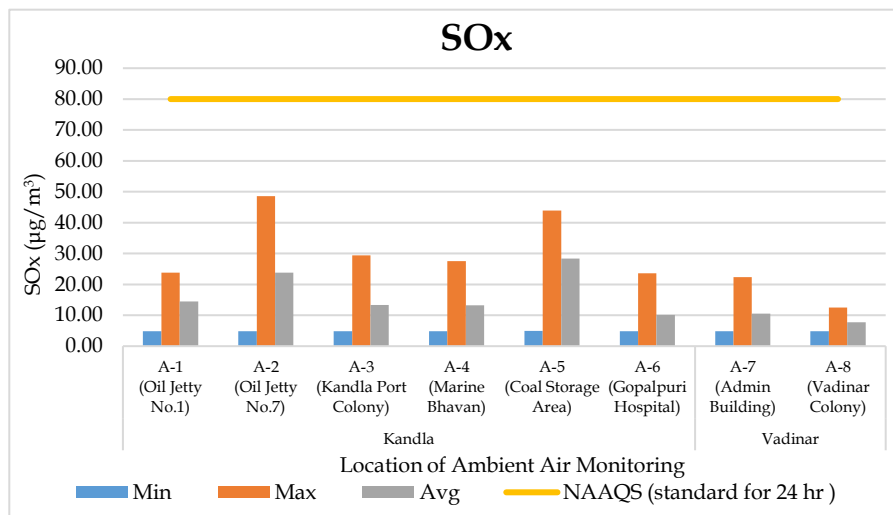


Graph 3: Spatial trend in Ambient SO_x Concentration

Graph 4: Spatial trend in Ambient NO_x Concentration

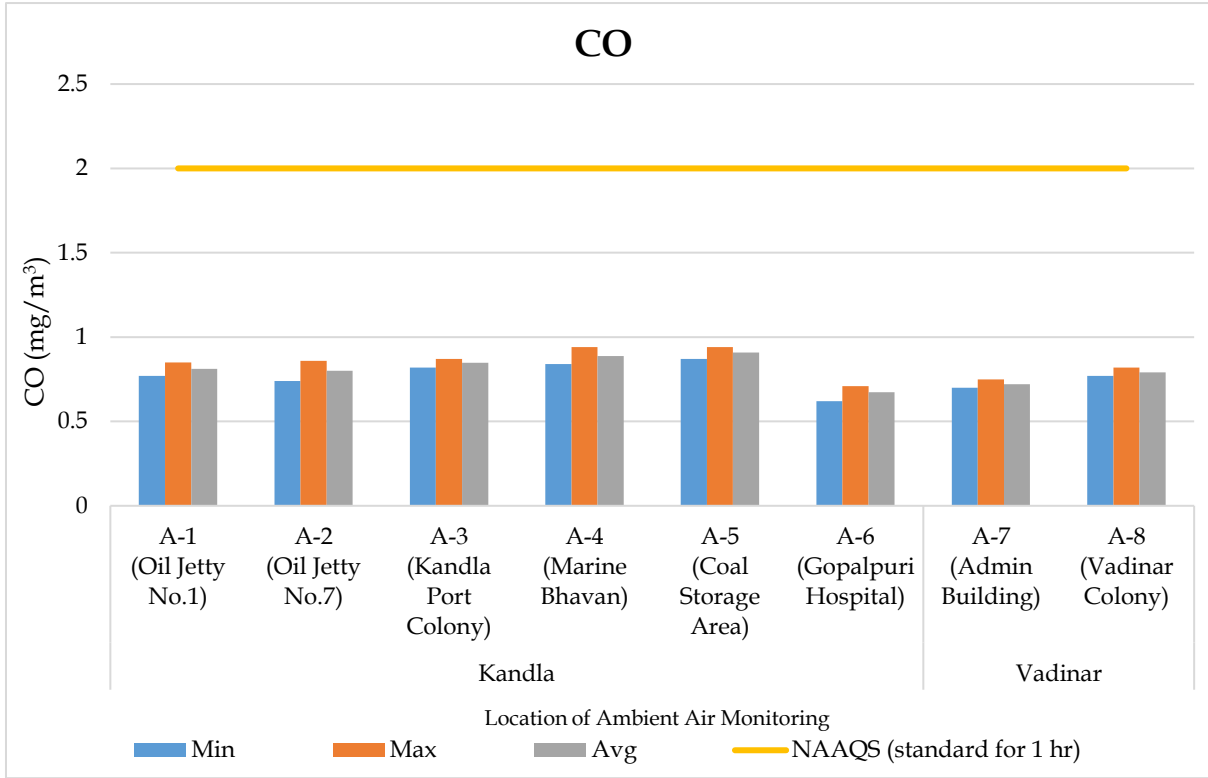

Graph 5: Spatial trend in Ambient CO Concentration

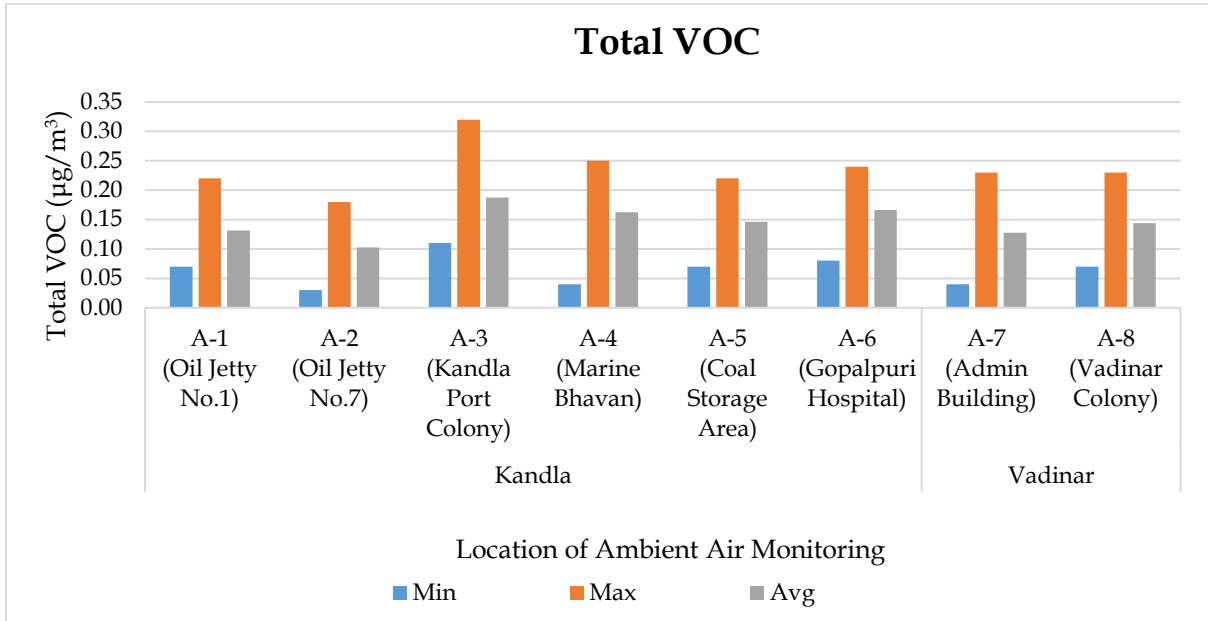

Graph 6: Spatial trend in Ambient Total VOCs

Table 7: Summarized results of Benzene for Ambient Air quality monitoring

Benzene ($\mu\text{g}/\text{m}^3$)									
Sr. No	Kandla						Vadinar		NAAQS standards (24 hr)
	A-1	A-2	A-3	A-4	A-5	A-6	A-7	A-8	
1	0	0	0	0	0	0	0	0	5 $\mu\text{g}/\text{m}^3$

Table 8: Summarized results of Polycyclic Aromatic Hydrocarbons

Sr. No.	Components	Kandla						Vadinar	
		A-1	A-2	A-3	A-4	A-5	A-6	A-7	A-8
1	Napthalene	0.25	0.44	0.48	0.60	0.43	0.46	0.01	0.04
2	Acenaphthylene	0.05	0.02	0.08	0.05	0.04	0.08	0.01	0.01
3	Acenaphthene	0.01	0.03	0.00	0.01	0.04	0.03	0.00	0.00
4	Fluorene	0.05	0.02	0.19	0.13	0.56	0.11	0.03	0.02
5	Anthracene	0.07	0.16	0.22	0.51	2.64	0.53	0.18	0.11
6	Phenanthrene	0.00	0.02	0.26	0.18	0.53	0.06	0.01	0.00
7	Fluoranthene	0.03	0.09	0.07	0.21	0.35	0.19	0.09	0.04
8	Pyrene	0.00	0.05	0.42	0.51	0.84	0.31	0.13	0.03
9	Chrycene	0.17	0.20	0.37	0.54	1.22	0.48	0.00	0.00
10	Banz(a)anthracene	0.11	0.06	0.06	0.23	0.58	0.20	0.05	0.02
11	Benzo[k]fluoranthene	0.03	0.01	0.20	0.15	0.36	0.10	0.00	0.00
12	Benzo[b]fluoranthene	0.03	0.05	0.10	0.17	0.32	0.11	0.00	0.00
13	Benzopyrene	0.03	0.04	0.00	0.14	0.84	0.25	0.02	0.04
14	Indeno [1,2,3-cd] fluoranthene	0.08	0.13	0.02	0.12	0.23	0.28	0.04	0.26
15	Dibenz(ah)anthracene	0.03	0.06	0.17	0.15	0.46	0.02	0.02	0.09
16	Benzo[ghi]perylene	0.00	0.01	0.00	0.00	0.00	0.00	0.07	0.18

Table 9: Summarized results of Non-methane VOC

Sr No	Kandla						Vadinar	
	A-1	A-2	A-3	A-4	A-5	A-6	A-7	A-8
1	1.11	1.08	1.63	1.24	1.43	1.69	1.53	1.27

4.3 Data Interpretation and Conclusion

The results were compared with the National Ambient Air Quality Standards (NAAQS), 2009 of Central Pollution Control Board (CPCB).

- The concentration of PM_{10} at Kandla varies in the range of 61.27 to 588.16 $\mu\text{g}/\text{m}^3$ with an average value of 203.93 $\mu\text{g}/\text{m}^3$. PM_{10} exceeded NAAQS of all the monitoring locations in Kandla. Whereas, at Vadinar, the concentration varies from 24.57 to 52.72 $\mu\text{g}/\text{m}^3$, with an average value of 39.73 $\mu\text{g}/\text{m}^3$, and complies with the stipulated norm (100 $\mu\text{g}/\text{m}^3$).
- The highest concentration of PM_{10} at locations A-5 i.e. Coal Storage Area could be attributed to the presence of heavy vehicular traffic in upwind areas which bring

higher impact causing the dispersion of emitted particulate matter in the ambient air. The unloading of coal directly in the truck, using grabs causes the coal to disperse in the air as well as coal dust to fall and settle on the ground. This settled coal dust again mixes with the air while trucks travel through it. Also, the coal-loaded trucks are generally not always covered with tarpaulin sheets and this might result in increased suspension of coal from trucks/dumpers during its transit from vessel to yard or storage site. This might increase the PM₁₀ in and around the Coal storage area and Marine bhavan.

- The **PM_{2.5}** concentrations at Kandla vary from 10.01 to 82.57 µg/m³, with an average of 31.84 µg/m³. While the **PM_{2.5}** concentrations at most locations in Kandla fall within the NAAQS limits, the concentration at location A-5, with a value of 82.57 µg/m³, exceeds the permissible limit. Whereas, at Vadinar its concentration varies from 10.30 to 28.30 µg/m³ with average 18.60 µg/m³ which falls within the limit of NAAQS of 60 µg/m³.
- The concentration of **SO_x** varies from 4.79 to 48.62 µg/m³ with average concentration as 17.22 µg/m³ at Kandla and 4.84 to 22.32 µg/m³ with average as 9.13 µg/m³ at Vadinar. The average concentration of SO_x complies with the prescribed limit of NAAQS (80 µg/m³) for both the monitoring site.
- The concentration of **NO_x** varies from 5.68 to 32.68 µg/m³ with average 12.08 µg/m³ at Kandla and 5.73 to 19.38 µg/m³ with average 8.58 µg/m³ at Vadinar. The concentration of **NO_x** falls within the prescribed limit of NAAQS i.e. 80 µg/m³ at both the monitoring site of Kandla and Vadinar.
- The concentration of **CO** varies from 0.66 to 0.94 µg/m³ with average 0.82 µg/m³ at Kandla and 0.68 to 0.80 µg /m³ with average 0.73 µg/m³ at Vadinar. The concentration falls within the norm of 2 mg/m³ specified by NAAQS at both the monitoring sites
- The concentration of **Total VOCs** levels was recorded in range of 0.03 to 0.32 µg/m³ and 0.04 to 0.23 µg/m³ at Kandla and Vadinar respectively. The main source of VOCs in the ambient air may be attributed to the burning of Gasoline and Natural gas in Vehicle exhaust and burning fossil fuels, and garbage that release VOCs into the atmosphere. During the monitoring period, the wind flows towards South direction at Kandla, and hence the wind direction and speed also contribute to increased dispersion of pollutants from the upward areas towards the downward areas.
- **Benzene** was not detected at any of locations of Kandla and Vadinar.
- **Polycyclic Aromatic Hydrocarbons (PAHs)** are ubiquitous pollutants in urban atmospheres. Anthropogenic sources of total PAHs in ambient air emissions are greater than those that come from natural events. These locations are commercial areas where Vehicular activity and dust emission is common. PAHs are a class of chemicals that occur naturally in coal, crude oil, and gasoline. The higher concentration which results from burning coal, oil, gas, road dust, etc. Other outdoor sources of PAHs may be the industrial plants in-and-around the DPA premises.

- The Ambient air Monitoring location of Kandla recorded the **Non-methane VOC** (NM-VOC) concentration in the range of 1.08 to 1.69 $\mu\text{g}/\text{m}^3$. While at Vadinar, the concentration of NM-VOC falls in the range of 1.27 to 1.53 $\mu\text{g}/\text{m}^3$.

With reference to the Ambient Air Quality monitoring conducted under the study, it may be concluded that the particulate matter PM_{10} , were reported in higher concentration and apparently exceeds the NAAQS particularly at locations of Kandla., whereas $\text{PM}_{2.5}$ complies with the NAAQS at majority of the locations. For both the ambient air monitoring parameters (PM_{10} and $\text{PM}_{2.5}$), the major exceedance was observed at location A-5 i.e. Coal Storage Area. The gaseous pollutants (NO_x , SO_x , CO, VOCs etc.) falls within the permissible limit. The probable reasons contributing to these emissions of pollutants into the atmosphere in-and-around the port area are summarized as follows: -

1. **Port Machinery:** Port activities involve the use of various machinery and equipment, including cranes, for lifts, tugboats, and cargo handling equipment. These machines often rely on diesel engines, which can emit pollutants such as NO_x , Particulate matter, and CO. Older or poorly maintained equipment tends to generate higher emissions.
2. **Port Vehicles:** Trucks and other vehicles operating within port and port area contributes to air pollution. Similar to port machinery, diesel-powered vehicles can emit NO_x , PM, CO, and other pollutants such as PAH, VOCs etc. Vehicle traffic and congestion in and around port areas can exacerbate the air quality issues.

4.4 Remedial Measures:

Efficient mitigation strategies need to be implementation for substantial environmental and health co-benefits. To improve air quality, DPA has implemented a number of precautionary measures, such as maintaining Green zone, initiated Inter-Terminal Transfer of tractor-trailers, Centralized Parking Plaza, providing shore power supply to tugs and port crafts, the use of LED lights at DPA area helps in lower energy consumption and decreases the carbon foot prints in the environment, time to time cleaning of paved and unpaved roads, use of tarpaulin sheets to cover dumpers at project sites etc. are helping to achieve the cleaner and green future at port. To address air pollution from port shipping activities, various measures that can be implemented are as follows:

- Practice should be initiated for using mask as preventative measure, to avoid Inhalation of dust particle-Mask advised in sensitive areas. Covering vehicles with tarpaulin during transportation will help to reduce the suspension of pollutants in air.
- Ensuring maintenance of engines and machinery to comply with emission standards.
- Frequent water sprinkling on roads to reduce dust suspension due to vehicular movement, this can be use during transporting coal to avoid suspension of coal dust.
- Use of proper transport methods, such as a conveyor belt, for excavated material and screens around the construction site.
- Temporary pavement of roads in construction site could considerably reduce dust emission. Prohibition of use of heavy diesel oil as fuel could be possibly reduce pollutants. Encouraging use of low-sulfur fuels (viz. Marine Gas Oil (MGO)/Liquefied Natural Gas (LNG), can significantly reduce sulfur and PM emissions from ships.



- Retrofitting ships with exhaust gas cleaning systems can help reduce sulfur emissions. Engine upgrades, such as optimizing fuel combustion and improving engine efficiency, can reduce overall emissions.
- Investing in infrastructure for cold ironing allows ships to connect to the electrical grid while docked, reducing the need for auxiliary engines and associated emissions.
- Implementing efficient cargo-handling processes, optimizing logistics to reduce congestion and idling times, and encouraging use of cleaner port machinery and vehicles can all contribute to reducing air pollution in port areas.



CHAPTER 5: DG STACK MONITORING

5.1 DG Stack Monitoring


A diesel generator is a mechanical-electrical machine that produces electrical energy (electricity) from diesel fuel. They are used by the residential, commercial, charitable and governmental sectors to provide power in the event of interruption to the main power, or as the main power source. Diesel generating (DG) sets are generally used in places without connection to a power grid, or as an emergency power supply if the grid fails. These DG sets utilize diesel as fuel and generate and emit the air pollutants such as Suspended Particulate Matter, SO₂, NO_x, CO, etc. from the stack during its functioning. The purpose of stack sampling is to determine emission levels from plant processes to ensure they are in compliance with any emission limits set by regulatory authorities to prevent macro environmental pollution. The stack is nothing but chimney which is used to disperse the hot air at a great height, emissions & particulate matters that are emitted. Hence, monitoring of these stacks attached to DG Sets is necessary in order to quantify the emissions generated from it.

As defined in scope by DPA, the monitoring of DG Stack shall be carried out at two locations, one at Kandla and one at Vadinar. The details of the DG Sets at Kandla and Vadinar have been mentioned in **Table 10** as follows:

Table 10: Details of DG Stack monitoring locations

Sr. No.	Location Code	Location Name	Latitude/ Longitude
1.	DG-1	Kandla	22.98916N 70.22083E
2.	DG-2	Vadinar	22.44155N 69.67419E

The map depicting the locations of DG Stack Monitoring to be monitored in Kandla and Vadinar have been mentioned in **Map 6 and 7** as follows:

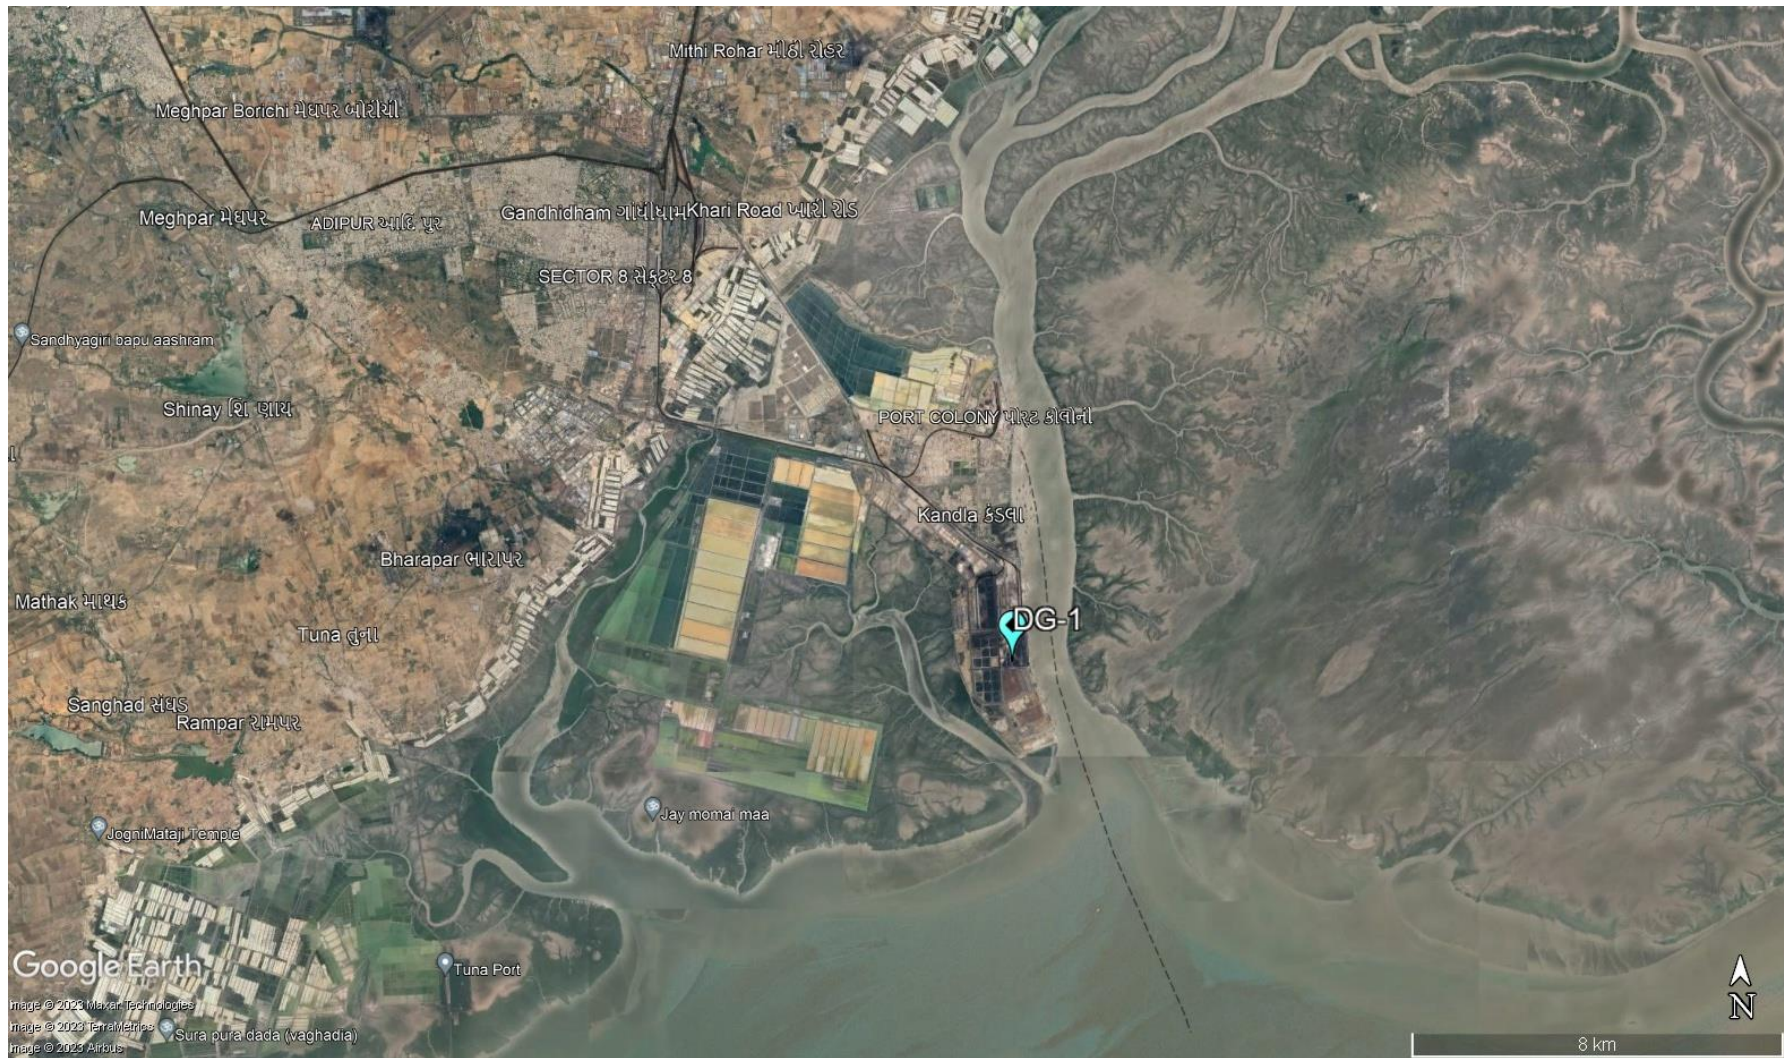

Map 6: Locations for DG Stack monitoring at Kandla



Map 7: Locations for DG Stack monitoring at Vadinar

Methodology:

Under the study, the list of parameters to be monitored under the projects for DG Stack Monitoring has been mentioned in **Table 11** as follows:

Table 11: DG stack parameters

Sr. No.	Parameter	Unit	Instrument
1.	Suspended Particulate Matter	mg/Nm ³	Stack Monitoring Kit
2.	Sulphur Dioxide (SO ₂)	PPM	Sensor based Flue Gas Analyzer (Make: TESTO, Model 350)
3.	Oxides of Nitrogen (NO _x)	PPM	
4.	Carbon Monoxide	%	
5.	Carbon Dioxide	%	

The methodology for monitoring of DG Stack has been mentioned as follows:

The monitoring of DG Stack is carried out as per the IS:11255 and USEPA Method. The Stack monitoring kit is used for collecting representative samples from the stack to determine the total amount of pollutants emitted into the atmosphere in a given time. Source sampling is carried out from ventilation stack to determine the emission rates/or characteristics of pollutants. Sample collected must be such that it truly represents the conditions prevailing inside the stack. Whereas the parameters Sulphur Dioxide, Oxides of Nitrogen (NO_x), Carbon Monoxide and Carbon Dioxide, the monitoring is carried out by using the sensor-based Flue Gas Analyzer.

Frequency

Monitoring is required to be carried out once a month for both the locations of Kandla and Vadinar.

5.2 Result and Discussion

The sampling and monitoring of DG stack emission was carried out at Kandla and Vadinar and its comparison with CPCB or Indian standards for Industrial Stack Monitoring the flue gas emission from DG set has given in **Table 12**.

Table 12: DG monitoring data

Sr. No.	Stack Monitoring Parameters for DG Sets	Stack Monitoring Limits / Standards As per CPCB	DG- 1 (Kandla)	DG-2 (Vadinar)
1.	Suspended Particulate Matter (SPM) (mg/Nm ³)	150	85.36	39.56
2.	Sulphur Dioxide (SO ₂) (PPM)	100	6.31	N.D.
3.	Oxides of Nitrogen (NO _x) (PPM)	50	38.21	10.32
4.	Carbon Monoxide (CO) (%)	1	0.26	0.11
5.	Carbon Dioxide (CO ₂) (%)	-	2.15	1.35

5.3 Data Interpretation and Conclusion

The results of DG stack emission are compared with the permissible limits mentioned in the consent issued by GPCB, and have been found within the prescribed limit for all the monitored parameters.



CHAPTER 6: NOISE MONITORING

6.1 Noise Monitoring

Noise can be defined as an unwanted sound, and it is therefore, necessary to measure both the quality as well as the quantity of environmental noise in and around the study area. Noise produced during operation stage and the subsequent activities may affect surrounding environment impacting the fauna and as well as the human population. Under the scope, the noise monitoring is required to be carried out at 10 locations in Kandla and 3 locations in Vadinar. The sampling locations for noise are not only confined to commercial areas of DPA but also the residential areas of DPA.

The details of the noise monitoring stations are mentioned in **Table 13** and locations have been depicted in the **Map 8 and 9** as follow:

Table 13: Details of noise monitoring locations

Sr. No.	Location Code	Location Name	Latitude/ Longitude
1.	N-1	Oil Jetty 7	23.043527N 70.218456E
2.	N-2	West Gate No.1	23.006771N 70.217340E
3.	N-3	Canteen Area	23.003707N 70.221331E
4.	N-4	Main Gate	23.007980N 70.222525E
5.	N-5	Main Road	23.005194N 70.219944E
6.	N-6	Marin Bhavan	23.007618N 70.222087E
7.	N-7	Port & Custom Building	23.009033N 70.222047E
8.	N-8	Nirman Building	23.009642N 70.220623E
9.	N-9	ATM Building	23.009985N 70.221715E
10.	N-10	Wharf Area/ Jetty	22.997833N 70.223042E
11.	N-11	Near Main Gate	22.441544N 69.674495E
12.	N-12	Near Vadinar Jetty	22.441002N 69.673147E
13.	N-13	Port Colony Vadinar	22.399948N 69.716608E



Map 8: Locations for Noise Monitoring at Kandla



Map 9: Locations for Noise Monitoring at Vadinar

Methodology:

The intensity of sound energy in the environment is measured in a logarithmic scale and is expressed in a decibel (dB(A)) scale. The ordinary sound level meter measures the sound energy that reaches the microphone by converting it into electrical energy and then measures the magnitude in dB(A). Whereas, in a sophisticated type of sound level meter, an additional circuit (filters) is provided, which modifies the received signal in such a way that it replicates the sound signal as received by the human ear and the magnitude of sound level in this scale is denoted as dB(A). The sound levels are expressed in dB(A) scale for the purpose of comparison of noise levels, which is universally accepted. Noise levels were measured using an integrated sound level meter of the make Envirotech Sound Level Meter (Class-I) (model No. SLM-109). It has an indicating mode of Lp and Leq. Keeping the mode in Lp for few minutes and setting the corresponding range and the weighting network in “A” weighting set the sound level meter was run for one-hour time and Leq was measured at all locations.

Frequency

Monitoring was carried out at each noise monitoring station for Leq. noise level (Day and Night), which was recorded for 24 hours continuously at a monthly frequency with the help of Sound/Noise Level Meter (Class-1). The details of the noise monitoring have been mentioned in **Table 14**.

Table 14: Details of the Noise Monitoring

Sr. No.	Parameters	Units	Reference Method	Instrument
1.	Leq (Day)	dB(A)	IS 9989: 2014	Noise Level Meter (Class-I) model No. SLM-109
2.	Leq (Night)	dB(A)		

Standard for Noise

Ministry of Environment & Forests (MoEF) has notified the noise standards vide the Gazette notification dated February 14, 2000 for different zones under the Environment Protection Act (1986). The day time noise levels have been monitored from 6.00 AM to 10.00 PM and night noise levels were measure from 10.00 PM to 6.00 AM at all the thirteen locations (10 at Kandla and 3 at Vadinar) monthly. The specified standards are as mentioned in **Table 15** as follows:

Table 15: Ambient Air Quality norms in respect of Noise

Area Code	Category of Area	Noise dB(A) Leq	
		Daytime	Night time
A	Industrial Area	75	70
B	Commercial Area	65	55
C	Residential Area	55	45
D	Silence Zone	50	40



6.2 Result and Discussion

The details of the Noise monitoring conducted during the monitoring period have been summarized in the **Table 16** as below:

Table 16: The Results of Ambient Noise Quality

Sr. No.	Station Code	Station Name	Category of Area	Standard	Day Time			Standard	Night Time		
					Max.	Min.	Leq dB(A) Total		Max.	Min.	Leq dB(A) Total
1	N-1	Oil Jetty 7	A	75	58.1	38.9	48.5	70	42.6	35.4	39.0
2	N-2	West Gate No.1	A	75	66.1	48.0	57.1	70	50.1	41.1	45.6
3	N-3	Canteen Area	B	65	60.2	44.2	52.2	55	49.2	36.7	43.0
4	N-4	Main Gate	A	75	58.4	46.9	52.7	70	45.4	36.2	40.8
5	N-5	Main Road	A	75	60.2	39.4	49.8	70	47.6	35.6	41.6
6	N-6	Marin Bhavan	B	65	61.9	39.5	50.7	55	42.0	34.6	38.3
7	N-7	Port & Custom Building	B	65	54.6	39.4	47.0	55	46.6	36.4	41.5
8	N-8	Nirman Building	B	65	54.5	42.6	48.6	55	48.1	37.1	42.6
9	N-9	ATM Building	B	65	58.1	41.6	49.9	55	45.9	35.9	40.9
10	N-10	Wharf Area/ Jetty	A	75	61.5	42.6	52.1	70	47.2	40.6	43.9
11	N-11	Near Main Gate	A	75	67.4	57.2	60.3	75	50.4	54.6	62.3
12	N-12	Near Vadinar Jetty	A	75	69.3	63.2	63.7	75	52.1	56.3	59.6
13	N-13	Port Colony Vadinar	C	55	53.5	45.1	45.3	55	43.3	44.7	52.1

6.3 Data Interpretation and Conclusion

The noise level at both the locations (Kandla and Vadinar) was compared with the standard limits specified in NAAQS by CPCB. During the Day Time, the average noise level at all 10 locations at Kandla ranged from 47.0 dB(A) to 57.1 dB(A), while at Vadinar, the noise levels for the three-location ranged from 45.3 dB(A) to 63.7 dB(A). Whereas, during Night Time the average Noise Level ranged from 38.3 dB(A) to 45.6 dB(A) at Kandla and 52.1 dB(A) to 62.3 dB(A) at Vadinar, which was within the permissible limits for the industrial and commercial area, but exceeded slightly for location N-12, which is a residential zone. Overall, the noise levels at Kandla and Vadinar fall within the prescribed norms for both Day and Night times.

6.4 Remedial Measures

Though, the noise levels detected at the locations of Kandla and Vadinar, are found within the prescribed norms, the noise can further be considerably reduced by adoption of low noise equipment or installation of sound insulation fences. Green belt of plants can be a good barrier. If noise exceeds the applicable norms, then the working hours may be altered as a possible means to mitigate the nuisances of construction activities.



CHAPTER 7: SOIL MONITORING

7.1 Soil Quality Monitoring:

The purpose of soil quality monitoring is to track changes in the features and characteristics of the soil, especially the chemical properties of soil occurring at specific time intervals under the influence of human activity. Soil quality assessment helps to determine the status of soil functions and environmental risks associated with various practices prevalent at the location.

As defined in scope by Deendayal Port Authority (DPA), Soil Quality Monitoring shall be carried out at Six locations, four at Kandla and two at Vadinar. The details of the soil monitoring locations within the Port area of DPA are mentioned in **Table 17**:

Table 17: Details of the Soil quality monitoring

Sr. No.	Location Code	Location Name	Latitude Longitude	
1.	Kandla	S-1	Oil Jetty 7	23.043527N 70.218456E
2.		S-2	IFFCO Plant	23.040962N 70.216570E
3.		S-3	Khori Creek	22.970382N 70.223057E
4.		S-4	Nakti Creek	23.033476N 70.158461E
5.	Vadinar	S-5	Near SPM	22.400026N 69.714308E
6.		S-6	Near Vadinar Jetty	22.440759N 69.675210E

Methodology

As per the defined scope by Deendayal Port Authority (DPA), the sampling and analysis of Soil quality has been carried out on monthly basis.

The samples of soil collected from the locations of Kandla and Vadinar and analyzed for the various physico-chemical parameter. Collection and analysis of these samples was carried out as per established standard methods and procedures. The samples were analyzed for selected parameters to get the present soil quality status and environmental risks associated with various practices prevalent at the location. GEMI has framed its own guidelines for collection of soil samples titled as '*Soil Sampling Manual*'. Soil samples were collected from 30 cm depth below the surface using scrapper, filled in polythene bags, labelled on-site with specific location code and name and sent to GEMI's laboratory, Gandhinagar for further detailed analysis. The samples collected from all locations are homogeneous representative of each location. The list of parameters to be monitored under the projects for the Soil Quality Monitoring been mentioned in **Table 18** as follows:

Frequency

Monitoring is required to be carried out once a month for both the locations of Kandla and Vadinar.

Table 18: Soil parameters

Sr. No.	Parameters	Units	Reference method	Instruments
1.	TOC	%	Methods Manual Soil Testing in India January, 2011, 09. Volumetric method (Walkley and Black, 1934)	Titration Apparatus
2.	Organic Carbon	%		
3.	Inorganic Phosphate	Kg/Hectare	Practical Manual Chemical Analysis of Soil and Plant Samples, ICAR-Indian Institute of Pulses Research 2017 Determination of Available Phosphorus in Soil	UV-Visible Spectrophotometer
4.	Texture	-	Methods Manual Soil Testing in India January 2011,01	Hydrometer
5.	pH	-	IS 2720 (Part 26): 1987	pH Meter
6.	Conductivity	µS/cm	IS 14767: 2000	Conductivity Meter
7.	Particle size distribution & Silt content	-	Methods Manual Soil Testing in India January 2011	Sieves Apparatus
8.	SAR	meq/L	Procedures for Soil Analysis, International Soil Reference and Information Centre, 6 th Edition 2002 13-5.5.3 Sodium Absorption Ratio (SAR), Soluble cations	Flame Photometer
9.	Water Holding Capacity	%	NCERT, Chapter 9, 2022-23 and Water Resources Department Laboratory Testing Procedure for Soil & Water Sample Analysis	Muffle Furnace
10.	Aluminium	mg/Kg	EPA Method 3051A	ICP-OES
11.	Chromium	mg/Kg		
12.	Nickel	mg/Kg		
13.	Copper	mg/Kg	Methods Manual Soil Testing in India January, 2011, 17a	
14.	Zinc	mg/Kg	Methods Manual Soil Testing in India January, 2011, 17a	
15.	Cadmium	mg/Kg	EPA Method 3051A	
16.	Lead	mg/Kg		
17.	Arsenic	mg/Kg		
18.	Mercury	mg/Kg		

The map depicting the locations of Soil Quality Monitoring to be monitored in Kandla and Vadinar have been mentioned in **Map 10 and 11** as follows:



Map 10: Locations for Soil Quality Monitoring at Kandla



Map 11: Locations for Soil Quality Monitoring at Vadinar

7.2 Result and Discussion

The analysis results of physical analysis of the soil samples collected during environmental monitoring mentioned in **Table 19** are shown below:

Table 19: Soil Quality for the sampling period

Sr. No	Location Parameters	Unit	Kandla				Vadinar	
			S-1 (Oil Jetty 7)	S-2 (IFFCO Plant)	S-3 (Khori Creek)	S-4 (Nakti Creek)	S-5 (Near SPM)	S-6 (Near Vadinar Jetty)
1	pH	-	7.34	7.3	8.64	8.45	7.74	8.14
2	Conductivity	µS/cm	45300	27200	226	219	102	272
3	Inorganic Phosphate	Kg/ha	2.06	2.22	3.14	3.03	0.59	0.55
4	Organic Carbon	%	0.56	0.5	0.29	0.23	0.1	0.52
5	Organic Matter	%	0.96	0.86	0.49	0.39	0.17	0.89
6	SAR	meq/L	24.88	10.06	0.39	0.38	0.09	0.17
7	Aluminium	mg/Kg	11277.15	14127.51	10350.29	7708.929	12783.28	13457.49
8	Chromium	mg/Kg	53.599	62.015	53.667	35.6	51.109	55.378
9	Nickel	mg/Kg	14.22	5.764	13.391	5.668	18.72	24.346
10	Copper	mg/Kg	83.233	123.235	14.591	14.22	63.292	67.75
11	Zinc	mg/Kg	146.081	45.517	32.38	17.203	37.242	55.477
12	Cadmium	mg/Kg	BQL	BQL	BQL	BQL	BQL	BQL
13	Lead	mg/Kg	15.314	5.068	2.698	1.591	BQL	BQL
14	Arsenic	mg/Kg	0.198	BQL	2.298	0.795	BQL	BQL
15	Mercury	mg/Kg	BQL	BQL	BQL	BQL	BQL	BQL
16	Water Holding Capacity	%	37.98	43.96	40	39.97	37.95	51.9
17	Sand	%	61.52	65.55	77.54	75.53	72.81	74.8
18	Silt	%	33.44	31.41	11.43	13.44	26.15	24.16
19	Clay	%	5.04	3.04	11.03	11.04	1.04	1.04
20	Texture	-	Sandy loam	Sandy loam	Sandy loam	Sandy loam	Loamy sand	loamy sand

7.3 Data Interpretation and Conclusion

Soil samples were collected from 6 locations (4 at Kandla and 2 at Vadinar) and further analysed for its physical & chemical characteristics. Each of the parameters have been given an interpretation based on the observations as follows:

- The value of **pH** ranges from **7.3 to 8.64**, highest at location S-3 (Khori Creek) and lowest at S-2 (IFFCO Plant); while the average pH for Kandla was observed to be 7.93. Whereas, at Vadinar the pH was observed as 7.74 at S-5 i.e., Near SPM and 8.14 at S-6

i.e., Near Jetty Area. The pH in Kandla varies from the **Slightly alkaline to strongly alkaline**. Whereas, pH of Soil at Vadinar was found to be **Slightly alkaline**.

- At entire monitoring locations of Kandla the value of **Electrical Conductivity** ranges from **219 to 45300 $\mu\text{s}/\text{cm}$** , highest at location S-1 (Oil Jetty 7) and lowest at S-4 (Nakti Creek), with the average as **18236.25 $\mu\text{s}/\text{cm}$** . Whereas, at Vadinar the conductivity falls within the range of **102 to 272 $\mu\text{s}/\text{cm}$** with an average value of **187 $\mu\text{s}/\text{cm}$** .
- At Kandla, the concentration of **Inorganic Phosphate** varied from **2.06 to 3.14 Kg/ha**, with average 2.61 Kg/ha. Whereas, at the locations of Vadinar, the Inorganic Phosphate was observed as 0.59 Kg/ha at S-5 (Near SPM) and 0.55 Kg/ha at S-6 (near Jetty Area), with the average 0.57 Kg/ha. The phosphorus availability in soil solution is influenced by a number of factors such as Organic matter, clay content, pH, temperature, etc.
- The concentration of **Total Organic Carbon** ranges from 0.23 to 0.56% while the average TOC at Kandla was detected as 0.39%. Whereas, at Vadinar the average TOC was found to be 0.31% where the observed TOC value found at S-5 and S-6 to be 0.1% and 0.52% respectively.
- The **Sodium Adsorption Ratio** ranges from **0.38 to 24.88 meq/L** with an average value 8.92 meq/L at Kandla. Whereas, at Vadinar, the average SAR was found to be 0.13 meq/L where the observed SAR value found at S-5 (0.09 meq/L) and S-6 (0.17 meq/L).
- The **Water Holding Capacity** in the soil samples of Kandla and Vadinar varies from 37.98 to 43.96% and 37.95 to 51.9% respectively.
- The Soil Texture was observed as “Sandy loam” at all the monitoring locations in Kandla and Vadinar, except the location S-6 of Vadinar which is “loamy sand”.

Heavy Metals

- For the sampling period, the concentration of **Aluminium** varied from **7708.929 to 14127.509 mg/kg** at Kandla, and **12783.28 to 13457.493 mg/kg** at Vadinar. Whereas, the average Aluminium concentration was observed to be 10865.97 and 13120.39 mg/kg at Kandla and Vadinar monitoring station respectively.
- The concentration of **Chromium** varied from **35.6 to 62.015 mg/kg** at Kandla and **51.109 to 55.378 mg/kg** at Vadinar and the average value was observed to be 51.22 and 53.24 mg/kg at Kandla and Vadinar monitoring station, respectively.

The concentration of **Nickel** varied from **5.668 to 14.22 mg/kg** at Kandla and **18.72 to 24.346 mg/kg** at Vadinar and the average value was observed to be 9.76 and 21.533 mg/kg at Kandla and Vadinar monitoring station, respectively.

- The concentration of **Zinc** varied from **17.203 to 146.081 mg/kg** at Kandla and **37.242 to 55.477 mg/kg** at Vadinar and the average value was observed to be 60.29 and 46.35 mg/kg at Kandla and Vadinar monitoring station, respectively.
- The concentration of **copper** varied from **14.22 to 123.235 mg/kg** at Kandla and **63.292 to 67.75 mg/kg** at Vadinar and the average value was observed to be 58.81 and 65.52 mg/kg at Kandla and Vadinar monitoring station, respectively.
- Concentration of **Lead** varied from **1.59 to 15.31 mg/kg** at Kandla with average value 6.16 mg/Kg, whereas for Vadinar, the values recorded 6.57 mg/Kg at S-5 and “Below Quantification Limit” at location at S-6 location.
- The concentration of **Arsenic** varied from **0.19 to 2.29 mg/kg** at Kandla with average value 1.09 mg/Kg, whereas for Vadinar, the values recorded 6.57 mg/Kg at S-5 and “Below Quantification Limit” at location at S-6 location.
- While other heavy metals in the Soil i.e., **Mercury and Cadmium** were observed “Below Quantification Limit” for the soil samples collected at Kandla and Vadinar.



CHAPTER 8: DRINKING WATER MONITORING

8.1 Drinking Water Monitoring

It is necessary to check with the drinking water sources regularly so as to know whether water quality conforms to the prescribed standards for drinking. Monitoring the drinking water quality is essential to protect human health and the environment. With reference to the scope specified by DPA, a total of 20 locations (18 at Kandla and 2 at Vadinar) were monitored to assess the Drinking Water quality.

The details of the drinking water sampling stations have been mentioned in **Table 20** and the locations have been depicted through Google map in **Map 12 and 13**.

Table 20: Details of Drinking Water Sampling Locations

Sr. No.	Location Code	Location Name	Latitude/ Longitude
1.	DW-1	Oil Jetty 7	23.043527N 70.218456E
2.	DW-2	Port & Custom Building	23.009033N 70.222047E
3.	DW-3	North Gate	23.007938N 70.222411E
4.	DW-4	Workshop	23.009372N 70.222236E
5.	DW-5	Canteen Area	23.003707N 70.221331E
6.	DW-6	West Gate 1	23.006771N 70.217340E
7.	DW-7	Sewa Sadan -3	23.009779N 70.221838E
8.	DW-8	Nirman Building	23.009642N 70.220623E
9.	DW-9	Custom Building	23.018930N 70.214478E
10.	DW-10	Port Colony Kandla	23.019392N 70.212619E
11.	DW-11	Wharf Area/ Jetty	22.997833N 70.223042E
12.	DW-12	Hospital Kandla	23.018061N 70.212328E
13.	DW-13	A.O. Building	23.061914N 70.144861E
14.	DW-14	School Gopalpuri	23.083619N 70.132061E
15.	DW-15	Guest House	23.078830N 70.131008E
16.	DW-16	E- Type Quarter	23.083306N 70.132422E
17.	DW-17	F- Type Quarter	23.077347N 70.135731E
18.	DW-18	Hospital Gopalpuri	23.081850N 70.135347E
19.	DW-19	Near Vadinar Jetty	22.440759N 69.675210E
20.	DW-20	Near Port Colony	22.401619N 69.716822E



Map 12: Locations for Drinking Water Monitoring at Kandla



Map 13: Locations for Drinking Water Monitoring at Vadinar

Methodology

The water samples were collected from the finalized sampling locations and analyzed for physico-chemical and microbiological parameter, for which the analysis was carried out as per APHA, 23rd Edition and Indian Standard method in GEMI's NABL Accredited Laboratory, Gandhinagar. GEMI has followed the CPCB guideline as well as framed its own guidelines for the collection of water/wastewater samples, under the provision of Water (Preservation and Control of Pollution) Act 1974, titled as '**Sampling Protocol for Water & Wastewater**'; approved by the Government of Gujarat vide letter no. ENV-102013-299-E dated 24-04-2014. The samples under the study were collected and preserved as per the said Protocol. The parameters finalized to assess the drinking water quality have been mentioned in **Table 21** as follows:

Table 21: List of parameters for Drinking Water Quality monitoring

Sr. No.	Parameters	Units	Reference method	Instrument
1.	pH	-	APHA, 23 rd Edition (Section-4500-H ⁺ B):2017	pH Meter
2.	Colour	Hazen	APHA, 23 rd Edition, 2120 B:2017	Color Comparator
3.	EC	µS/cm	APHA, 23 rd Edition (Section-2510 B):2017	Conductivity Meter
4.	Turbidity	NTU	APHA, 23 rd Edition (Section -2130 B):2017	Nephlo Turbidity Meter
5.	TDS	mg/L	APHA, 23 rd Edition (Section-2540 C):2017	Vaccum Pump with filtration assembly and Oven
6.	TSS	mg/L	APHA, 23 rd Edition, 2540 D: 2017	
7.	Chloride	mg/L	APHA, 23 rd Edition (Section-4500-Cl-B):2017	Titration Apparatus
8.	Total Hardness	mg/L	APHA, 23 rd Edition (Section-2340 C):2017	
9.	Ca Hardness	mg/L	APHA, 23 rd Edition (Section-3500-Ca B):2017	
10.	Mg Hardness	mg/L	APHA, 23 rd Edition (Section-3500-Mg B):2017	
11.	Free Residual Chlorine	mg/L	APHA 23 rd Edition, 4500	
12.	Fluoride	mg/L	APHA, 23 rd Edition (Section-4500-F-D):2017	UV- Visible Spectrophotometer
13.	Sulphate	mg/L	APHA, 23 rd Edition (Section 4500-SO ₄ -2-E):2017	
14.	Sodium	mg/L	APHA, 23 rd Edition (Section-3500-Na-B):2017	Flame Photometer
15.	Potassium	mg/L	APHA, 23 rd Edition, 3500 K-B: 2017	
16.	Salinity	mg/L	APHA, 23 rd Edition (section 2520 B, E.C. Method)	Salinity /TDS Meter
17.	Nitrate	mg/L	APHA, 23 rd Edition, 4500 NO ₃ - B: 2017	UV- Visible Spectrophotometer
18.	Nitrite	mg/L	APHA, 23 rd Edition, 4500 NO ₂ -B: 2017	



Sr. No.	Parameters	Units	Reference method	Instrument
19.	Hexavalent Chromium	mg/L	APHA, 23 rd Edition, 3500 Cr B: 2017	
20.	Manganese	mg/L	APHA, 23 rd Edition, ICP Method 3120 B: 2017	ICP-OES
21.	Mercury	mg/L	EPA 200.7	
22.	Lead	mg/L	APHA ICP 23 rd Edition (Section-3120 B):2017	
23.	Cadmium	mg/L	APHA ICP 23 rd Edition (Section-3120 B):2017	
24.	Iron	mg/L	APHA ICP 23 rd Edition (Section-3120 B):2017	
25.	Total Chromium	mg/L	APHA ICP 23 rd Edition (Section-3120 B):2017	
26.	Copper	mg/L	APHA, 23 rd Edition, ICP Method 3120 B: 2017	ICP-OES
27.	Zinc	mg/L	APHA ICP 23 rd Edition (Section-3120 B):2017	
28.	Arsenic	mg/L	APHA ICP 23 rd Edition (Section-3120 B):2017	
29.	Total Coliforms	MPN/100ml	IS 15185: 2016	LAF/ Incubator



8.2 Result and Discussion

The drinking water quality of the locations at Kandla and Vadinar and its comparison with the to the stipulated standard (Drinking Water Specifications i.e., IS: 10500:2012) have been summarized in **Table 22** as follows:

Table 22: Summarized results of Drinking Water quality

Sr. No.	Parameters	Units	Standard values as per IS		Kandla																		Vadinar		
			A	P	DW-1	DW-2	DW-3	DW-4	DW-5	DW-6	DW-7	DW-8	DW-9	DW-10	DW-11	DW-12	DW-13	DW-14	DW-15	DW-16	DW-17	DW-18	DW-19	DW-20	
1.	pH	-	6.5-8.5	-	8.34	6.41	7.67	8.78	7.63	8.26	8.48	8.50	7.79	8.15	7.87	7.88	7.90	8.10	7.85	7.01	6.99	6.91	7.58	7.30	
2.	Colour	Hazen	5	15	1	1	5	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	
3.	EC	µS/ cm	-	-	15	44.56	677	48.7	1004	88.4	14.05	31	703	210	1041	57.9	123.7	173	169.9	165	158.6	68	499	113.9	
4.	Salinity	PSU	-	-	0.02	0.21	0.33	0.03	0.49	0.05	0.02	0.02	0.34	0.10	0.51	0.03	0.06	0.09	0.08	0.08	0.08	0.04	0.24	0.06	
5.	Turbidity	NTU	1	5	BQL	BQL	0.52	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	0.68	BQL	
6.	Chloride	mg/L	250	1000	4.96	8.55	119.1 1	6.95	193.56	17.87	4.47	7.94	119.1 1	45.16	203.48	14.39	23.33	33.25	36.23	32.26	35.73	17.87	71.47	17.87	
7.	Total Hardness	mg/L	200	600	2.5	8	165	13	200	7	BQL	3.5	170	20	210	4	25.0	40	12.5	25	7.5	12	130	20	
8.	Ca Hardness	mg/L	-	-	1.5	6	100	10	115	5.5	1	2.5	85	5	125	3	12.5	15	7.5	12.5	2.5	5	60	5	
9.	Mg Hardness	mg/L	-	-	1	2	65	3	85	1.5	BQL	1	85	15	85	1	12.5	25	5	12.5	5	7	70	15	
10.	Free Residual Chlorine	mg/L	0.2	1	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	4.96	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	
11.	TDS	mg/L	500	2000	8	22	356	26	516	46	8	16	362	108	538	30	66	94	88	86	82	36	258	60	
12.	TSS	mg/L	-	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	
13.	Fluoride	mg/L	1.0	1.5	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	0.318	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	0.500	0.360
14.	Sulphate	mg/L	200	400	BQL	BQL	33.51 6	BQL	52.375	BQL	BQL	BQL	38.32 6	BQL	66.402	BQL	BQL	BQL	BQL	21.771	BQL	BQL	33.620	BQL	
15.	Nitrate	mg/L	45	-	BQL	BQL	2.783	BQL	28.36	5.037	BQL	BQL	2.242	1.865	30.93	BQL	BQL	1.330	1.353	BQL	4.432	BQL	3.584	BQL	
16.	Nitrite	mg/L	-	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	1.638	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	



Environmental Monitoring Report of Deendayal Port Authority, June-July 2024

Sr. No.	Parameters	Units	Standard values as per IS		Kandla																		Vadinar	
			A	P	DW-1	DW-2	DW-3	DW-4	DW-5	DW-6	DW-7	DW-8	DW-9	DW-10	DW-11	DW-12	DW-13	DW-14	DW-15	DW-16	DW-17	DW-18	DW-19	DW-20
17.	Sodium	mg/L	-	-	BQL	BQL	72.16	BQL	109.19	16.59	BQL	BQL	78.98	28.79	109.58	10.72	16.16	19.30	27.45	21.13	28.99	13.51	54.54	17.05
18.	Potassium	mg/L	-	-	BQL	BQL	BQL	BQL	7.22	BQL	BQL	BQL	BQL	BQL	7.89	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
19.	Hexavalent Chromium	mg/L	-	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
20.	Odour	TON	Agreeable		1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1
21.	Arsenic	mg/L	0.01	0.05	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
22.	Cadmium	mg/L	0.003	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
23.	Copper	mg/L	0.05	1.5	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
24.	Iron	mg/L	0.3	-	BQL	BQL	BQL	0.119	BQL	BQL	BQL	BQL	BQL	0.126	BQL	0.872	BQL	0.121	BQL	0.252	BQL	0.109	0.128	BQL
25.	Lead	mg/L	0.01	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
26.	Manganese	mg/L	0.1	0.3	BQL	BQL	BQL	BQL	BQL	BQL	BQL	0.059	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
27.	Mercury	mg/L	0.001	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
28.	Total Chromium	mg/L	0.05	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
29.	Zinc	mg/L	5	15	BQL	BQL	BQL	BQL	BQL	BQL	BQL	3.964	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
30.	Total Coliform*	MPN/100ml	Shall not be detected		5110	380	695	BQL	3100	130	10	2018	1060	BQL	4250	BQL	35	BQL	3400	BQL	385	85	85	75

A: Acceptable, P:Permissible, BQL: Below Quantification limit Turbidity (QL=0.5 NTU), Free Residual Chlorine (QL=2 mg/L), Total Suspended Solids (QL=2 mg/L), Fluoride (QL=0.3 mg/L), Sulphate (QL=10 mg/L), Nitrate as NO₃ (QL=1 mg/L), Nitrite as NO₂ (QL=0.1mg/L), Sodium as Na (QL=5mg/L), Potassium as K (QL=5mg/L), Hexavalent Chromium (QL=0.01 mg/L), Arsenic (QL=0.005 mg/L), Cadmium (QL=0.002 mg/L), Copper (QL=0.005 mg/L), Iron (QL=0.1mg/L), Lead (QL=0.002 mg/L), Manganese (QL=0.04 mg/L), Mercury (QL=0.0005 mg/L), Total Chromium (QL=0.005 mg/L), Zinc (QL=0.5 mg/L), Total Coliforms (QL=1 MPN/ 100ml)

*Note: For Total Coliform, one MPN is equivalent to one CFU. The use of either method; MPN or CFU for the detection of bacteria are considered valid measurements for bacteria limits.

8.3 Data Interpretation and Conclusion

Drinking water samples were taken from 20 locations (18 at Kandla and 2 at Vadinar), and their physical and chemical properties were analyzed. The analysis's results were compared with standard values as prescribed in IS 10500:2012 Drinking Water Specification.

- **pH:** The pH values of drinking water samples in Kandla were reported to be in the range of **6.41 to 8.78**, with an average pH of 7.80. In Vadinar, its values ranged from **7.30 to 7.58**, with an average pH of 7.44. Notably, the pH levels at both project sites fall within the acceptable range of 6.5 to 8.5, except the location DW-2 & DW-4, as specified under IS:10500:2012.
- **Colour:** The colour varies from 1 to 5 at the monitoring locations of Kandla. Only locations DW-3 showed the value of 5 Hazen, whereas, all the other locations showed a value of 1 in Hazen at Kandla. At Vadinar, the color was observed to be 1 Hazen at both the monitoring locations.
- **Electrical Conductivity (EC):** It is a measure of the ability of a solution to conduct electric current, and it is often used as an indicator of the concentration of dissolved solids in water. During the monitoring period, the EC values for samples collected in Kandla were observed to range from **14.05 to 1041 µS/cm**, with an average value of 266.26 µS/cm. In Vadinar, the EC values showed variation from **113.9 to 499 µS/cm**, with an average value of 306.45 µS/cm. It's important to regularly monitor EC levels in drinking water as it can provide valuable information about water quality and presence of dissolved substances.
- **Salinity:** Salinity at Kandla varies from **0.02 to 0.51 PSU** with an average of 0.14 PSU, while at Vadinar, salinity was observed to be 0.24 and **0.06 PSU** for locations DW-19 & DW-20 respectively.
- **Turbidity:** At the drinking water locations of Kandla, the turbidity was found BQL for all locations except locations DW-3 (0.52 NTU). Whereas, at Vadinar the value of turbidity was reported 0.68 NTU at DW-19 and BQL at DW-20 respectively.
- **Chlorides:** The chloride concentrations in Kandla varied from **4.47 to 203.48 mg/L**, with an average value of 51.34 mg/L. At Vadinar the locations DW-19 and DW-20, the chloride concentration was observed as 71.47 mg/L and 17.87 mg/L, with an average value of 44.67 mg/L. Thus, the chloride levels at both project sites fall within the acceptable limit of 250 mg/L, as specified under IS:10500:2012.
- **Total Hardness (TH):** The concentration of Total Hardness varies from **2.5 to 210 mg/L**, with an average concentration of 54.41 mg/L. At location DW-11, the total hardness was observed 210 mg/L, which exceeds the acceptable limit but falls within the permissible limit. While at Vadinar, the observed values were 130 & 20 mg/L; at locations DW-19 & D-20, with an average concentration of 75 mg/L. which was found to be within the acceptable norm of 200 mg/L as specified by IS:10500:2012 and is not harmful for local inhabitants.
- **Total Dissolved Solids (TDS):** Monitoring TDS is crucial because it provides an indication of overall quality of the water. During the monitoring period, the TDS concentrations in Kandla were observed to vary in a wide range i.e., between 8 to 538 mg/L, with an average concentration of 138.22 mg/L. At Locations DW-11, the TDS

value is 538 mg/L, which is more than the acceptable limit but within the permissible limit. while in Vadinar, it ranged from 60 to 258 mg/L, with an average of 159 mg/L. It is important to note that the TDS concentrations in both Kandla and Vadinar fall well within the acceptable limit of 500 mg/L.

- **Fluoride:** The concentration was found BQL, at all of the monitoring location except for locations DW-11 (0.31 mg/L) at Kandla. While at Vadinar Fluoride concentration was reported to be 0.500 & 0.360 mg/L respectively at both of the monitoring location.
- **Sulphate:** At the monitoring locations of Kandla, the sulphate concentrations were recorded BQL for majority of the locations except the locations DW-3(33.516 mg/L), DW-5 (52.375 mg/L), DW-9 (38.326 mg/L), DW-11 (66.402 mg/L), and DW-16 (21.771 mg/L). In Vadinar, the sulphate concentration was observed 33.620 mg/L at location DW-19 and BQL at location DW-20. During monitoring period in Kandla and Vadinar, the sulphate concentrations were found to be within the acceptable limits i.e., 200 mg/L as per the specified norms.
- **Nitrate:** During the monitoring period, at Kandla & Vadinar variation in the concentration of Nitrate was observed to be in the range of **1.33 to 30.93 mg/L**, with the average concentration of 8.70 mg/L and locations DW-1, DW-2, DW-4, DW-7, DW-8, DW-12, DW-13, DW-16 and DW-18 were recorded as “BQL”. While at Vadinar, the concentration recorded 3.584 mg/L at location DW-19 and BQL at location DW-20.
- **Nitrite:** Except locations DW-11 (1.638 mg/L), all monitoring locations showed the Nitrite concentration as BQL at Kandla & Vadinar.
- **Sodium:** During the monitoring period, at Kandla variation in the concentration of Sodium was observed to be in the range of **10.72 to 109.58 mg/L**, with the average concentration of 42.50 mg/L and Location DW-1, DW-2, DW-4, DW-7 & DW-8 showed the BQL concentration for Sodium. While at Vadinar, the concentration recorded 54.54 mg/L at DW-19 and 17.05 mg/L at DW-20.
- **Odour:** Odour values recorded 1 TON at all monitoring locations of Kandla and Vadinar.
- **Arsenic:** In Kandla & Vadinar, the Arsenic concentrations were recorded BQL for all of the locations.
- **Copper:** In Kandla & Vadinar, the Copper concentrations were recorded BQL for all of the locations.
- **Iron:** Except for locations DW-4 (0.119 mg/L), DW-10 (0.126 mg/L), DW-12 (0.872 mg/L), DW-14 (0.121 mg/L), DW-16 (0.252 mg/L), and DW-18 (0.109 mg/L), the other locations were observed to have concentrations Below the detection Limit at Kandla. Whereas, at Vadinar the Copper concentrations were recorded 0.128 mg/L & BQL for locations DW-19 and DW-20 respectively.
- **Lead:** In Kandla & Vadinar, the Lead concentrations were recorded BQL for all of the locations.
- **Manganese:** All of locations observed to have BQL concentration for both the monitoring locations at Kandla and Vadinar except the location DW-8 (0.059 mg/L).
- **Free Residual Chlorine:** Free Residual Chlorine concentrations at all monitoring locations, including Kandla and Vadinar, were observed to be below quantifiable limits (BQL) except at location DW-11, where a concentration of 4.96 mg/L was

recorded. According to health standards, concentrations exceeding 4 mg/L are considered unsafe for human health, potentially leading to adverse health effects.

- The parameters such as **Free Residual Chlorine, Total Suspended Solid, Potassium Hexavalent Chromium** and **the metals (Cadmium, Mercury, Total Chromium and Zinc)** were all observed to have concentrations “Below the Quantification Limit (BQL)” at majority of the locations during the monitoring period.
- Bacteriological Analysis of the drinking water reveals that **Total Coliforms (TC)** were detected in higher number at location DW-1 (5110 MPN/100ml), DW-11 (4250 MPN/100ml), DW-15 (3400 MPN/100ml), DW-5 (3110 MPN/100ml) & DW-8 (2018 MPN/100ml). Whereas, TC were also detected at locations DW-2 (380 MPN/100ml), DW-3 (695 MPN/100ml), DW-6 (130 MPN/100ml), DW-7 (10 MPN/100 ml), DW-9 (1060 MPN/100 ml), DW-13 (35 MPN/100 ml), DW-17 (385 MPN/100 ml), DW-18 (85 MPN/100 ml), DW-19 (75 MPN/100 ml) and DW-20 (5 MPN/100 ml) and for the rest of the monitoring locations of Kandla and Vadinar were detected “Below the Quantification Limit (BQL)”. Reporting such concentration of Coliforms indicates certain external influx may contaminate the source. Hence, it should be checked at every distribution point.

8.4 Remedial Measures

Appropriate water treatment processes should be administered to eradicate coliform bacteria. The methods of disinfection such as **chlorination, ultraviolet (UV), or ozone** etc, apart from that, filtration systems can also be implemented to remove bacteria, sediment, and other impurities.

The following steps can be implemented to ensure that the water being supplied is safe for consumption:

- Regular monitoring should be carried out to assess the quality of drinking water at various stages, including the source, purification plants, distribution network, and consumer endpoints would help in early detection of coliform bacteria or other contaminants in the drinking water.
- It is necessary to carry out a system assessment to determine whether the drinking-water supply chain (up to the point of consumption) as a whole can deliver water of a quality that meets identified targets. This also includes the assessment of design criteria of the treatment systems employed.
- Identifying control measures in a drinking-water system that will collectively control identified risks and ensure that the health-based targets are met. For each control measure identified, an appropriate means of operational monitoring should be defined that will ensure that any deviation from required performance (water quality) is rapidly detected in a timely manner.
- Management and communication plan should be formulated describing actions to be taken during normal operation as well as during incident conditions (such as drinking water contamination) and documenting the same.



CHAPTER 9: SEWAGE TREATMENT PLANT MONITORING

9.1 Sewage Treatment Plant (STP) Monitoring:

The principal objective of STP is to remove contaminants from sewage to produce an effluent that is suitable to discharge to the surrounding environment or an intended reuse application, thereby preventing water pollution from raw sewage discharges. As defined in the scope by Deendayal Port Authority (DPA), Kandla, the STP Monitoring is to be carried out weekly at three locations, one at Kandla, one at Gopalpuri and one STP at Vadinar. The samples from the inlet and outlet of the STP have been collected weekly. The details of the locations of STP to be monitored for Kandla and Vadinar have been mentioned in **Table 23** as follows:

Table 23: Details of the monitoring locations of STP

Sr. No.	Location Code		Location Name	Latitude Longitude
1.	Kandla	STP-1	STP Kandla	23.021017N 70.215594E
2.		STP-2	STP Gopalpuri	23.077783N 70.136759E
3.	Vadinar	STP-3	STP at Vadinar	22.406289N 69.714689E

The Consolidated Consent and Authorization (CC&A) issued by the GPCB were referred for the details of the STP for Kandla and Gopalpuri. The CC&A of Kandla and Gopalpuri entails that the treated domestic sewage should conform to the norms specified in **Table 24**. The treated effluent conforming to the norms shall be discharged on the land within the premises strictly for the gardening and plantation purpose. Whereas, no sewage shall be disposed outside the premises in any manner.

Table 24: Treated effluent Standards (as per CC&A of Kandla STP)

Sr. No.	Parameters	Prescribed limits
1.	pH	6.5-8.5
2.	BOD (3 days at 27°C)	30 mg/L
3.	Suspended Solids	100 mg/L
4.	Fecal Coliform	< 1000 MPN/100 ml

The detailed process flow diagram of the Kandla and Gopalpuri STP have been mentioned in **Figure 3 and 4** as follows:

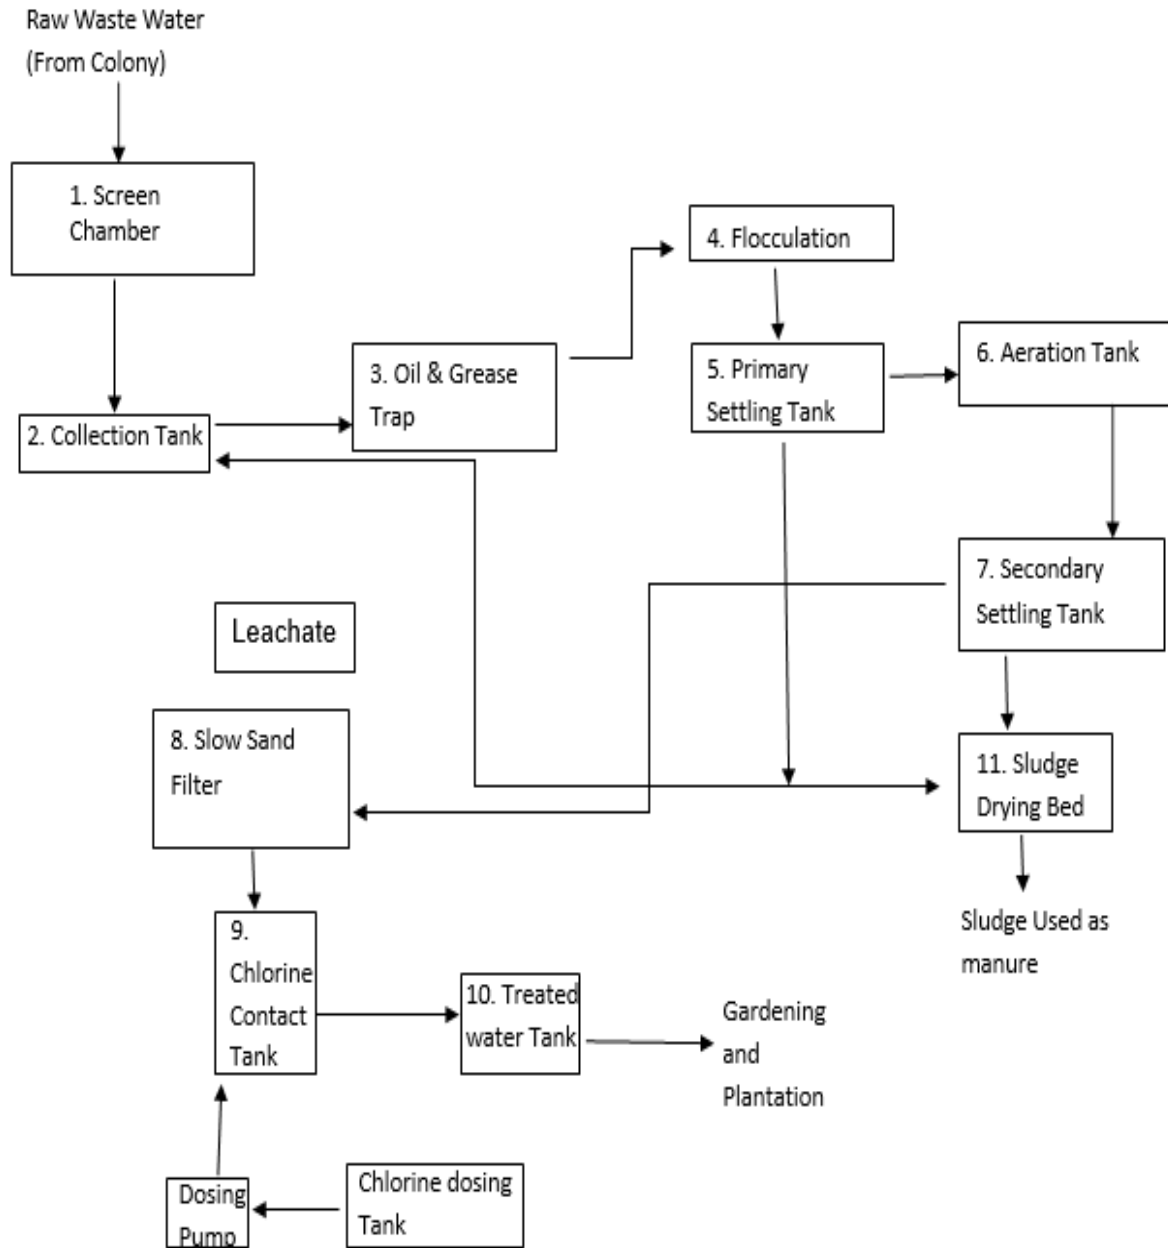


Figure 3: Process flow diagram of STP at Kandla

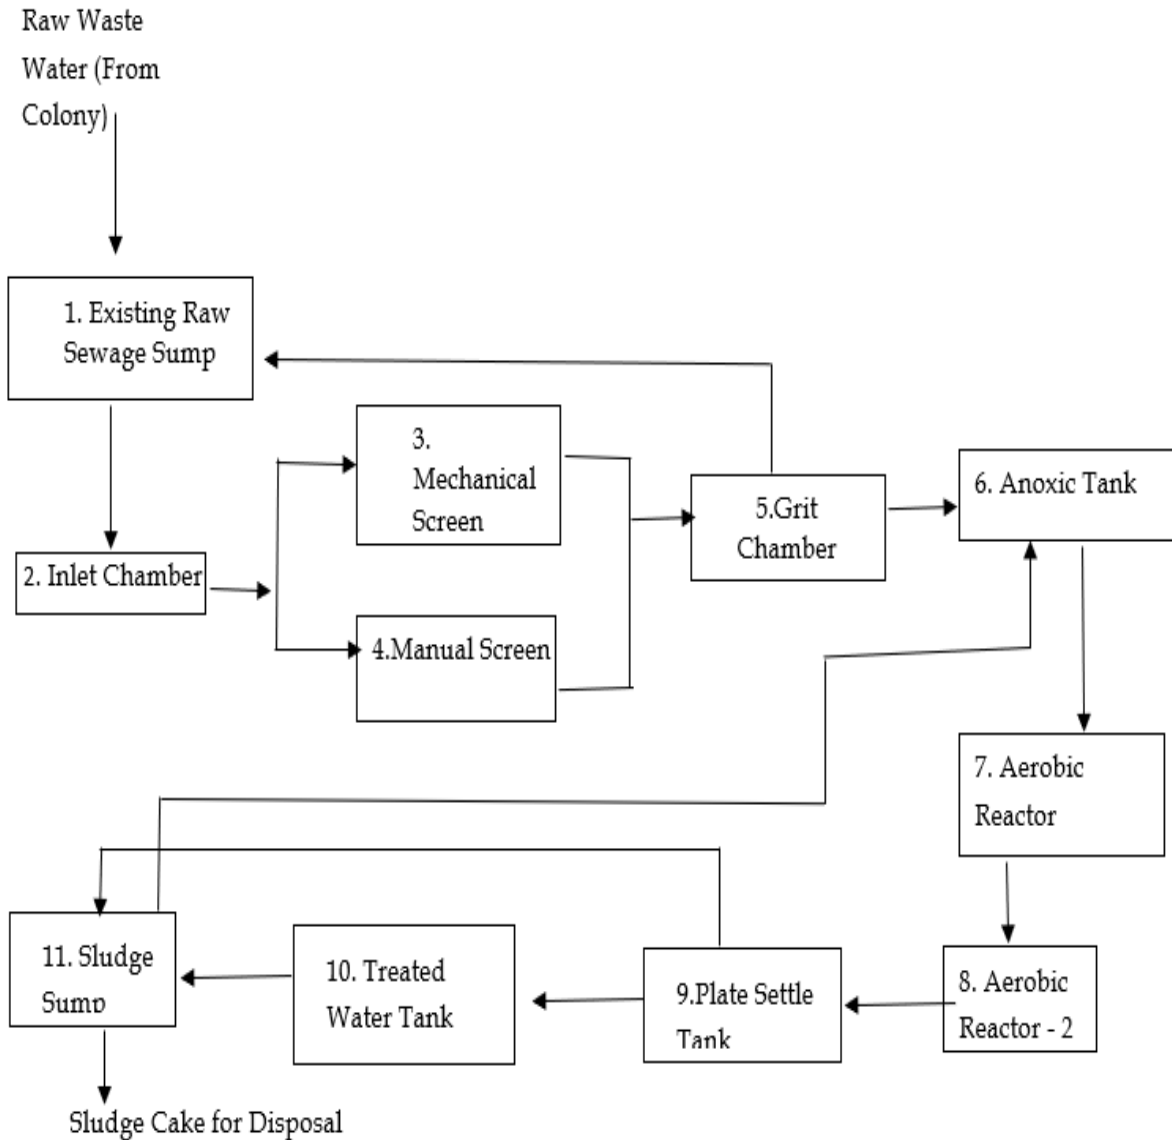


Figure 4: Process flow diagram of STP at Gopalpuri

STP at Vadinar

The STP at Vadinar has been built with a treatment capacity of 450 KLD/day. The Consolidated Consent and Authorization (CC&A) issued by the GPCB has been referred for the details of the said STP. The CC&A of the Vadinar STP suggests that the domestic effluent generated shall be treated as per the norms specified in **Table 25**. The treated effluent conforming to the norms shall be discharged on the land within the premises strictly for the gardening and plantation purpose. Whereas, no sewage shall be disposed outside the premises in any manner.

Table 25: Norms of treated effluent as per CC&A of Vadinar STP

Sr. No.	Parameters	Prescribed limits
1.	pH	5.5-9
2.	BOD (3 days at 27°C)	10 mg/L
3.	Suspended Solids	20 mg/L
4.	Fecal Coliform	Desirable 100 MPN/100 ml Permissible 230 MPN/100 ml
5.	COD	50 mg/L

The detailed process flow diagram of the Vadinar STP have been mentioned in **Figure 5** as follows:


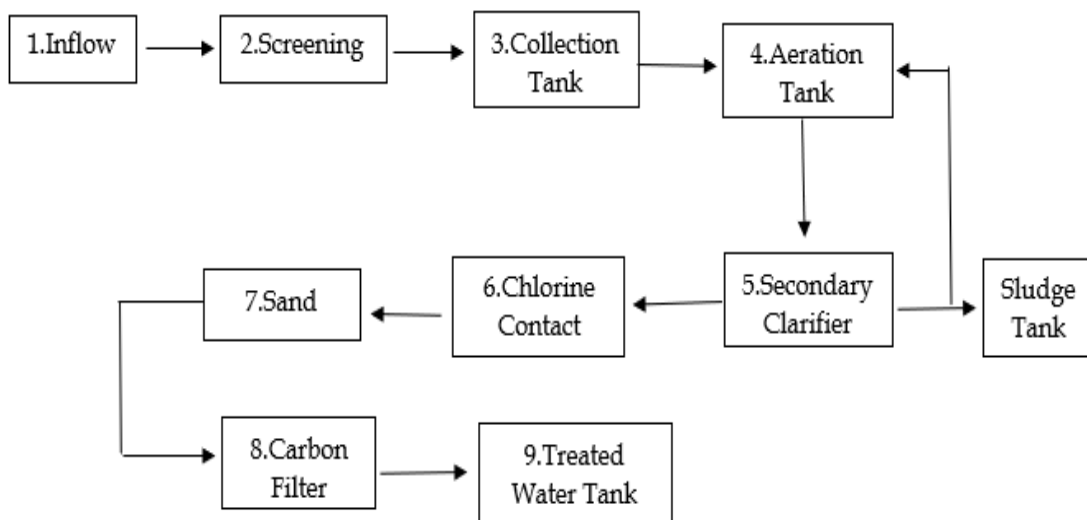


Figure 5: Process flowchart for the STP at Vadinar

The map depicting the locations of STP to be monitored in Kandla and Vadinar have been shown in **Map 14 and 15** as follows:



Map 14: Locations for STP Monitoring at Kandla

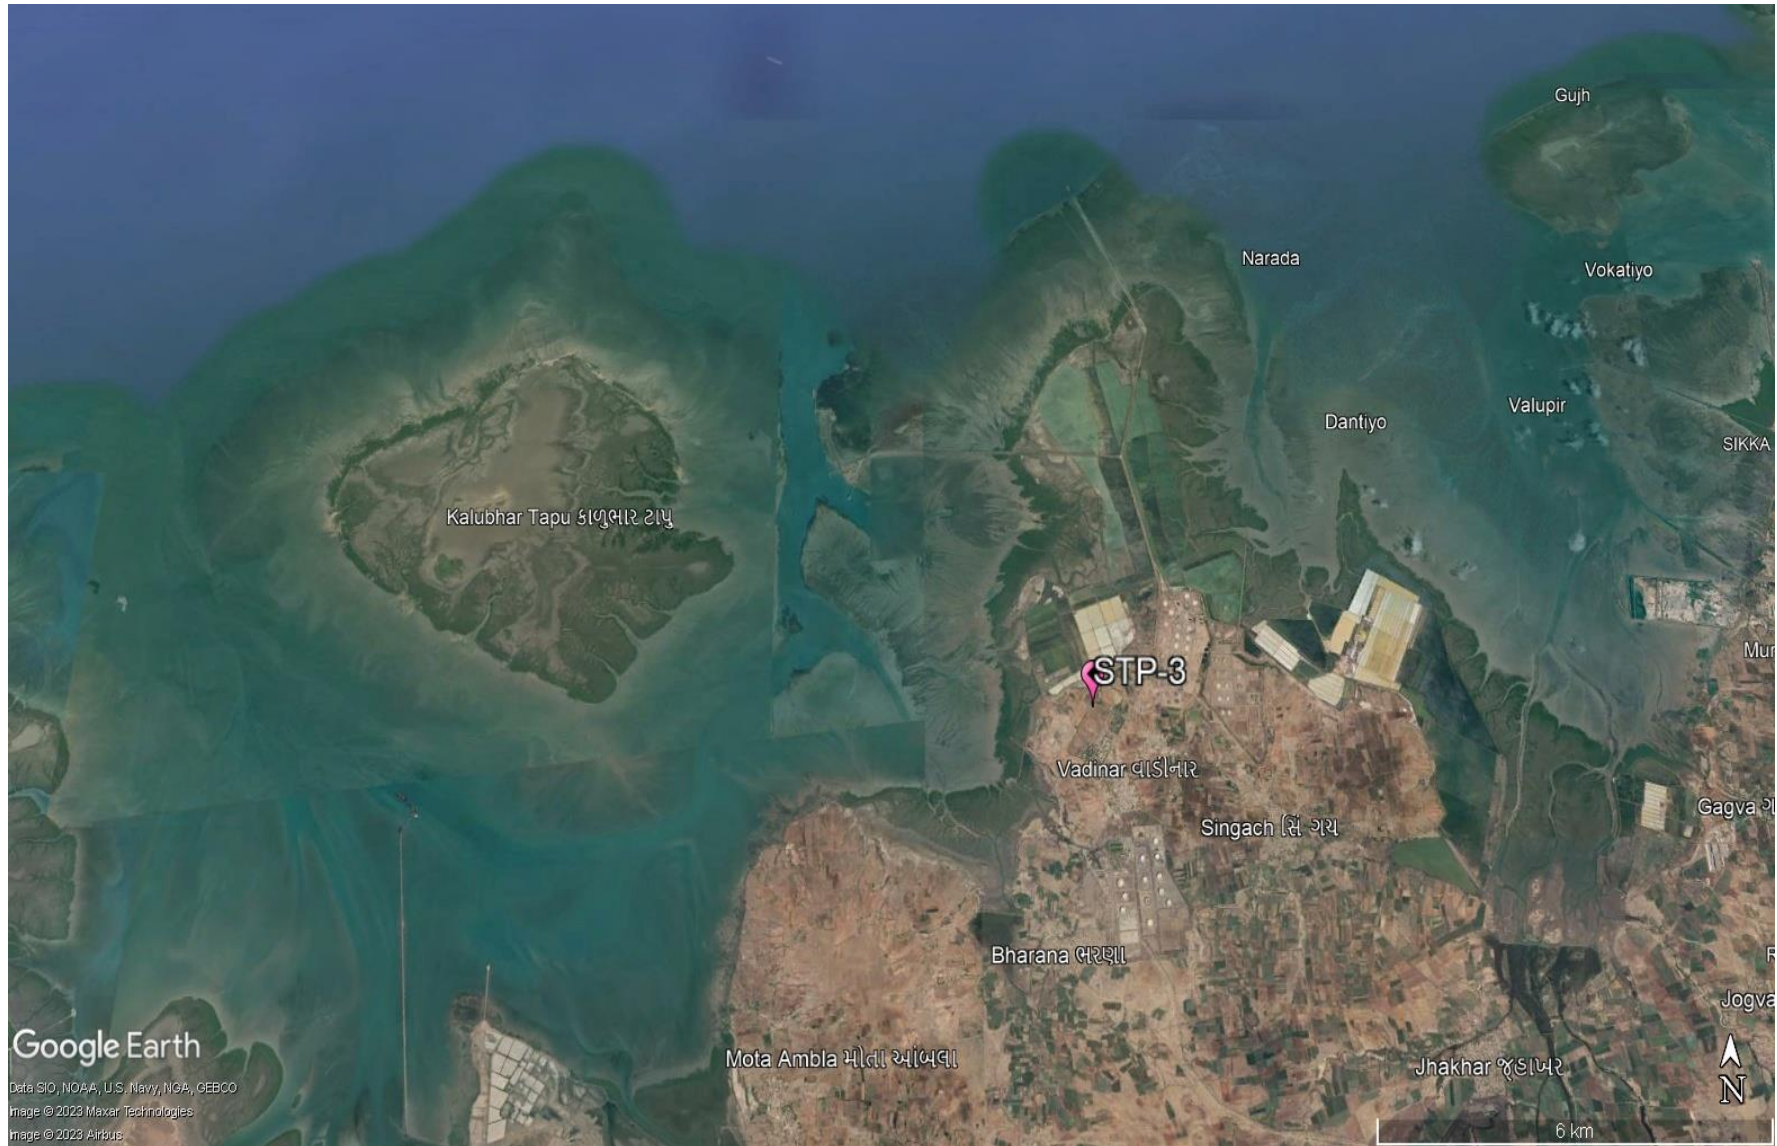

Map 15: Locations for STP Monitoring at Vadinar

Methodology

As per the defined scope by DPA, the sampling and analysis of water samples from the inlet and outlet of the STP's of Kandla and Vadinar are carried out once a week, i.e., four times a month.

The water samples were collected from inlet and the outlet of the STP's and analyzed for physico-chemical and microbiological parameter. Collection and analysis of these samples was carried out as per established standard methods and procedures for the examination of water. The samples were analyzed for selected parameters to establish the existing water quality of the inlet and outlet points of the STP. GEMI has framed its own guidelines for collection of water/wastewater samples titled as 'Sampling Protocol for Water & Wastewater'; which has been approved by the Government of Gujarat vide letter no. ENV-102013-299-E dated 24-04-2014 under the provision of Water (Preservation and Control of Pollution) Act 1974. The sample collection and preservation are done as per the said Protocol. Under the project, the list of parameters to be monitored for the STP have been mentioned in **Table 26** as follows:

Frequency

Monitoring is required to be carried out once a week for monitoring location of Kandla and Vadinar i.e., two STP station at Kandla and one STP station at Vadinar.

Table 26: List of parameters monitored for STP's at Kandla and Vadinar

Sr. No.	Parameters	Units	Reference method	Instruments
1.	pH	-	APHA, 23 rd edition, 4500- H ⁺ B, 2017	pH Meter
2.	TDS	mg/L	APHA, 23 rd Edition, 2540 C: 2017	Vacuum Pump with filtration assembly and Oven
3.	TSS	mg/L		
4.	DO	mg/L	APHA, 23 rd Edition, 4500 C: 2017	Titration Apparatus
5.	COD	mg/L	APHA, 23 rd Edition, 5220 B: 2017	Titration Apparatus plus Digester
6.	BOD	mg/L	IS-3025, Part 44, 1993	BOD Incubator plus Titration Apparatus
7.	SAR	meq/L	IS 11624: 2019	Flame Photometer
8.	Total Coliforms	MPN/100ml	IS 1622: 2019	LAF/ Incubator

9.2 Result and Discussion

Analytical results of the STP samples collected from the inlet and the outlet of the STP's of Kandla and Vadinar have been summarized in **Table 27 & 28**. Further it was compared with the standard norms specified in the CC&A of the respective STPs.



Table 27: Water Quality of inlet and outlet of STP of Kandla

Sr No.	Parameter	Units	GPCB Norms (Kandla)	Kandla															
				Week 3 of June				Week 4 of June				Week 1 of July				Week 2 of July			
				STP-1 (Inlet)	STP-1 (Outlet)	STP-2 (Inlet)	STP-2 (Outlet)	STP-1 (Inlet)	STP-1 (Outlet)	STP-2 (Inlet)	STP-2 (Outlet)	STP-1 (Inlet)	STP-1 (Outlet)	STP-2 (Inlet)	STP-2 (Outlet)	STP-1 (Inlet)	STP-1 (Outlet)	STP-2 (Inlet)	STP-2 (Outlet)
1.	pH	-	6.5-8.5	7.02	7.22	7.08	7.36	7.18	7.41	7.12	7.29	7.22	7.56	7.08	7.21	7.12	7.48	6.94	7.48
2.	TDS	mg/L	-	1896	1438	708	682	3948	3583	977	745	1869	1624	766	498	6643	3814	962	894
3.	TSS	mg/L	100	126	8	88	10	88	12	126	18	72	14	108	10	78	6	62	8
4.	COD	mg/L	-	249	92.4	257	52.2	229	66.47	236	42.7	173.7	66.21	385.7	54.7	233	71.2	184	52
5.	DO	mg/L	-	BQL	5	BQL	3	BQL	4.8	BQL	4.2	BQL	3.9	BQL	5.4	BQL	2.3	BQL	4
6.	BOD	mg/L	30	77.81	11.55	80.32	6.53	71.19	14.16	87.19	9.26	68.34	8.27	118.54	7.59	79.46	6.89	57.5	6.5
7.	SAR	meq/L	-	10.69	8.54	4	3.58	18.47	13.91	7.41	5.34	8.79	8.13	4.92	2.78	16.72	5.63	4.75	5.14
8.	Total Coliforms	MPN/100ml	<1000	1600	1600	1600	1600	1600	1600	1600	1600	1600	1600	1600	1600	1600	1600	1600	1600

Table 28: Water Quality of inlet and outlet of STP of Vadinar

Sr No.	Parameter	Units	GPCB Norms (Vadinar)	Week 3 of June		Week 4 of June		Week 1 of July		Week 2 of July	
				STP-3 (Inlet)	STP-3 (Outlet)	STP-3 (Inlet)	STP-3 (Outlet)	STP-3 (Inlet)	STP-3 (Outlet)	STP-3 (Inlet)	STP-3 (Outlet)
1.	pH	-	5.5-9	7.21	7.07	7.22	7.04	7.24	7.05	7.2	7.48
2.	TDS	mg/L	-	584	578	532	442	436	378	452	366
3.	TSS	mg/L	20	8	4	8	2	12	6	18	4
4.	COD	mg/L	50	116.9	36.3	149.2	52.4	132	52	148.6	36.1
5.	DO	mg/L	-	BQL	4.5	BQL	5.6	BQL	7	0.9	7.8
6.	BOD	mg/L	10	36.53	4.54	46.63	6.55	39.6	7.8	46.44	6.77
7.	SAR	meq/L	-	3.08	2.59	3.51	2.96	2.32	2.2	2.4	1.99
8.	Total Coliforms	MPN/100ml	100-230	1600	1600	1600	1600	1600	1600	1600	1600

BQL: Below Quantification limit; Total Suspended Solids (QL=2), Dissolved Oxygen (QL=0.5), Biochemical Oxygen Demand (QL=3 mg/L)

9.3 Data Interpretation and Conclusion

For physicochemical analysis, the treated sewage water was gathered from the Kandla STP, Gopalpuri STP, and Vadinar STP and the analytical results were compared with the standards mentioned in the Consolidated Consent and Authorization (CC&A) by GPCB.

- The **pH** of treated effluent from STPs at Kandla (STP-1 and STP-2) and Vadinar (STP-3) conform to their respective stipulated norms of 7.21-7.56 at Kandla and 7.04-7.48 at Vadinar respectively.
- The **TDS** of treated sewage at Kandla was ranges from 498 to 3814 mg/L, whereas for Vadinar it ranges from 366 to 578 mg/L.
- The **TSS** of the Treated effluent for the STP-1 and STP-2 at Kandla and STP-3 at Vadinar falls within the stipulated norms of 100 and 20 mg/L respectively as mentioned in their respective CCA.
- **COD** value for Kandla was observed in the range of 42.7 to 92.4 mg/L. Whereas for Vadinar the value of COD falls within the range of 36.1 - 52.4 mg/L, and conforms the CCA norms of 50 mg/L, except the 4th & 1st week sample of June & July.
- The value of **DO** was observed in the range of 2.3 to 5.4 mg/L, whereas for Vadinar it was observed in the range of 4.5 to 7.8 mg/L.
- The **BOD** of the outlet for the STPs of Kandla and Vadinar falls within the stipulated norms.
- The value of **SAR** for Kandla was observed in the range of 2.78 to 13.91 meq/L, whereas for Vadinar, it was observed in the range of 1.99 to 2.96 meq/L.
- The **Total Coliforms** was observed to exceed the norms at the locations of the STP-1 & STP-2 for the treated effluent at Kandla and STP-3 at Vadinar.

During the monitoring period, only Total Coliforms were observed to be exceeding the limits at STPs of Kandla and Vadinar while rest of the treated sewage parameters for STP outlet were within norms as specified under the CCA at both the monitoring sites. Regular monitoring of the STP performance should be conducted on regular basis to ensure adequate treatment as per the norms.

9.4 Remedial Measures:

- The quantum of raw sewage (influent) entering the STP should be monitored by installation of the flow meter. If the quantity of the sewage exceeds the treatment capacity of the treatment plant, then provision of additional capacity of collection sump should be provided.
- The adequacy and efficacy of the stages of Sewage treatment units shall be conducted.
- The results show the presence of total coliforms; hence the method of disinfection (Chlorination) sodium or calcium Hypochlorite can be used.
- Effectiveness of any technology depends on factors such as the specific pollutants in the wastewater, plant size, local regulations, and available resources. There are several processes that may be implemented such as - Advanced oxidation process involve using strong oxidants to break down complex organic compounds. Methods like Fenton's

reagent (hydrogen peroxide and iron catalyst) and UV/H₂O₂ treatment can help in reducing COD through oxidation.

- Electrochemical processes like Electrocoagulation (EC) and Electrooxidation (EO) that involve the application of an electric current to facilitate the removal of pollutants through coagulation, flocculation, and oxidation. These methods can be useful for treating sewage containing various pollutants.



CHAPTER 10: MARINE WATER QUALITY MONITORING

10.1 Marine Water

Deendayal Port is one of the largest ports of the country and thus, is engaged in wide variety of activities such as movement of large vessels, oil tankers and its allied small and medium vessels and handling of dry cargo several such activities whose waste if spills in water, can cause harmful effects to marine water quality.

Major water quality concerns at ports include wastewater and leakage of toxic substances from ships, stormwater runoff, etc. This discharge of wastewater, combined with other ship wastes which includes sewage and wastewater from other on-board uses, is a serious threat to the water quality as well as to the marine life. As defined in the scope by DPA, the Marine Water sampling and analysis has to be carried out at a total of eight locations, six at Kandla and two at Vadinar. The marine water sampling has been carried out with the help of Niskin Sampler with a capacity of 5L. The Niskin Sampler is a device used to take water samples at a desired depth without the danger of mixing with water from other depths. Details of the locations to be monitored have been mentioned in **Table 29**:

Table 29: Details of the sampling locations for Marine water

Sr. No.	Location Code	Location Name	Latitude Longitude
1.	MW-1	Near Passenger Jetty One	23.017729N 70.224306E
2.	MW-2	Kandla Creek (nr KPT Colony)	23.001313N 70.226263E
3.	MW-3	Near Coal Berth	22.987752N70.227923E
4.	MW-4	Khori Creek	22.977544N 70.207831E
5.	MW-5	Nakti Creek (nr Tuna Port)	22.962588N 70.116863E
6.	MW-6	Nakti Creek (nr NH-8A)	23.033113N 70.158528E
7.	MW-7	Near SPM	22.500391N 69.688089E
8.	MW-8	Near Vadinar Jetty	22.440538N 69.667941E

The map depicting the locations of Marine Water to be sampled and analysed for Kandla and Vadinar have been mentioned in **Map 16 and 17** as follows:



Map 16: Locations for Marine Water Monitoring at Kandla



Map 17: Locations for Marine Water Monitoring at Vadinar

Methodology

The methodology adopted for the sampling and monitoring of Marine Water was carried out as per the ‘**Sampling Protocol for Water & Wastewater**’ developed by GEMI. The water samples collected through the Niskin Sampler are collected in a clean bucket to reduce the heterogeneity. The list of parameters to be monitored under the project for the Marine Water quality have been mentioned in **Table 30** along with the analysis method and instrument.

Frequency:

As defined in the scope by DPA, the sampling and analysis of Marine Water has to be carried out once in a month at the eight locations (i.e., six at Kandla and two at Vadinar).

Table 30: List of parameters monitored for Marine Water

Sr. No	Parameters	Units	Reference method	Instrument
1.	Electrical Conductivity	μS/cm	APHA, 23 rd Edition (Section-2510 B):2017	Conductivity Meter
2.	Dissolved Oxygen (DO)	mg/L	APHA, 23 rd Edition, 4500 O C, 2017	Titration Apparatus
3.	pH	-	APHA, 23 rd Edition (Section-4500-H+B):2017	pH meter
4.	Color	Hazen	APHA, 23 rd Edition, 2120 B: 2017	Color comparator
5.	Odour	-	IS 3025 Part 5: 2018	Heating mantle & odour bottle
6.	Turbidity	NTU	IS 3025 Part 10: 1984	Nephlo Turbidity Meter
7.	Total Dissolved Solids (TDS)	mg/L	APHA, 23 rd Edition (Section-2540 C):2017	Vaccum Pump with Filtration Assembly and Oven
8.	Total Suspended Solids (TSS)	mg/L	APHA, 23 rd Edition, 2540 D: 2017	
9.	Particulate Organic Carbon	mg/L	APHA, 23 rd Edition, 2540 D and E	TOC analyser
10.	Chemical Oxygen Demand (COD)	mg/L	IS-3025, Part- 58: 2006	Titration Apparatus plus Digester
11.	Biochemical Oxygen Demand (BOD)	mg/L	IS-3025, Part 44,1993,	BOD Incubator plus Titration apparatus
12.	Silica	mg/L	APHA, 23 rd Edition, 4500 C, 2017	UV- Visible Spectrophotometer
13.	Phosphate	mg/L	APHA, 23 rd Edition, 4500 P-D: 2017	
14.	Sulphate	mg/L	APHA, 23 rd Edition, 4500 SO4-2 E: 2017	
15.	Nitrate	mg/L	APHA, 23 rd Edition, 4500 NO3-B: 2017	

Sr. No	Parameters	Units	Reference method	Instrument
16.	Nitrite	mg/L	APHA, 23 rd Edition, 4500 NO2- B: 2017	
17.	Sodium	mg/L	APHA, 23 rd Edition, 3500 Na-B: 2017	Flame photometer
18.	Potassium	mg/L	APHA, 23 rd Edition, 3500 K-B: 2017	
19.	Manganese	µg/L	APHA, 23 rd Edition, ICP Method 3120 B: 2017	ICP-OES
20.	Iron	mg/L	APHA, 23 rd Edition, ICP Method 3120 B: 2017	
21.	Total Chromium	µg/L	APHA, 23 rd Edition, 3500 Cr B: 2017	
22.	Hexavalent Chromium	µg/L		UV- Visible Spectrophotometer
23.	Copper	µg/L	APHA, 23 rd Edition, ICP Method 3120 B: 2017	ICP-OES
24.	Cadmium	µg/L		
25.	Arsenic	µg/L		
26.	Lead	µg/L		
27.	Zinc	mg/L		
28.	Mercury	µg/L	EPA 200.7	
29.	Floating Material (Oil grease scum, petroleum products)	mg/L	APHA, 23 rd Edition, 5520 C: 2017	Soxhlet Assembly
30.	Total Coliforms (MPN)	MPN/100ml	IS 1622: 2019	LAF/ Incubator

10.2 Result and Discussion

The quality of the Marine water samples collected from the locations of Kandla and Vadinar during the monitoring period has been summarized in the **Table 31**. The said water quality has been represented in comparison with the standard values as stipulated by CPCB for Class SW-IV Waters.

Table 31: Results of Analysis of Marine Water Sample for the sampling period

Sr. No	Parameters	Unit	Primary Water Quality Criteria for Class SW-IV Waters	Kandla						Vadinar	
				MW-1	MW-2	MW-3	MW-4	MW-5	MW-6	MW-7	MW-8
1.	Density	kg/m ³	-	1.018	1.024	1.022	1.019	1.02	1.023	1.02	1.023
2.	pH	-	6.5-9.0	7.79	7.89	7.85	7.80	7.79	7.82	7.83	7.88
3.	Color	Hazen	No Noticeable	5	5	5	5	5	5	5	1
4.	EC	µS/cm	-	62,600	57,800	59,400	60,500	61,500	58,900	53,300	55,100
5.	Turbidity	NTU	-	>500	150	>500	323	>500	424	11.7	18.2
6.	TDS	mg/L	-	42,638	39,356	41,264	41,884	42,728	43,544	36,178	37,296
7.	TSS	mg/L	-	744	152	568	348	608	348	12	14
8.	COD	mg/L	-	68.1	58.7	89.4	60.4	88.5	80.9	57.9	46.8
9.	DO	mg/L	3.0 mg/L	5.7	6.2	5.5	5.6	5.6	5.8	6.5	7.8
10.	BOD	mg/L	5.0 mg/L	4.26	3.67	5.59	3.78	5.53	5.05	3.62	5.85
11.	Oil & Grease	mg/L	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
12.	Sulphate	mg/L	-	3444.7	3473.1	3160.3	3452.6	3344	3045.9	3041.8	2772.6
13.	Nitrate	mg/L	-	4.144	3.599	4.578	3.678	5.200	3.834	2.963	2.371
14.	Nitrite	mg/L	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
15.	Phosphate	mg/L	-	0.901	BQL	BQL	BQL	BQL	BQL	BQL	BQL
16.	Silica	mg/L	-	4.23	3.67	3.15	3.75	4.74	3.94	1.80	1.60
17.	Sodium	mg/L	-	>10,000	>10,000	>10,000	>10,000	>10,000	>10,000	>10,000	>10,000
18.	Potassium	mg/L	-	444	336	454	428	419	441	382	384
19.	Hexavalent Chromium	mg/L	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
20.	Odour	-	-	1	1	1	1	1	1	1	1
21.	Arsenic	mg/L	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
22.	Cadmium	mg/L	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
23.	Copper	mg/L	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
24.	Iron	mg/L	-	4.477	0.970	3.887	2.861	4.058	2.876	BQL	0.225
25.	Lead	mg/L	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
26.	Manganese	mg/L	-	0.17	BQL	0.14	0.094	0.16	0.10	BQL	BQL
27.	Total Chromium	mg/L	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
28.	Zinc	mg/L	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
29.	Mercury	mg/L	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
30.	Particulate Organic Carbon	mg/L	-	4.82	1.27	3.92	2.86	3.26	4.28	0.08	BQL
31.	Total Coliforms	MPN/100ml	500/100 ml	8	2	2	1600	13	4	BQL	9

Sr. No	Parameters	Unit	Primary Water Quality Criteria for Class SW-IV Waters	Kandla						Vadinar	
				MW-1	MW-2	MW-3	MW-4	MW-5	MW-6	MW-7	MW-8
32.	Floating Material (Oil grease scum, petroleum products)	mg/L	10 mg/L	1.018	1.024	1.022	1.019	1.02	1.023	1.02	1.023

10.3 Data Interpretation and Conclusion

The Marine water quality of Deendayal Port Harbor waters at Kandla and Vadinar has been monitored for various physico-chemical and biological parameters during the monitoring period. The detailed interpretation of the parameters in comparison to the Class SW-IV for Harbour Waters is as follows:

- **Density** at Kandla was observed in the range of **1.018 to 1.024 kg/m³**, with the average of **1.021 kg/m³**. Whereas for the location of Vadinar, it was observed **1.02 kg/m³** at MW-7 and **1.023 kg/m³** at MW-8, with the average of **1.021 kg/m³**.
- **pH** at Kandla was observed in the range of **7.79 to 7.89**, with the average pH as **7.89**. Whereas for the locations of Vadinar, it was observed in the range of **7.83 to 7.88**, with the average pH as **7.85**. For the monitoring location of both the study areas, pH was found to comply with the norms of **6.5-8.5**.
- **Color** range varied from **5 Hazen** at all the monitoring locations in Kandla, and for Vadinar, it found **5 Hazen** at MW-7 and **1 Hazen** at MW-8 location.
- **Electrical conductivity (EC)** was observed in the range of **57,800 to 62,600 µS/cm**, with the average EC as **60116.7 µS/cm** for the locations of Kandla, whereas for the locations of Vadinar, it was observed in the range of **53,300 to 55,100 µS/cm**, with the average EC as **54,200µS/cm**.
- For all monitoring locations of Kandla the value of **Turbidity** was observed in the range of **150 to 424 NTU**, with average value of **299 NTU**, and location MW-1, MW-3 & MW-5 exceeds the quantification limit of **500 NTU**. For Vadinar it ranges from **11.7 to 18.2 NTU**, with average of **14.95 NTU**. Materials that cause water to be turbid include clay, silt, finely divided organic and inorganic matter, soluble coloured organic compounds, plankton and microscopic organisms. Turbidity affects the amount of light penetrating to the plants for photosynthesis.
- For the monitoring locations at Kandla the value of **Total Dissolved Solids (TDS)** ranged from **39,356 to 43,544 mg/L**, with an average value of **41,902.3 mg/L**. Similarly, at Vadinar, the TDS values ranged from **36,178 to 37,296 mg/L**, with an average value of **36,737 mg/L**.

- TSS values in the studied area varied between **152 to 744 mg/L** at Kandla and **12 to 14 mg/L** at Vadinar, with the average value of 461.33 mg/L and 13 mg/L respectively for Kandla and Vadinar.
- COD varied between **58.7 to 89.4 mg/L** at Kandla and **46.8 to 57.9 mg/L** at Vadinar, with the average value as 74.33 mg/L and 52.35 mg/L respectively for Kandla and Vadinar.
- DO level in the studied area varied between **5.5 to 6.2 mg/L** at Kandla and **6.5 to 7.8 mg/L** at Vadinar, with the average value of 5.73 mg/L and 7.15 mg/L respectively for Kandla and Vadinar. Which represents that the marine water is suitable for marine life.
- BOD observed was observed in the range of **3.67 to 5.59 mg/L**, with average of 4.64 mg/L for the location of Kandla and for the locations of Vadinar, it was observed in the range of **3.62 to 5.85 mg/L**, with an average value of 4.73 mg/L.
- Sulphate concentration in the studied area varied between **3045.9 to 3473.1 mg/L** at Kandla and **2772.6 to 3041.8 mg/L** at Vadinar. The average value observed at Kandla was 3320.1 mg/L, whereas 2907.2 mg/L was the average value of Vadinar. Sulphate is naturally formed in inland waters by mineral weathering or the decomposition and combustion of organic matter.
- Nitrate in the study area was observed in the range of **3.59 to 5.2 mg/L**, with the average of 4.17 mg/L. Whereas for the Vadinar, recorded value was observed as 2.96 mg/L at MW-7 and 2.37 mg/L at MS-8.
- In the study area of Kandla the concentration of Potassium varied between **336 to 454 mg/L** and **382 to 384 mg/L** at Vadinar, with the average value as 420.33 mg/L and 383 mg/L respectively for Kandla and Vadinar.
- Silica in the studied area varied between **3.15 to 4.74 mg/L**, with the average of 3.91 mg/L, at Kandla. Vadinar, observed value was found to be 1.80 mg/L at MW-7 and 1.60 mg/L at MS-8 locations.
- Sodium in the study area at both Kandla & Vadinar the sodium concentration value recorded Above the quantification limit.
- Odour was observed 1 for all locations of Kandla and Vadinar.
- Copper at the Kandla site as well as both locations at the Vadinar site, had levels below the quantification limit (BQL)."
- Iron in the studied area varied between **0.97 to 4.47 mg/L**, with the average of 3.18 mg/L, at Kandla, and for Vadinar value were recorded BQL for location MW-7 and 0.225 mg/L for location MW-8.
- Lead concentration was observed BQL at both site of Kandla & Vadinar.
- Manganese in the studied area varied between **0.094 to 0.17 mg/L**, with the average of 0.13 mg/L, at Kandla. At Vadinar both location MW-7 and MW-8 observed BQL.
- Particulate Organic Carbon in the study area was observed in the range of **1.27 to 4.82**, with the average value of 3.40. Whereas for the Vadinar, the value observed was 0.08 at MW-7 and BQL at MW-8.
- Oil & Grease, Nitrite, Phosphate, Hexavalent Chromium, Arsenic, Cadmium, Total Chromium, Zinc, Mercury and Floating Material (Oil grease scum, petroleum

products) were observed to have concentrations “**Below the Quantification Limits (BQL)**” for most of the locations of Kandla and Vadinar.

- **Total Coliforms** were detected complying with the specified norm of 500 MPN/100ml for all the locations of Kandla and Vadinar, except the location MW-4, which is 1600 MPN/100ml.

During the Monitoring period, marine water samples were analysed and found in line with Primary Water Quality criteria for class-IV Waters (For Harbour Waters).

However, as a safeguard towards marine water pollution prevention, appropriate regulations on ship discharges and provision of reception facilities are indispensable for proper control of emissions and effluent from ships. Detection of spills is also important for regulating ship discharges. Since accidental spills are unavoidable, recovery vessels, oil fences, and treatment chemicals should be prepared with a view to minimizing dispersal. Proper contingency plans and a prompt reporting system are keys to prevention of oil dispersal. Periodical clean-up of floating wastes is also necessary for preservation of port water quality.



CHAPTER 11: MARINE SEDIMENT QUALITY MONITORING

11.1 Marine Sediment Monitoring

Marine sediment, or ocean sediment, or seafloor sediment, are deposits of insoluble particles that have accumulated on the seafloor. These particles have their origins in soil and rocks and have been transported from the land to the sea, mainly by rivers but also by dust carried by wind. The unconsolidated materials derived from pre-existing rocks or similar other sources by the process of denudation are deposited in water medium are known as sediment. For a system, like a port, where large varieties of raw materials and finished products are handled, expected sediment contamination is obvious.

The materials or part of materials spilled over the water during loading and unloading operations lead to the deposition in the harbour water along with sediment and thus collected as harbour sediment sample. These materials, serve as receptor of many trace elements, which are prone to environment impact. In this connection it is pertinent to study the concentration and distribution of environmentally sensitive elements in the harbour sediment. However, human activities result in accumulation of toxic substances such as heavy metals in marine sediments. Heavy metals are well-known environmental pollutants due to their toxicity, persistence in the environment, and bioaccumulation. Metals affect the ecosystem because they are not removed from water by self-purification, but accumulate in sediments and enter the food chain.


Methodology

As defined in the scope by DPA, the Marine Sediment sampling is required to be carried out once in a month at total eight locations, i.e., six at Kandla and two at Vadinar. The sampling of the Marine Sediment is carried out using the Van Veen Grab Sampler (make Holy Scientific Instruments Pvt. Ltd). The Van Veen Grab sampler is an instrument to sample (disturbed) sediment up to a depth of 20-30 cm into the sea bed. While letting the instrument down on the seafloor, sediment can be extracted. The details of locations of Marine Sediment to be monitored under the study are mentioned in **Table 32** as follows:

Table 32: Details of the sampling locations for Marine Sediment

Sr. No	Location Code	Location Name	Latitude Longitude	
1.	Kandla	MS-1	Near Passenger Jetty One	23.017729N 70.224306E
2.		MS-2	Kandla Creek	23.001313N 70.226263E
3.		MS-3	Near Coal Berth	22.987752N 70.227923E
4.		MS-4	Khori Creek	22.977544N 70.207831E
5.		MS-5	Nakti Creek (near Tuna Port)	22.962588N 70.116863E
6.		MS-6	Nakti Creek (near NH-8A)	23.033113N 70.158528E
7.	Vadinar	MS-7	Near SPM	22.500391N 69.688089E
8.		MS-8	Near Vadinar Jetty	22.440538N 69.667941E

The map depicting the locations of Marine Sediment sampling at Kandla and Vadinar have been mentioned in **Map 18 and 19** as follows:

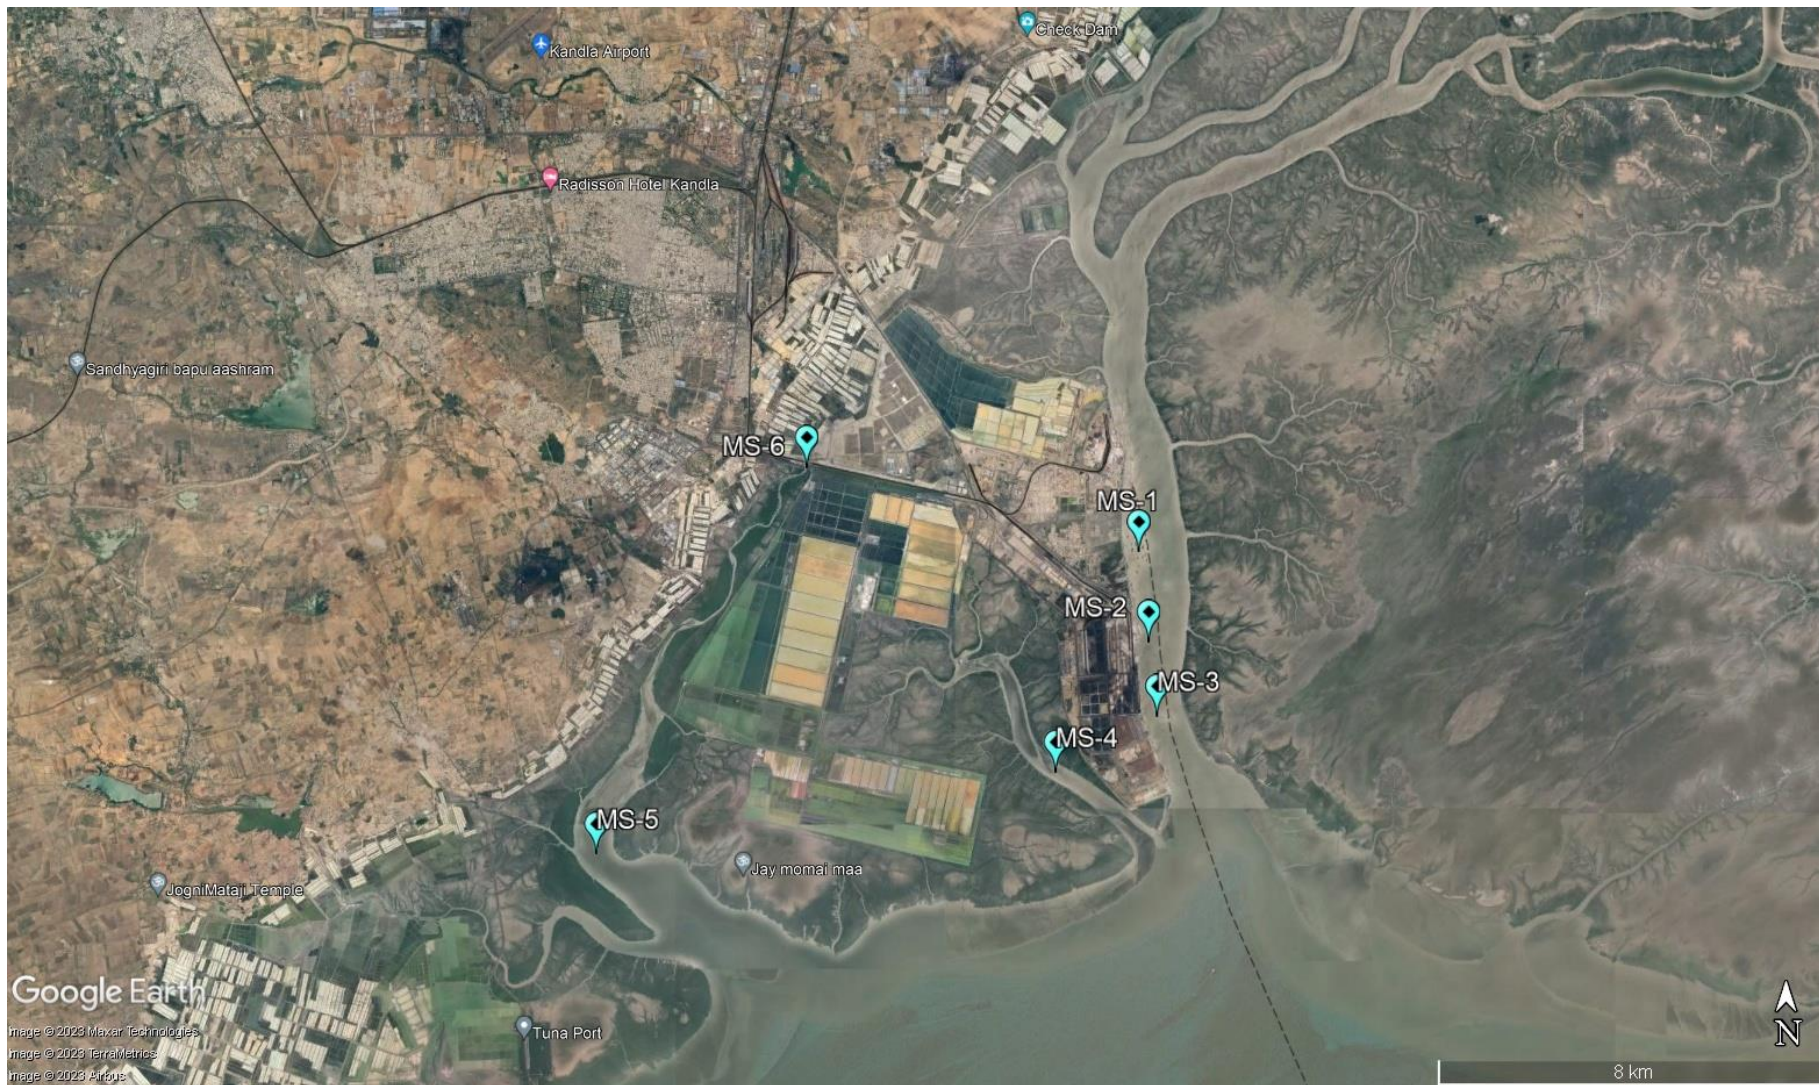

Map 18: Location of Marine Sediment Monitoring at Kandla



Map 19: Locations of Marine Sediment Monitoring at Vadinar

The list of parameters to be monitored under the projects for the Marine Sediment sampling been mentioned in **Table 33** as follows:

Table 33: List of parameters to be monitored for Sediments at Kandla and Vadinar

Sr. No.	Parameters	Units	Reference method	Instruments	
1.	Texture		Methods Manual Soil Testing in India January 2011,01	Hydrometer	
2.	Organic Matter	%	Methods Manual Soil Testing in India January, 2011, 09. Volumetric method (Walkley and Black, 1934)	Titration apparatus	
3.	Inorganic Phosphates	mg/Kg	Practical Manual Chemical Analysis of Soil and Plant Samples, ICAR-Indian Institute of Pulses Research 2017	UV- Visible Spectrophotometer	
4.	Silica	mg/Kg	EPA METHOD 6010 C & IS: 3025 (Part 35) - 1888, part B		
5.	Phosphate	mg/Kg	EPA Method 365.1		
6.	Sulphate as SO ⁴	mg/Kg	IS: 2720 (Part 27) - 1977		
7.	Nitrite	mg/Kg	ISO 14256:2005		
8.	Nitrate	mg/Kg	Methods Manual Soil Testing in India January, 2011, 12		
9.	Calcium as Ca	mg/Kg	Methods Manual Soil Testing in India January 2011, 16.		Titration Apparatus
10.	Magnesium as Mg	mg/Kg	Method Manual Soil Testing in India January 2011		
11.	Sodium	mg/Kg	EPA Method 3051A	Flame Photometer	
12.	Potassium	mg/Kg	Methods Manual Soil Testing in India January, 2011		
13.	Aluminium	mg/Kg	EPA Method 3051A	ICP-OES	
14.	Chromium	mg/Kg			
15.	Nickel	mg/Kg			
16.	Zinc	mg/Kg			
17.	Cadmium	mg/Kg			
18.	Lead	mg/Kg			
19.	Arsenic	mg/Kg			
20.	Mercury	mg/Kg			

11.2 Result and Discussion

The quality of Marine Sediment samples collected from the locations of Kandla and Vadinar during the monitoring period has been summarized in the **Table 34**.

Table 34: Summarized result of Marine Sediment Quality

Sr No.	Parameters	Unit	Kandla						Vadinar	
			MS-1	MS-2	MS-3	MS-4	MS-5	MS-6	MS-7	MS-8
1.	Inorganic Phosphate	kg/ ha	2.12	2.41	3.64	2.88	3.42	1.71	1.85	1.06
2.	Phosphate	mg/Kg	288.72	329.62	467.84	363.18	319.45	213.507	217.339	339.31
3.	Organic Matter	%	1.12	1.36	1.02	1.28	0.94	1.43	1.13	1.52
4.	Sulphate as SO ⁴⁻	mg/Kg	170.55	146.88	133.90	122.57	189.41	169.42	145.05	126.34
5.	Calcium as Ca	mg/Kg	3680.00	3850.00	4600.00	4100.00	3740.00	3500.00	3400.00	3800.00
6.	Magnesium as Mg	mg/Kg	1928.00	2473.00	2541.00	2849.00	2473.00	1342.00	976.00	1865.00
7.	Silica	g/Kg	519.37	521.29	534.91	546.62	554.35	523.5	507.02	534.29
8.	Nitrite	mg/Kg	0.68	0.79	0.61	0.72	0.77	0.29	0.22	0.31
9.	Nitrate	mg/Kg	6.83	7.42	6.21	5.88	6.12	15.28	11.6	5.79
10.	Sodium	mg/Kg	8190	10687	7526	13760	9149	11972	9548	12586
11.	Potassium	mg/Kg	2671	2149	2375	3460	2549	6376	4447	1172
12.	Aluminium	mg/Kg	7234.11	6841.64	8423.36	9864.22	7246.18	12327.688	10215.74	12643.2
13.	Chromium	mg/Kg	49.21	53.46	52.15	56.51	48.72	50.009	48.941	86.61
14.	Copper	mg/Kg	5.52	5.63	5.75	6.29	5.31	48.227	30.463	4.25
15.	Nickel	mg/Kg	24.87	21.79	25.48	27.62	26.73	29.24	22.776	24.37
16.	Zinc	mg/Kg	58.75	52.4	61.85	82.41	55.12	62.49	41.691	40.85
17.	Cadmium	mg/Kg	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
18.	Lead	mg/Kg	6.08	6.41	6.19	6.77	6.28	6.54	2.97	4.494
19.	Arsenic	mg/Kg	4.61	4.82	4.58	4.72	4.42	4.61	1.485	2.497
20.	Mercury	mg/Kg	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
21.	Texture	-	Sandy loam	Sandy loam	Silt loam	Sandy loam	Silt loam	Silt loam	Sandy loam	Loam

11.3 Data Interpretation and Conclusion

The Marine sediment quality at Kandla and Vadinar has been monitored for various physico-chemical parameters during the monitoring June-July. The detailed interpretation of the parameters is given below:

- **Inorganic Phosphate** for the sampling period was observed in range of **2.12 to 3.64** Kg/ha for Kandla. Whereas for Vadinar the value observed at location MS-7 (Nakti creek) is 1.71 Kg/ha and MS-8 (Near Vadinar Jetty) is 1.85 Kg/ha. For Kandla and Vadinar the average value of Inorganic Phosphate was observed 2.81 and 1.78 Kg/ha respectively.

- The concentration of **Phosphate** was observed in range of **288.72 to 467.84 mg/Kg** for Kandla and for Vadinar the value observed at location MS-7 (Nakti creek) as 213.507 mg/Kg and MS-8 (Near Vadinar Jetty) as 217.339 mg/Kg. For Kandla and Vadinar the average concentration of Phosphate was observed 367.238 and 215.423 mg/Kg respectively.
- The **Organic Matter** for the sampling period was observed in the range of **0.94 to 1.36 %** for Kandla with the average value of 1.16% and for Vadinar the value recorded at location MS-7 and MS-8 was observed 1.43% & 1.13% respectively, with average concentration as 1.28 %.
- The concentration of **Sulphate** was observed in the range of **122.57 to 212.27 mg/Kg** for Kandla and for Vadinar the value observed at MS-7 is 169.42 mg/Kg and at MS-8 is 145.05 mg/Kg. For Kandla and Vadinar the average value of Sulphate was observed 162.596 and 157.235 mg/Kg respectively.
- The value of **Calcium** was observed in the range of **3680 to 4900 mg/Kg** for Kandla and for Vadinar the value observed at MS-7 is 3500.00 mg/Kg and at MS-8, is 3400.00 mg/Kg. The average value of Calcium for the monitoring period was observed 4145 mg/Kg and 3450 mg/Kg at Kandla and Vadinar, respectively.
- The value of **Magnesium** for the sampling period was observed in the range of **1928 to 2849 mg/Kg** for Kandla and for Vadinar the value observed at MS-7 is 1342.00 mg/Kg and at MS-8, is 976.00 mg/Kg. For Kandla and Vadinar the average value of Magnesium was observed 2427 mg/Kg and 1159 mg/Kg respectively.
- For the sampling period **Silica** was observed in the range of **519.27 to 559.73 mg/Kg** for Kandla with average value 539.37 mg/Kg and for Vadinar the value observed to be 523.5 and 507.02 mg/Kg at MS-7 and MS-8, respectively with average 515.26 mg/Kg.
- The value of **Nitrate** was observed in the range of **5.88 to 8.19 mg/Kg** for Kandla with average value 6.77 mg/Kg and for Vadinar the value observed to be 15.28 and 11.6 mg/Kg at MS-7 and MS-8, respectively with average 13.44 mg/Kg.
- The value of **Nitrite** was observed in the range of **0.61 to 0.83 mg/Kg** for Kandla with average value 0.73 mg/Kg and for Vadinar the value observed to be 0.29 and 0.22 mg/Kg at MS-7 and MS-8, respectively with average 0.25 mg/Kg.
- The value of **Sodium** was observed in the range of **7526 to 13760 mg/Kg** for Kandla with average value 10327.66 mg/Kg and for Vadinar the value observed to be 11972 and 9548 mg/Kg at MS-7 and MS-8, respectively with average 10760 mg/Kg.
- The value of **Potassium** was observed in the range of **2149 to 3671 mg/Kg** for Kandla with average value 2812.5 mg/Kg and for Vadinar the value observed to be 6376 and 4447 mg/Kg at MS-7 and MS-8, respectively with average 5411.5 mg/Kg.
- The value of **Aluminium**, was observed in the range of **6841.64 to 10157.25 mg/Kg** for Kandla with average value 8294.46 mg/Kg and for Vadinar the value observed to be 12327.68 and 10215.74 mg/Kg at MS-7 and MS-8, respectively with average 11271.7 mg/Kg.

- The value of **Mercury** was observed “Below the Quantification Limit” at all the eight-monitoring location of Kandla and Vadinar.
- Texture was observed to be “**Sandy Loam**” at location MS-1, MS-2, and MS-4 “**Silt loam**” at location MS-3, MS-5 & MS-6 in Kandla. “**Sandy Loam**” at location MS-7 & “**loam**” at location MS-8 in Vadinar during sampling period.

Heavy Metals

The sediment quality of Kandla and Vadinar has been compared with respect to the Average Standard guideline applicable for heavy metals in marine sediment specified by EPA have been mentioned in **Table 35**.

Table 35: Standard Guidelines applicable for heavy metals in sediments

Sr. No.	Metals	Sediment quality (mg/kg)			Source
		Not polluted	Moderately polluted	Heavily polluted	
1.	As	<3	3-8	>8	EPA
2.	Cu	<25	25-50	>50	
3.	Cr	<25	25-75	>75	
4.	Ni	<20	20-50	>50	
5.	Pb	<40	40-60	>60	
6.	Zn	<90	90-200	>200	
7.	Cd	-	<6	>6	

ND = Not Detected

(Source: G Perin et al. 1997)

Table 36: Comparison of Heavy metals with Standard value in Marine Sediment

Sr. No.	Parameters	Unit	Kandla						Vadinar	
			MS-1	MS-2	MS-3	MS-4	MS-5	MS-6	MS-7	MS-8
1.	Arsenic	mg/Kg	4.61	4.82	4.58	4.72	4.42	4.61	1.485	2.497
2.	Copper	mg/Kg	5.52	5.63	5.75	6.29	5.31	48.227	30.463	4.25
3.	Chromium	mg/Kg	49.21	53.46	52.15	56.51	48.72	50.009	48.941	86.61
4.	Nickel	mg/Kg	24.87	21.79	25.48	27.62	26.73	29.24	22.776	24.37
5.	Lead	mg/Kg	6.08	6.41	6.19	6.77	6.28	6.54	2.97	4.494
6.	Zinc	mg/Kg	58.75	52.4	61.85	82.41	55.12	62.49	41.691	40.85
7.	Cadmium	mg/Kg	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL

- **Arsenic** was observed in the range of **4.42 to 4.82 mg/Kg** for Kandla with average value 4.62 mg/Kg and for Vadinar the value observed to be 1.48 and 2.49 mg/Kg at MS-7 and MS-8, respectively with average 1.99 mg/Kg. With reference to the guidelines mentioned in table 35, the sediment quality with respect to arsenic falls in moderately polluted class.
- **Copper** was observed in the range of **5.31 to 6.54 mg/Kg** for Kandla with average value 5.84 mg/Kg and for Vadinar the value observed to be 48.22 and 30.46 mg/Kg at MS-7 and MS-8, respectively with average 39.74 mg/Kg. With reference to the guidelines mentioned in table 35, the sediment quality with respect to copper falls in non-polluted class.

- **Chromium** was observed in the range of **48.72 to 59.81 mg/Kg** for Kandla with average value 53.31 mg/Kg and for Vadinar the value observed to be 50 and 48.94 mg/Kg at MS-7 and MS-8, respectively with average 49.47 mg/Kg. With reference to the guidelines mentioned in table 35, the sediment quality with respect to chromium falls in moderately polluted class.
- **Nickel** was observed in the range of **21.79 to 29.24 mg/Kg** for Kandla with average value 25.95 mg/Kg and for Vadinar the value observed to be 22.77 and 24.37 mg/Kg at MS-7 and MS-8, respectively with average 38.1mg/Kg. With reference to the guidelines mentioned in table 35, the sediment quality with respect to nickel falls in moderately polluted class.
- **Lead** was observed in the range of **6.08 to 6.77 mg/Kg** for Kandla with average value 6.37 mg/Kg and for Vadinar the value observed to be 2.97 and 4.49 mg/Kg at MS-7 and MS-8, respectively with average 3.73 mg/Kg. With reference to the guidelines mentioned in table 35, the sediment quality with respect to lead falls in moderately polluted class.
- **Zinc** was observed in the range of **52.4 to 82.41 mg/Kg** for Kandla with average value 62.17 mg/Kg and for Vadinar the value observed to be 41.69 and 40.85 mg/Kg at MS-7 and MS-8, respectively with average 56 mg/Kg. With reference to the guidelines mentioned in table 35, the sediment quality with respect to zinc falls in non-polluted class.
- **Cadmium** was observed BQL for all locations at Kandla and Vadinar during sampling period. With reference to the guidelines mentioned in table 35, the sediment quality with respect to cadmium falls in non-polluted class.

Analysis of the sediments indicates moderate pollution. However, it may be noted that, the sediments are highly dynamic being constantly deposited and carried away by water currents. Hence maintaining the quality of sediments is necessary as it plays a significant role in regulating the quality of the marine water and the marine ecology.

The presence of anthropic activity in the coastal areas has an effect upon the marine water and sediment. One of the primary risks associated with contaminated sediments is bioaccumulation in benthic organisms, which is a route of entry into the food chain. Generally adopted sediment remediation approaches include dredging, capping of contaminated areas, and monitored natural recovery (MNR). Dredging can remove contaminated sediments, but it requires large areas of land for sediment disposal. It is expensive and may cause secondary contamination of the water column during re-suspension. MNR relies on ongoing naturally occurring processes to decrease the bioavailability or toxicity of contaminants in sediment. These processes may include physical, biological, and chemical mechanisms that act together to reduce the environmental risks posed by contaminated sediments. MNR require longer monitoring time and can be even more expensive than for dredging and capping. Capping consists of in situ covering of clean or suitable isolating material over contaminated sediments layer



to limit leaching of contaminants, and to minimize their re-suspension and transport. Hence appropriate remedial measures for the polluted sediment sites may be implemented, to reduce the concentration of the heavy metals.

CHAPTER 12: MARINE ECOLOGY MONITORING

12.1 Marine Ecological Monitoring

The monitoring of the biological and ecological parameters is important in order to assess the marine environment. A marine sampling is an estimation of the body of information in the population. The theory of the sampling design is depending upon the underlying frequency distribution of the population of interest. The requirement for useful water sampling is to collect a representative sample of suitable volume from the specified depth and retain it free from contamination during retrieval. Deendayal Port and its surroundings have mangroves, mudflats and creek systems as major ecological entities. As defined in the scope by DPA, the Marine Ecological Monitoring is required to be carried out once a month specifically at eight locations, six at Kandla and two at Vadinar. The sampling of the Benthic Invertebrates has been carried out with the help of D-frame nets, whereas the sampling of zooplankton and phytoplankton has been carried out with the help of Plankton Nets (60 micron and 20 micron). The details of the locations of Marine Ecological Monitoring have been mentioned in **Table 37** as follows:

Table 37: Details of the sampling locations for Marine Ecological

Sr. No.	Location Code	Location Name	Latitude Longitude	
1.	Kandla	ME-1	Near Passenger Jetty One	23.017729N 70.224306E
2.		ME-2	Kandla Creek (near KPT Colony)	23.001313N 70.226263E
3.		ME-3	Near Coal Berth	22.987752N 70.227923E
4.		ME-4	Khori Creek	22.977544N 70.207831E
5.		ME-5	Nakti Creek (near Tuna Port)	22.962588N 70.116863E
6.		ME-6	Nakti Creek (near NH - 8A)	23.033113N 70.158528E
7.	Vadinar	ME-7	Near SPM	22.500391N 69.688089E
8.		ME-8	Near Vadinar Jetty	22.440538N 69.667941E

The map depicting the locations of Marine Ecological monitoring in Kandla and Vadinar have been mentioned in **Map 20 and 21** as follows:



Map 20: Locations of Marine Ecological Monitoring at Kandla



Map 21: Locations of Marine Ecological Monitoring at Vadinar

The various parameters to be monitored under the study for Marine Ecological Monitoring are mentioned in **Table 38** as follows:

Table 38: List of parameters to be monitored for Marine Ecological Monitoring

Sr. No.	Parameters
1.	Productivity (Net and Gross)
2.	Chlorophyll-a
3.	Pheophytin
4.	Biomass
5.	Relative Abundance, species composition and diversity of phytoplankton
6.	Relative Abundance, species composition and diversity of zooplankton
7.	Relative Abundance, species composition and diversity of benthic invertebrates (Meio, Micro and macro benthos)
8.	Particulate Oxidisable Organic Carbon
9.	Secchi Depth

Methodology

- **Processing for chlorophyll estimation:**

Samples for chlorophyll estimation were preserved in ice box on board in darkness to avoid degradation in opaque container covered with aluminium foil. Immediately after reaching the shore after sampling, 1 litre of collected water sample was filtered through GF/F filters (pore size 0.45 µm) by using vacuum filtration assembly. After vacuum filtration the glass micro fiber filter paper was grunted in tissue grinder, macerating of glass fiber filter paper along with the filtrate was done in 90% aqueous Acetone in the glass tissue grinder with glass grinding tube. Glass fiber filter paper will assist breaking the cell during grinding and chlorophyll content was extracted with 10 ml of 90% Acetone, under cold dark conditions along with saturated magnesium carbonate solution in glass screw cap tubes. After an extraction period of 24 hours, the samples were transferred to calibrated centrifuge tubes and adjusted the volume to original volume with 90% aqueous acetone solution to make up the evaporation loss. The extract was clarified by using centrifuge in closed tubes. The clarified extracts were then decanted in clean cuvette and optical density was observed at wavelength 664, 665 nm.

- **Phytoplankton Estimation**

Phytoplankton are free floating unicellular, filamentous and colonial eutrophic organisms that grow in aquatic environments whose movement is more or less dependent upon water currents. These micro flora acts as primary producers as well as the basis of food chain, source of protein, bio-purifier and bio-indicators of the aquatic ecosystems of which diverse array of the life depends. They are considered as an important component of aquatic flora, play a key role in maintaining equilibrium between abiotic and biotic components of aquatic ecosystem. The phytoplankton includes a wide range of photosynthetic and phototrophic organisms. Marine phytoplankton is mostly microscopic and unicellular floating flora, which are the

primary producers that support the pelagic food-chain. The two most prominent groups of phytoplankton are Diatoms (*Bacillariophyceae*) and Dinoflagellates (*Dinophyceae*). Phytoplankton also include numerous and diverse collection of extremely small, motile algae which are termed micro flagellates (naked flagellates) as well as Cyanophytes (Bluegreen algae). Algae are an ecologically important group in most aquatic ecosystems and have been an important component of biological monitoring programs. Algae are ideally suited for water quality assessment because they have rapid reproduction rates and very short life cycles, making them valuable indicators of short-term impacts. Aquatic populations are impacted by anthropogenic stress, resulting in a variety of alterations in the biological integrity of aquatic systems. Algae can serve as an indicator of the degree of deterioration of water quality, and many algal indicators have been used to assess environmental status.

- **Zooplankton Estimation**

Zooplankton includes a taxonomically and morphologically diverse community of heterotrophic organisms that drift in the waters of the world's oceans. Qualitative and quantitative studies on zooplankton community are a prerequisite to delineate the ecological processes active in the marine ecosystem. Zooplankton community plays a pivotal role in the pelagic food web as the primary consumers of phytoplankton and act as the food source for organisms in the higher trophic levels, particularly the economically essential groups such as fish larvae and fishes. They also function in the cycling of elements in the marine ecosystem. The dynamics of the zooplankton community, their reproduction, and growth and survival rate are all significant factors determining the recruitment and abundance of fish stocks as they form an essential food for larval, juvenile and adult fishes. Through grazing in surface waters and following the production of sinking faecal matters and also by the active transportation of dissolved and particulate matter to deeper waters via vertical migration, they help in the transport of organic carbon to deep ocean layers and thus act as key drivers of 'biological pump' in the marine ecosystem. Zooplankton grazing and metabolism also, transform particulate organic matter into dissolved forms, promoting primary producer community, microbial demineralization, and particle export to the ocean's interior. The categorisation of zooplankton into various ecological groups is based on several factors such as duration of planktonic life, size, food preferences and habitat. As they vary significantly in size from microscopic to metazoic forms, the classification of zooplankton based on size has paramount importance in the field of quantitative plankton research.

- **Benthic Organisms Estimation**

Benthic macroinvertebrates are small aquatic animals and the aquatic larval stages of insects. They include dragonfly and stonefly larvae, snails, worms, and beetles. Use of benthic macroinvertebrates has been in vogue as indicator organisms for water quality monitoring since long. Traditional methods of water quality monitoring incorporates mostly monitoring of physicochemical parameters. Benthic macroinvertebrates are majorly insects that dwell on the floor of water bodies. They are found in all water bodies, as they have a wide range of pollution tolerance among various species. The benthic

macro-invertebrate's community structure depends on the exposure to pollution it receives. Benthic macroinvertebrates have been used as indicator organisms to measure the water quality of water bodies across the world. Evaluating the abundance and variety of benthic macroinvertebrates in a waterbody gives us an indication of the biological condition of that waterbody. Generally, waterbodies in healthy biological condition support a wide variety and high number of macroinvertebrate taxa, including many that are intolerant of pollution. Samples yielding only pollution-tolerant species or very little diversity or abundance may indicate a less healthy waterbody. Biological condition is the most comprehensive indicator of waterbody health. When the biology of a waterbody is healthy, the chemical and physical components of the waterbody are also typically in good condition.

- **Diversity Index**

A diversity index is a measure of species diversity within a community that consists of co-occurring populations of several (two or more) different species. It includes two components: richness and evenness. Richness is the measure of the number of different species within a sample showing that more the types of species in a community, the higher is the diversity or greater is the richness. Evenness is the measure of relative abundance of the different species with in a community.

1. **Shannon-Wiener's index:**

An index of diversity commonly used in plankton community analyses is the Shannon-Wiener's index (H), which emphasizes not only the number of species (richness or variety), but also the apportionment of the numbers of individuals among the species. Shannon-Wiener's index (H) reproduces community parameters to a single number by using an equation are as follow:

$$H' = \sum p_i * \ln (p_i)$$

Where, \sum = Summation symbol,

p_i = Relative abundance of the species,

\ln = Natural logarithm

More diverse ecosystems are considered healthier and more resilient. Higher diversity ecosystems typically exhibit better stability and greater tolerance to fluctuations. e.g., The Shannon diversity index values between 2.19 and 2.56 indicate relatively high diversity within the community compared to communities with lower values. It suggests that the community likely consists of a variety of species, and the species are distributed somewhat evenly in terms of their abundance.

2. **Simpson's index:**

A reasonably high level of dominance by one or a small number of species is indicated by the range of **0.89 to 0.91**. The general health and stability of the ecosystem may be impacted by this dominance. Community disturbances or modifications that affect the dominant species may be more likely to have an impact. The dominating species

determined by the Simpson's index can have big consequences on how the community is organised and how ecological interactions take place.

The formula for calculating D is presented as:

$$D = 1 - \sum (p_i^2)$$

Where, \sum = Summation symbol, p_i = Relative abundance of the species

3. Margalef's diversity index:

The number of species is significantly related to the port's vegetation cover surface, depth, and photosynthetic zone. The habitat heterogeneity is a result of these three elements. Species richness is related to the number of distinct species present in the analysed area. Margalef's index has a lower correlation with sample size. Small species losses in the community over time are likely to result in inconsistent changes.

Margalef's index D_{Mg} , which is also a measure of species richness and is based on the presumed linear relation between the number of species and the logarithm of the number of individuals. It is given by the formula:

$$D_{Mg} = \frac{S-1}{\ln N}$$

Where, N = total number of individuals collected

S = No. of taxa or species or genera

4. Berger-Parker index:

This is a useful tool for tracking the biodiversity of deteriorated ecosystems. Environmental factors have a considerable impact on this index, which accounts for the dominance of the most abundant species over the total abundance of all species in the assemblage. The preservation of their biodiversity and the identification of the fundamental elements influencing community patterns are thus critical for management and conservation. Successful colonising species will dominate the assemblage, causing the Berger-Parker index to rise, corresponding to well-documented successional processes. The environmental and ecological features of the system after disturbance may therefore simply but significantly determine the identity of the opportunistic and colonising species through niche selection processes.

The Berger-Parker index is a biodiversity metric that focuses on the dominance or relative abundance of a single species within a community. It provides a measure of the most abundant species compared to the total abundance of all species present in the community. Mathematically, it can be represented as follows:

$$d = \frac{N_{max}}{N_i}$$

Where, N_{max} = Max no of individuals of particular genera or species

$\sum N_i$ = Total no of individuals obtained.

The resulting value of the Berger-Parker index ranges between 0 and 1. A higher index value indicates a greater dominance of a single species within the community. Conversely, a lower index value suggests a more even distribution of abundance among different species, indicating higher species diversity. The range of the Berger-Parker

index can be interpreted as when the index value is close to 0, it signifies a high diversity with a more even distribution of abundances among different species. In such cases, no single species dominates the community, and there is a balanced representation of various species.

5. Evenness index-

Evenness index determines the homogeneity (and heterogeneity) of the species' abundance. Intermediate values between 0 and 1 represent varying degrees of evenness or unevenness in the distribution of individuals among species. Value of species evenness represents the degree of redundancy and resilience in an ecosystem. High species evenness = All species of a community can perform similar ecological activities or functions= even utilization of available ecological niches = food web more stable = ecosystem is robust (resistant to disturbances or environmental changes). Intermediate values between 0 and 1 represent variable degrees of evenness or unevenness.

$$EI = \frac{H}{\ln(S)}$$

Where, H= Shannon value

ln(S) = the natural logarithm of the number of different species in the community

Relative Abundance: The species abundance distribution (SAD) from disturbed ecosystems follows even/ uneven pattern. E.g., If relative abundance is 0.15, then the found species are neither highly dominant nor rare.

$$RA = \frac{\text{No. of Individuals of Sp.}}{\text{Total no. of Individual}} * 100\%$$

The basic idea of index is to obtain a quantitative estimate of biological variability that can be used to compare biological entities composed of discrete components in space and time. Biodiversity is commonly expressed through indices based on species richness and species abundances. Biodiversity indices are a non-parametric tool used to describe the relationship between species number and abundance. The most widely used bio diversity indices are Shannon Weiner index and Simpson's index.

12.2 Result and Discussion

The details of Marine Ecological Monitoring conducted for the locations of Kandla and Vadinar during the monitoring period has been summarized in the **Table 39**.

Table 39: Values of Biomass, Net Primary Productivity (NPP), Gross Primary Productivity (GPP), Pheophytin and Chlorophyll for Kandla and Vadinar

Sr. No.	Parameters	Unit	Kandla						Vadinar	
			ME-1	ME-2	ME-3	ME-4	ME-5	ME-6	ME-7	ME-8
1.	Biomass	mg/L	158	220	92	147	130	108	115	158
2.	Net Primary Productivity	mg/L/hr	0.58	BQL	0.82	BQL	0.72	BQL	BQL	BQL
3.	Gross Primary Productivity	mg/L/hr	1.12	BQL	1.22	0.78	1.19	0.66	0.76	BQL
4.	Pheophytin	mg/m ³	0.88	4	0.78	0.84	1.12	0.97	1.32	BQL

Sr. No.	Parameters	Unit	Kandla						Vadinar	
			ME-1	ME-2	ME-3	ME-4	ME-5	ME-6	ME-7	ME-8
5.	Chlorophyll-a	mg/m ³	0.93	1.210	1.87	1.19	1.86	1.52	1.44	1.26
6.	Particulate Oxidisable Organic Carbon	mg/L	1.11	0.78	0.74	0.81	0.92	1.08	0.61	0.62
7.	Secchi Depth	ft	0.62	0.59	0.53	0.71	0.64	0.68	1.05	1.16

- **Biomass:**

With reference to the **Table 39**, the concentration of **Biomass** reported from location ME-1 to ME-6 in range between **92-220mg/L** where lowest biomass presents in ME-3 (Near Coal Berth) and highest biomass present in ME-2 (Kandla Creek) during sampling period. In Vadinar, the value of biomass was observed 115 mg/L at ME-7 (Near SPM) and 158 mg/L in ME-8 (Near Vadinar Jetty) monitoring station.

- **Productivity (Net and Gross)**

Gross primary productivity (GPP) is the rate at which organic matter is synthesised by producers per unit area and time (GPP). The amount of carbon fixed during photosynthesis by all producers in an ecosystem is referred to as gross primary productivity. The monitoring location of Kandla reported GPP value in range between **0.66 to 1.22 mg/L/48 Hr** where the highest value recorded for ME-3 and lowest recorded at ME-6 (Nakti Creek (near NH - 8A)). In Vadinar, the value of **GPP** was observed 0.76 at ME-7 (Near SPM) and BQL at ME-8 (Near Vadinar Jetty) monitoring station.

Net primary productivity, is the amount of fixed carbon that is not consumed by plants, and it is this remaining fixed carbon that is made available to various consumers in the ecosystem. The Net primary productivity of the monitoring location at Kandla from (ME-1 to ME-6) has been estimated to be between **0.58 to 0.82 mg/L/48 Hr**. While in Vadinar, the value of **NPP** was observed BQL at ME-7 (Near SPM) and ME-8 (Near Vadinar Jetty) monitoring station.

- **Pheophytin**

The level of Pheophytin was detected in the range from **0.78 to 4 mg/m³** where the highest value observed at ME-2 (Kandla Creek (near KPT Colony)) and the lowest value observed at ME-3 (Near Coal Berth). While in Vadinar, the value of Pheophytin was observed 1.32mg/m³ at ME-7 and BQL at ME-8 monitoring station.

- **Chlorophyll-a**

In the sub surface water, the value of Chlorophyll-a reported in range from **0.93 to 1.87 mg/m³**. The highest value observed at ME-3 (Near Coal Berth) while the lowest value observed at ME-1 (Near Passenger Jetty One). In Vadinar, the value of chlorophyll-a was observed 1.44 mg/m³ at ME-7 (Near SPM) and 1.26 mg/m³ in ME-8 (Near Vadinar Jetty) monitoring station.

- **Particulate Oxidisable Organic Carbon**

During the sampling period, the particulate oxidisable organic carbon falls within the range of **0.74 to 1.11 mg/L** from monitoring location ME-1 to ME-6 at Kandla, whereas for Vadinar, the value of POC observed 0.61 mg/L at ME-7 (Near SPM) and 0.62 mg/L in ME-8 (Near Vadinar Jetty) monitoring station.

- **Secchi Depth**

In monitoring station of Kandla (ME-1 to ME-6) the level of Secchi Depth was observed between **0.53 to 0.71 ft** whereas at Vadinar, the value recorded at ME-7 i.e. Near SPM is 1.05 ft and in Near Vadinar Jetty is 1.16 ft.

Ecological Diversity

Phytoplankton: For the evaluation of the Phytoplankton population in DPA Kandla and Vadinar within the immediate surroundings of the port, sampling was conducted during the study period. Total 8 sampling locations were studied i.e. sampling locations (6 from Kandla and two from Vadinar).

The details of variation in abundance and diversity in phytoplankton communities is mentioned in **Table 40**.

Table 40: Phytoplankton variations in abundance and diversity in sub surface sampling stations

Genera	ME-1	ME-2	ME-3	ME-4	ME-5	ME-6	ME-7	ME-8
<i>Bacillaria sp.</i>	-	253	-	-	258	155	-	-
<i>Biddulphia sp.</i>	219	-	377	116	-	-	129	211
<i>Chaetoceros sp.</i>	-	-	-	-	119	-	-	-
<i>Chlamydomonas sp.</i>	189	129	-	268	-	262	355	282
<i>Cyclotella sp.</i>	202	-	324	-	143	-	-	-
<i>Coscinodiscus sp.</i>	-	156	-	179	-	154	166	197
<i>Ditylum sp</i>	225	-	170	-	-	-	-	-
<i>Fragilaria sp.</i>	-	344	-	-	264	255	-	208
<i>Bacteriastrium sp.</i>	176	-	432	202	187	-	345	-
<i>Pleurosigma sp.</i>	-	181	-	-	-	192	-	-
<i>Navicula sp.</i>	281	-	186	-	246	-	-	149
<i>Merismopedia sp.</i>	-	191	-	161	-	164	250	-
<i>Synedra sp.</i>	217	-	-	-	266	-	-	-
<i>Skeletonema sp.</i>	-	131	-	153	-	238	-	294
<i>Oscillatoria sp.</i>	-	-	166	-	169	-	192	-
<i>Thalassiosira</i>	297	198	-	232	-	356	-	189
<i>Gomphonema sp.</i>	-	-	158	-	188	-	221	-
Density-Units/L	1806	1583	1813	1311	1840	1776	1658	1530
No. of genera	8	8	7	7	9	8	7	7

The phytoplankton community of the sub surface water in the Kandla and Vadinar was represented by, Diatoms, green algae and filamentous Cynobacteria. Diatoms were represented by 15 genera; green algae were represented by 1 genera and filamentous Cynobacteria were represented by 1 genera during the sampling period.

The density of phytoplankton of the sampling stations from ME-1 to ME-6 (Kandla) varying from 1311 to 1840 units/L, while for Vadinar its density of phytoplankton observed 1658 units/L at ME-7 and 1530 units/L at ME-8. During the sampling, phytoplankton communities were dominated by *Thalassiosira* and *Cyclotella sp.* in Kandla, while *Chlamydomonas sp.* in Vadinar.

The details of Species richness Index and Diversity Index in Phytoplankton is mentioned in **Table 41**.

Table 41: Species richness Index and Diversity Index in Phytoplankton

Indices	ME-1	ME-2	ME-3	ME-4	ME-5	ME-6	ME-7	ME-8
Taxa S	8	8	7	7	9	8	7	7
Individuals	1806	1583	1813	1311	1840	1776	1658	1530
Shannon diversity	2.06	1.89	1.87	1.62	2.18	2.02	1.81	1.77
Simpson 1-D	0.87	0.86	0.83	0.85	0.88	0.86	0.84	0.85
Species Evenness	0.99	0.91	0.96	0.83	0.99	0.97	0.93	0.91
Margalef richness	0.93	0.95	0.80	0.84	1.06	0.94	0.81	0.82
Berger-Parker	0.16	0.22	0.24	0.20	0.14	0.20	0.21	0.19
Relative abundance	0.44	0.51	0.39	0.53	0.49	0.45	0.42	0.46

- Shannon- Wiener's Index (H)** of phytoplankton communities was in the range of **1.62 to 2.18** between selected sampling stations from ME-1 to ME-6 with an average value of 1.94 at Kandla creek and its nearby creeks. While for Vadinar, Shannon Wiener's index of phytoplankton communities recorded to be **1.81** at location ME-7 and **1.77** at ME-8 with an average value of 1.79. The apportionment of the numbers of individuals among the species observed higher stability at all monitoring location of Kandla.
- Simpson diversity index (1-D)** of phytoplankton communities was ranged between **0.83 to 0.88** at all sampling stations in the Kandla creek and nearby creeks, with an average of 0.86. Similarly, for Vadinar Simpson diversity index (1-D) of phytoplankton communities was 0.84 at location ME-7 and 0.85 at ME-8 with an average of 0.85.
- Margalef's diversity index (Species Richness)** of phytoplankton communities in Kandla and nearby creeks sampling stations was varying from **0.80 to 1.06** with an average of 0.92 during the sampling period. While for Vadinar, Margalef's diversity index (Species Richness) of phytoplankton communities observed 0.81 at ME-7 and 0.82 at ME-8 with an average value of 0.82.
- Berger-Parker Index (d)** of phytoplankton communities was in the range of **0.14 to 0.24** between selected sampling stations from ME-1 to ME-6 with an average value of 0.19 at Kandla creek and nearby creeks. Berger-Parker Index (d) of phytoplankton communities in the sampling stations of Vadinar, was in the range of 0.19 to 0.21 with an average value of 0.20. All the monitoring station signifies a low diversity with an even distribution among the different species.
- The **Species Evenness** is observed in the range of **0.83 to 0.99** for all the six-monitoring station of Kandla and for the Vadinar the species evenness is observed 0.93 at location ME-7 & 0.91 at ME-8 location.
- During the sampling period, **Relative Abundance** of phytoplankton communities was in range of **0.39 to 0.53** between selected sampling stations from ME-1 to ME-6 with an average value of 0.47 at Kandla creek and nearby creeks. Whereas for Vadinar the Index value 0.42 at ME-7 and 0.46 at ME-8 with an average value 0.44, thus it is concluded that the studied species can be stated as neither highly dominant nor rare.

The details of variation in abundance and diversity in zooplankton communities is mentioned in **Table 42**.

Table 42: Zooplankton variations in abundance and diversity in sub surface sampling stations

Genera	ME-1	ME-2	ME-3	ME-4	ME-5	ME-6	ME-7	ME-8
<i>Acartia sp.</i>	-	2	1	-	1	-	-	1
<i>Acrocalanus</i>	1	-	-	1	-	2	1	-
<i>Amoeba</i>	-	1	1	-	-	1	-	-
<i>Brachionus sp.</i>	2	-	-	-	2	-	1	1
<i>Calanus sp.</i>	2	1	-	2	-	1	-	-
<i>Cladocera sp.</i>	-	-	2	-	1	-	2	2
<i>Cyclopoid sp.</i>	-	-	-	1	1	-	-	-
<i>Copepod larvae</i>	1	1	-	1	-	1	-	1
<i>Diaptomus sp.</i>	-	-	1	-	-	1	1	-
<i>Eucalanus sp.</i>	1	-	-	1	2	-	1	1
<i>Mysis sp.</i>	1	2	2	-	-	2	-	-
<i>Paracalanus sp.</i>	-	1	-	2	1	-	2	1
Density Unit/L	8	8	7	8	8	8	8	7
No. of genera	6	6	5	6	6	6	6	6

A total of 12 groups/taxa of zooplankton were recorded in Kandla and Vadinar during the study period which mainly constituted by *Mysis*, *brachionus*, *Calanus*, fish and shrimp larval forms. *Cladocera*, *Mysis* and *Paracalanus* had the largest representation at all stations from (ME-1 to ME-8). The density of Zooplankton of the sampling stations from ME-1 to ME-6 (Kandla) varying from 7 to 8 units/L, while for Vadinar its density of zooplankton observed 8 units/L at ME-7 and 8 units/L at ME-8. During the sampling, zooplankton communities were dominated by *Mysis sp.* in Kandla, while, *Cladocera* and *Paracalanus* had the largest representation at monitoring location of Vadinar.

The details of Species richness Index and Diversity Index in Zooplankton communities is mentioned in **Table 43**.

Table 43: Species richness Index and Diversity Index in Zooplankton

Indices	ME-1	ME-2	ME-3	ME-4	ME-5	ME-6	ME-7	ME-8
Taxa S	6	6	5	6	6	6	6	6
Individuals	8	8	7	8	8	8	8	7
Shannon diversity	1.73	1.73	1.47	1.73	1.73	1.73	1.73	1.65
Simpson (1-D)	0.93	0.93	0.9	0.93	0.93	0.93	0.93	0.95
Species Evenness	0.97	0.97	0.91	0.97	0.97	0.97	0.97	0.92
Margalef	2.4	2.4	2.06	2.4	2.4	2.4	2.4	2.57
Berger-Parker	0.25	0.25	0.29	0.25	0.25	0.25	0.25	0.29
Relative abundance	75	75	71.43	75	75	75	75	85.71

- **Shannon- Wiener's Index (H)** of zooplankton communities was in the range of **1.47 to 1.73** between selected sampling stations from ME-1 to ME-6 with an average value of 1.68 at Kandla creek and its nearby creeks. While for Vadinar, Shannon Wiener's index of zooplankton communities recorded to be 1.73 at ME-7 and 1.65 at ME-8 with an average

value of 1.69. The apportionment of the numbers of individuals among the species observed higher stability at all monitoring location of Kandla and Near SPM (Vadinar).

- **Simpson diversity index (1-D)** of zooplankton communities was ranged between **0.9 to 0.93** at all sampling stations in the Kandla creek and nearby creeks, with an average of 0.92 Similarly, for Vadinar Simpson diversity index (1-D) of zooplankton communities was 0.93 at ME-7 and 0.95 at ME-8 with an average of 0.94.
- **Margalef's diversity index (Species Richness)** of zooplankton communities in Kandla and nearby creeks sampling stations was varying from **2.06 to 2.4** with an average of 2.34 during the sampling period. While for Vadinar, Margalef's diversity index (Species Richness) of zooplankton communities observed 2.4 at ME-7 and 2.57 at ME-8 with an average value of 2.48.
- **Berger-Parker Index (d)** of zooplankton communities was in the range of **0.25 to 0.29** between selected sampling stations from ME-1 to ME-6 with an average value of 0.25 at Kandla creek and nearby creeks. Berger-Parker Index (d) of zooplankton communities in the sampling stations of Vadinar, was in the range of 0.25 to 0.29 with an average value of 0.27. All the monitoring station signifies a low diversity with an even distribution among the different species.
- The **Species Evenness** is observed in the range of **0.91 to 0.97** for all the six-monitoring station of Kandla whereas, for the Vadinar the species evenness was observed in the range of 0.92 to 0.97, during the monitoring month.
- During the sampling period, **Relative Abundance** of zooplankton communities was in range of 71.43 to 75 between selected sampling stations from ME-1 to ME-6 with an average value of 74.40 at Kandla creek and nearby creeks. Whereas for Vadinar the Index value 75 at ME-7 and 85.71 at ME-8 with an average value 80.36, thus it can be concluded that the studied species is stated as neither highly dominant nor rare.

The details of variation in abundance and diversity in **Benthic organism** is mentioned in **Table 44**.

Table 44: Benthic Fauna variations in abundance and diversity in sub surface sampling

Family/Class	ME-1	ME-2	ME-3	ME-4	ME-5	ME-6	ME-7	ME-8
Thiaridae	1	-	-	-	1	-	-	-
Mollusca	-	1	1	-	-	2	1	-
Odonata	-	-	1	2	-	-	1	1
Lymnidae	1	-	-	1	1	-	-	-
Planorbidae	-	2	2	-	-	1	-	-
Talitridae	2	-	-	-	-	-	2	3
Trochidae	-	1	-	1	2	1	-	2
Atydae	1	-	1	2	-	-	1	3

Family/Class	ME-1	ME-2	ME-3	ME-4	ME-5	ME-6	ME-7	ME-8
Gammaridae	-	-	-	-	1	2	-	-
Portunidae	-	-	1	-	-	-	-	-
Turbinidae	2	1	1	1	1	1	1	-
Palaemonidae	-	-	-	-	1	-	1	-
No. of Family	7	5	7	7	7	7	7	9
No of Class	5	4	6	5	6	5	6	4

Few Benthic organisms were observed in the collected sample by using the Van-Veen grabs during the sampling conducted for DPA Kandla and Vadinar. Majority of the species were found under the Macro-benthic organisms during the sampling period were represented by *Odonta*, *Portunidae sp.*, etc. The No. of Family of benthic fauna was varying from 5 to 9. The dominating benthic communities at Kandla Creek and nearby creek (Nakti and Khori creek) were represented Atyidae, Turbinidae. While lowest number of benthic species was represented by Portunidae.

The details of Species richness Index and Diversity Index in Benthic Organisms is mentioned in **Table 45**.

Table 45: Species richness Index and Diversity Index in Benthic Organisms

Indices	ME-1	ME-2	ME-3	ME-4	ME-5	ME-6	ME-7	ME-8
Taxa S	5	4	6	5	6	5	6	4
Individuals	7	5	7	7	7	7	7	9
Shannon diversity	1.55	1.19	1.75	1.55	1.75	1.55	1.75	1.36
Simpson 1-D	0.9	0.9	0.95	0.9	0.95	0.9	0.95	0.81
Species Evenness	0.96	0.86	0.98	0.96	0.98	0.96	0.98	0.98
Margalef	2.06	1.86	2.57	2.06	2.57	2.06	2.57	1.37
Berger-Parker	0.29	0.4	0.29	0.29	0.29	0.29	0.29	0.33
Relative abundance	71.43	80	85.71	71.43	85.71	71.43	85.71	44.44

- **Shannon- Wiener's Index (H)** of benthic organism was in the range of **1.19 to 1.75** between selected sampling stations from ME-1 to ME-6 with an average value of 1.55 at Kandla creek and its nearby creeks. While for Vadinar, Shannon Wiener's index of benthic organism recorded to be 1.75 at ME-7 & 1.36 at ME-8 location with an average value of 1.55. The apportionment of the numbers of individuals among the species observed higher stability at all monitoring location of Kandla and Vadinar.
- **Simpson diversity index (1-D)** of benthic organism was ranged between **0.9 to 0.95** at all sampling stations in the Kandla creek and nearby creeks, with an average of 0.91. Similarly, for Vadinar Simpson diversity index (1-D) of benthic organism was 0.95 at ME-7 and 0.81 at ME-8 location with an average of 0.88.
- **Margalef's diversity index (Species Richness)** of benthic organism in Kandla and nearby creeks sampling stations was varying from **1.86 to 2.57** with an average of 2.19 during the sampling period. While for Vadinar, Margalef's diversity index (Species Richness) of

benthic organism observed to be 2.57 at ME-7 and 1.37 at ME-8 location with an average of 1.97.

- **Berger-Parker Index (d)** of benthic organism was in the range of **0.29 to 0.4** between selected sampling stations from ME-1 to ME-6 with an average value of 0.30 at Kandla creek and nearby creeks. Berger-Parker Index (d) of benthic organism in the sampling stations of Vadinar, was observed to be 0.29 at ME-7 and 0.33 at ME-8 location with an average value of 0.31. All the monitoring station signifies a low diversity with an even distribution among the different species.
- The **Species Evenness** is observed in the range of **0.86 to 0.98** for all the six-monitoring station of Kandla and for the Vadinar the species evenness is observed 0.98 at both of the location.
- During the sampling period, **Relative Abundance** of Benthic organisms was in range of **71.43 to 85.71** between selected sampling stations from ME-1 to ME-6 with an average value of 77.61 at Kandla creek and nearby creeks. Whereas for Vadinar the Index value 85.71 at ME-7 and 44.44 at ME-8 location, with an average value 65.08, thus it is concluded that the studied species can be stated as neither highly dominant nor rare.

Annexure 1: Photographs of the Environmental Monitoring conducted at Kandla

STP Monitoring




Noise Monitoring



Soil Monitoring



Marine Monitoring

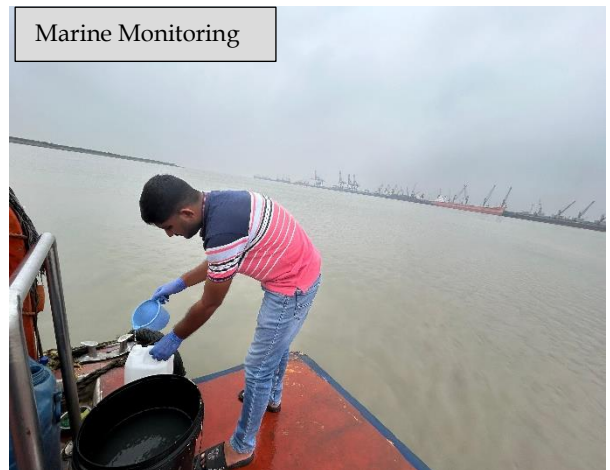


Air Monitoring



Drinking Water Monitoring



Annexure 2: Photographs of the Environmental Monitoring conducted at Vadinar

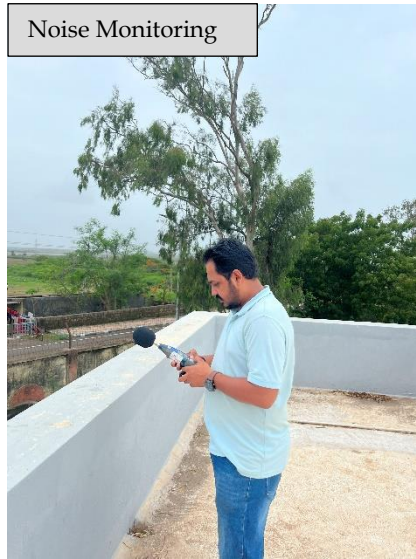

Source: GEMI



Gujarat Environment Management Institute (GEMI)

(An Autonomous Institute of Government of Gujarat)

'An ISO 9001:2015, ISO 14001:2015 & ISO 45001:2018 Certified Institute

Head Office

Plot No. B 246 & 247, G.I.D.C. Electronic Estate,
Sector-25, Gandhinagar-382024

Laboratory

Plot No. B-64, G.I.D.C. Electronic Estate,
Opp. I.P.R., Sector-25, Gandhinagar-382025

Tel: (+91) 79-23240964 (O), T: (+91) 79-23287758 (Lab), F: (+91) 79-23240965

E-mail: info-gemi@gujarat.gov.in | Website: www.gemi.gujarat.gov.in


"We Provide Environmental Solutions"

Annexure -D

Final Report

on

Greenbelt Development in Deendayal Port Authority and its surrounding areas, Kandla Port Phase-II

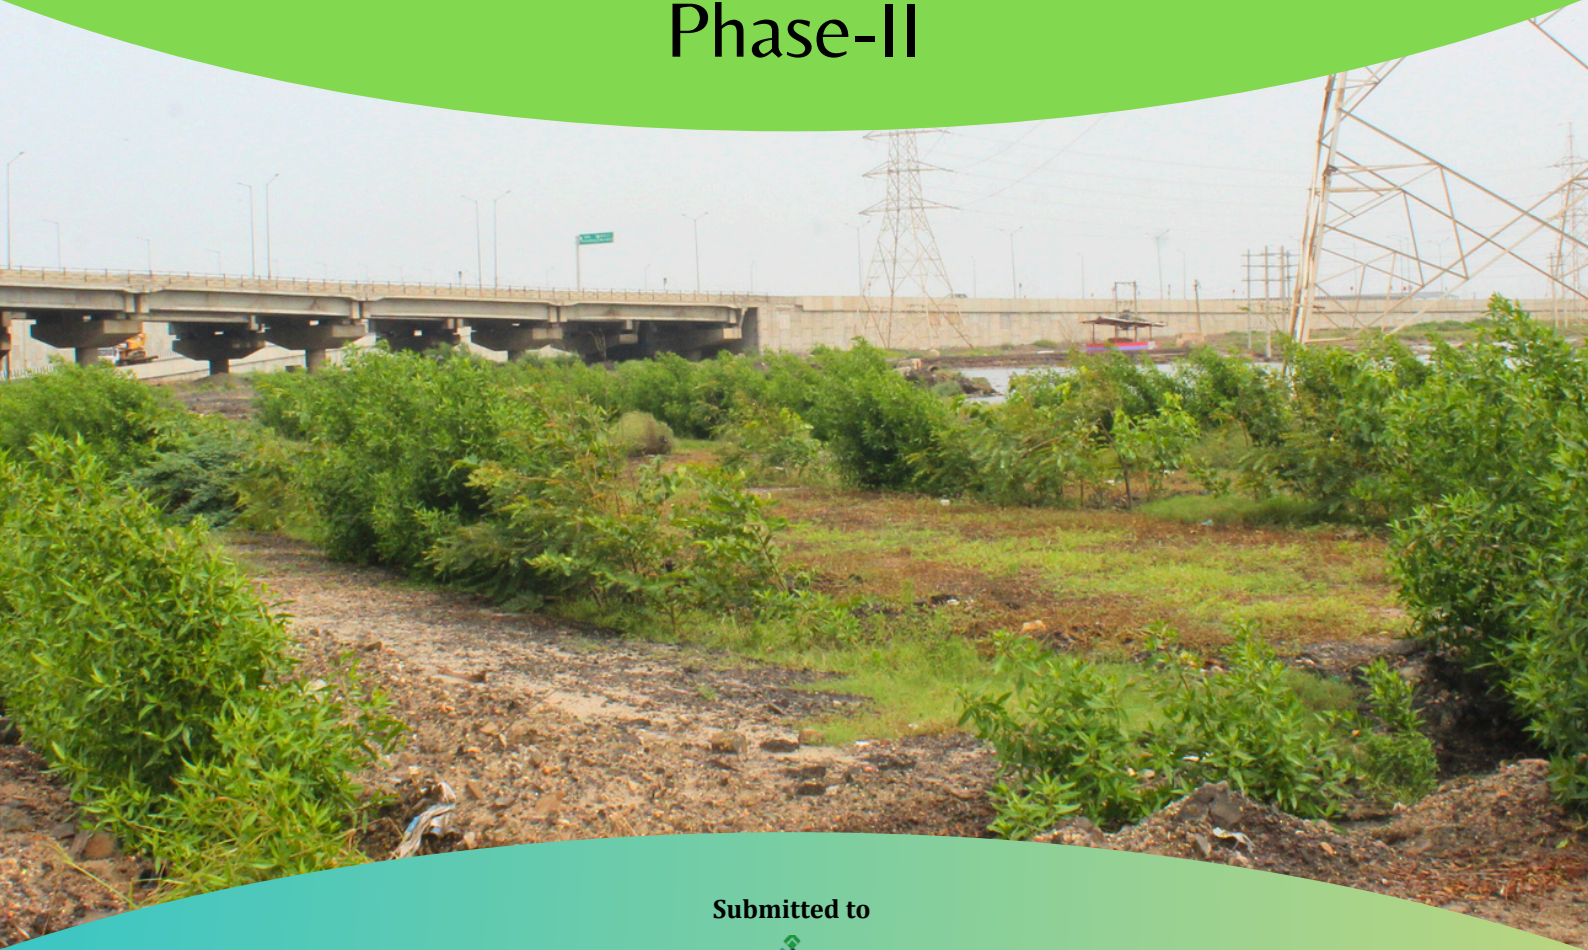

Submitted to



Deendayal Port Authority
Administrative Office Building
Post Box No.50, Gandhidham (Kachchh)
Gujarat-370201

Submitted by



Gujarat Institute of Desert Ecology
Opp. Changleshwar Temple,
Mundra Road, Bhuj-370 001,
Kachchh, Gujarat
www.gujaratdesertecology.com

Final Report

on

Greenbelt Development in Deendayal Port Authority and its
surrounding areas (Phase-II) Kandla Port

Co-ordinator

Dr. V. Vijay Kumar, *Director*

Principal Investigator

Dr. Jayesh B. Bhatt, *Scientist*

Co-Principal Investigator

Mr. Bhagirath Paradva, *Project Fellow*

Mr. Rakesh Popatani, *Project Fellow*

Team Member

Mr. Vivek Chauhan, *Project Assistant-I*

Mr. Ajay Gohel, *Project Fellow*

Submitted by



Gujarat Institute of Desert Ecology
Opp. Changleshwer Temple, Mundra Road
Bhuj-370 001, Kachchh, Gujarat
www.gujaratdesertecology.com

Content

Title	Page No
Introduction	1
Rationale	3
Project Site	5
Scope of Work	7
Approach and Methodology for Greenbelt Development	7
Plantation techniques	8
Selection of plant species for plantation	9
Number of saplings	9
Management and Monitoring of Greenbelt	9
Time Schedule for Water	11
Annexure-I	12

Introduction

The Greenbelt cover/forest has been the utmost necessity for the survival of human as well as for the wildlife with the current scenario of human explosion, industrial development and climate change. The greenbelt cover provides ecological services such as purifying air, reduce soil erosion, improving ground water table, reduce salinity. In addition, it also caters the services such as food, fodder and medicine, etc. along with playing a very vital role in providing habitats for wildlife and maintaining ecological balance, climate regulation, biodiversity conservation and maintaining pleasant micro climate of the region. Thus, green belt offers a number of benefits for population. Moreover, vegetation absorbs various pollutants from the environment and thus helps in effective pollution control. However, due to the various types and extent of economic development like industrialization, mining, infrastructural development, etc. has exerted pressure in reducing and fragmenting natural vegetation cover day-by day all over the world.

The infrastructural and industrial development leads to influence the life of all the living organisms in two directions: either upwards or downwards. In the upward mode, human being gets opportunities for luxuriant life with easy accessibility to the resources while in downward, the quality of ecosystem services gets affected. Most of the industrial and infra-structural developmental activities generate pollution of one or other types with varying magnitudes, which makes susceptible to all the organisms, nevertheless, the pre-eminence of resistance of each of the organisms helps themselves to overcome the hazards caused by such pollutants.

Therefore, the general concept of green belt has evolved in recent years to develop vegetations or green spaces alongside of industries, mines, thermal power station, roadsides, and other development units is an effective mechanism to rejuvenate the environment through vital vegetation cover that safeguard the health of human and other living organisms. Green belts in and around urban and industrial areas are important to the ecological health of any given region. Greenbelt is the plantation of trees along the industrial units, mines, roadside for reducing the pollution originating from these operations (Flemming, 1967; Hanson and Throne, 1970; Warren, 1973; Ganguly, 1976). Greenbelt has been developed in view of the following factors; (i) physical characteristics

of the green belt eg. Distance from the source, width, and height and leaf surface area density (ii) aerodynamic properties eg. Wind speed through greenbelt and effective height of the incident air stream (iii) deposition velocity of the pollutant and (iv) atmospheric stability conditions (CPCB, 2000).

As per the National Forest Policy (NFP-1988), it is necessary to encourage the planting of trees alongside of roads, railway lines, rivers and streams and canals, and on other unutilized lands under state/corporate, institutional or private ownership. NFP give emphasis on the green belt developments. It says – Green belts should be raised in urban/industrial areas as well as in arid tracts. Such a programme will help to check erosion and desertification as well as improve the microclimate.

Green infrastructure serves to provide an ecological framework for social, economic and environmental health of the surroundings. The main components of this approach include storm water management, climate adaptation, less heat stress, more biodiversity, food production, better air quality, sustainable energy production, clean water and healthy soils, as well as the more anthropocentric functions such as increased quality of life through recreation and providing shade and shelter in and around infrastructure and industrial areas. Green infrastructure is thought to be effective in such scenarios, where green plants from a surface capable of absorbing air pollutants and act as a sink for pollutants. Leaves with their vast leaf area in the tree canopy, absorb pollutants on their surface. Thus, effectively reduce their concentrations in the ambient air. Often the absorbed pollutants are incorporated in metallic streams and thus the air is purified. Plants grown in such a way as to function as pollutant sinks are collectively referred to as green infrastructure or green belts. Apart from functioning as a pollutant sink, green belts would also provide other benefits like aesthetic improvement and providing possible habitats for birds and animals along with maintain the soil moisture regime with the soil microorganisms and improve the Soil quality and ground water recharge. The greenbelts have helps in improving the ecology, maintenance of biodiversity, mitigation of dust pollution and fugitive emission, control of noise pollution, provide fresh air, increasing aesthetic values of an area and overall improvement of the landscape.

Rationale

Deendayal Port in Kachchh District of Gujarat State (formerly Kandla Port Trust), operated by Deendayal Port Authority (DPA), is a gateway Port to the hinterland in the western and northern states of India. It is one of the 11 major Ports of India situated at 22°59'39.77" N latitude and; 70°13'20.14" E longitude on Kandla creek at Gulf of Kachchh. The inclusion of Karachi Port in Pakistan after India's partition and heavy traffic congestion at the then Bombay Port gave impetus for promoting Deendayal Port during the year 1950s. In 1955, Deendayal Port acquired the status of a major Port in India. Because of its proximity to the Gulf countries, large quantities of crude petroleum and other assorted cargo are imported through Deendayal Port. The Port presently has 14 jetties, six oil terminals, and several allied facilities for handling dry and liquid cargo. Regular expansion/developmental activities such as the addition of jetties, allied Special Economic Zones (SEZ hereafter), industrial parks and ship bunkering facilities are underway to cope with the increasing cargo handling demands. Shri Mansukh Mandaviya, Minister of State for Ports, Shipping and Waterways (I/C) appreciated the efforts taken by Deendayal Port and added that it is indeed the major achievements in the challenging (COVID) times and it is significant indication that economy is bouncing back to achieve pre-COVID times.

Major commodities handled by the Deendayal Port are Crude Oil, Petroleum product, Coal, Salt, Edible Oil, Fertilizer, Sugar, Timber, Soya bean, Wheat. This major achievement can be attributed to the user-friendly approach of port with the Shipping fraternity / stakeholders and constant consultations with them to improve ease of doing business. An assortment of liquid and dry cargo is being handled at Deendayal Port. The dry cargo includes fertilizers, iron scrap, steel, food grain, metal products, ores, cement, coal, machinery, sugar, wooden logs, salt extractions, etc. The liquid cargo includes edible oil, crude oil and other petroleum products. DPA created a new record by handling 127.10 million metric tons of cargo during FY 2021-22 compared to 117.566 MMT in FY 2020-21, with a growth of 8.11%. Incidentally, DPA is the only major Indian Port to handle more than 127 MMT cargo throughput, and it has also registered as the highest cargo throughput in its history. The Port has handled 3151 vessels during FY 2021-22 compared to 3095 vessels in FY 2019-20. While the Port has flagged off several projects related to infrastructure creation, DPA has successfully awarded the work of

augmentation of Liquid cargo handling capacity by revamping the existing pipeline network at the oil jetty area in September 2021. Deendayal Port is a natural harbour located on the eastern bank of North-South trending Kandla creek at an aerial distance of 145 km from the Gulf's mouth.

Being located at the inner end of the Gulf of Kachchh (GoK), Deendayal Port has a marine ecosystem with a vast expanse of mangroves, creek systems and allied biota. The Port location is marked by a network of major and minor mangrove-lined creek systems. The coastal belt in and around the Port has an irregular and dissected configuration.

There are no perennial or seasonal rivers in Gandhidham taluka where the port is located. Total rainy days during the monsoon season is limited to only 15-20 days and used to be erratic. Freshwater input into the near coastal waters is relatively meagre and appears to have less influence on the ambient coastal water quality except during monsoon months, during which freshwater through flash floods get discharged in the near coastal waters. The annual average humidity is 60%, which increases to 80% during the southwest monsoon (June to September) and decreases to 50% during the months of November and December. The drought phenomenon is common with two drought years in a cycle of 5 years.

The coastal belt in and around the Kandla region is characterized by a network of creek systems and covered by sparse halophytic vegetation, creek water and salt-encrusted land mass, which forms the major land forms. The surrounding environment in a radius of 10 km from the Port is mostly built-up areas consisting of salt works, human habitations and Port related structures on the west and north, creek system, mangrove formations on the east and south. The Deendayal Port and its surroundings have mangroves and creek systems as major ecological entities.

DPA is committed towards environment protection since its establishment and has taken many initiatives towards increasing green cover and greenbelt development in various areas under DPA through intensive plantation activities and developing greenbelt around its established port and jetty areas and human habitations.

In order to enhance and strengthen Greenbelt Development, the DPA has approached GUIDE to develop the greenbelt area within the port area in phase wise manner and raised 5000 plants at a suitable site during the first phase (2022-23). In continuation,

10,000 plants have been finalized during the 2nd phase 2023-24 and 800 plants as a deficient of first phase.

GUIDE team has visited the proposed Greenbelt development site at Kandla port with the officials from Kandla Port as part of selection of suitable and available locations for green belt development. Based on the observation of the project site and its landscape, environment and ecology of the area, suitable plant species for such area was worked out in order to improve the local environment and for the Greenbelt development at the port area.

Project Site

Based on observation made by the GUIDE Team and Officials from Deendayal Port Authority, a site at RoB and another site opposite to 15-16th Birth along the wall have been selected on the peripheral boundary of two sites.



Fig. 1 Map of Plantation Area RoB

The area proposed for green development of Deendayal Port is barren land without any vegetation. The soil of the area is black muddy and is high saline soil and with saline ground water. The area is very dry and hot during the summer. The highest temperature in Kandla is used to be recorded in this area.



Fig. 2 Map of Plantation Area 15-16 Birth Opp: Wall



Fig. 3 Map of Plantation Area 15-16 Birth Opp: Wall

Scope of Works

The overall objective is to Development Greenbelt at Deendayal Port. The following activities of the Greenbelt development have been carried out:

1. To make an inventory of suitable sites for greenbelt development in and around the Deendayal Port at Kandla.
2. To carryout Soil and Moisture Conservation (SMC) of the selected sites.
3. Identification of suitable species of plants as per site scenario for the greenbelt plantation.
4. Adopting plantation technique and soil/manure amendments.
5. Regular monitoring (survival and growth) of the plantation.
6. Suggest measures for management and improvement of the greenbelt.

Approach and Methodology for Greenbelt Development

Following steps have been adopted for greenbelt development:

- Removal of exotic/unwanted plants plant species from the entire area demarcated for green belt development: The entire selected site has been cleared by removing unwanted weeds and material such as stones, plastics etc.by JCB and also with the help of labor forces.
- Landscaping of the area and land preparation Trench line of 2.5x 2.5 ft. have been dig out through JCB at RoB site and another site opposite to 15-16th Birth along the wall.
- Soil and moisture conservation work since the port area is highly saline, SMC work was very much essential for better survival of the plants. Agriculture fertile soil have been added in appropriate quantity.
- Identification of native species of plants for plantation in greenbelt as per the site suitability the site was very challenging for greenbelt development since the water and soil is highly saline with the extreme climatic condition, the selection of plant species for plantation has been made very carefully. 40 % of plants have been selected as native species for plantation where as 60% species of *Conocarpus* depends on high salinity level of the soil of the area.

- Procurement of sapling of identified species or Nursery management or seeding of tree/shrub species all the saplings were procured where of 3-4 ft. in height from reliable nursery. All saplings were of tree species.
- Installation of drip irrigation facilities was not feasible therefore activity was planned preferably through tankers. The watering of the plantation has been scheduled as per the seasons which is given in table. Regular watering as per the scheduled have been provided by the water tanker under the supervision of team expert
- Use of Manure, preferably organic fertilizer for enhancing soil fertility best quality organic manure have been provided to the saplings for better growth and survival. Weed management and trench repairing have been carried out periodically also as and when it required.
- Regular monitoring and management of the saplings by a qualified team from GUIDE the selected. The regular visit to the site has been made for monitoring and clearing the road for water tanker for irrigation. Gap fillings was also made during the period.

Plantation Techniques:

- Site development for a plantation includes clearance for weeds and it involves, bush cutting, soil and moisture conservation works and marking of pits for planting of saplings etc.
- After clearing the land sites for digging of pits, plantation have been marked on ground using a measuring tape to ensure the desired spacing.
- Pits of the size 45 cm x 45 cm and 45 cm depth have been dug for tree plantation. Pits have been deep enough to ensure that the roots of the plants do not curl up once the planting material is placed in it.
- Since the soil is highly saline, a fertile soil around 10 dumpers have been added for better survival of plants
- Organic manure has been added for better growth and survival.
- The pit has been filled a little above the ground level so that after the earth settles the upper surface of the pit is level to the ground thus avoiding any water logging.
- The plantation has been carried out in two phases

- Around 4000 saplings have been planted during the first phase at available plantation area at RoB site.
- Around 4500 saplings have been planted during the first phase at available plantation area at opposite 15-16th Birth along the wall.
- The remaining 2500 saplings have been planted at opposite 15-16th Birth along the wall. Thus, a total of 11000 plantations have been completed at the end of the project.
- Along with the above, gap filling of 2500 plants were carried out in both the sites, thus covering a total of 13,500 plants have been planted to achieve the target of 11,000 plants.
- The assessment on survival of plants have been carried out during the 2nd week of August 2024 which shows the deficient of around 1000 plants hence the gap filling of 1200 plants have been made during 3rd to 7th September 2024.
- The verification of plantation has been made with the officials of Deendayal Port Authority on 22nd October 2024 and it has been verified and confirmed that 90% survival of plants for the plantation carried out during the 2nd Phase under the project.

Selection of Plant Species for Plantation:

Various indigenous tree species suitable for the area have been identified and selected for plantation in suitable areas based on the assessment of soil quality, available water facility, and other environmental parameters.

Number of Sapling:

Approximate numbers of saplings to be required for the greenbelt are as follows;
Total plantations of 11,000 saplings were planted at RoB & 15-16 Birth (Opposite wall both sides) along with additional gap filling in the areas.

Management and Monitoring of Greenbelt:

The plantation within the identified site have been managed and monitored for a minimum period of one year from June 2023 to September 2024. The management of

plantation includes appropriate irrigation of the plantation in regular intervals, during summer and winter periods along with dry spells during the monsoon.

The plants are growing very well and reached more than 4-6 ft. height. The survival of plants has been noted very high as 90% during September 2024. Watering have been made through tanker service at given schedule during the different seasons. (Table. 1)



Table-1 Time Schedule for Watering

Sr. No.	Month & Year	Number of Time
1	October 2023	7 times/ month
2	November 2023	7 times/ month
3	December 2023	7 times/ month
4	January 2024	7 times/ month
5	February 2024	7 times/ month
6	March 2024	9 times/ month
7	April 2024	10 times/ month
8	May 2024	10 times/ month
9	June 2024	8 times/ month
10	July 2024	8 times/ month
11	August 2024	3 times/ month
12	September 2024	5 times/ month



Annexure I
List of Plants for Plantation at site for Greenbelt Development
Site: Road Over Bridge

Sr. No.	Scientific Name	Local Name	No. of Plants
1	<i>Conocarpus</i>	Conocarpus	2500
2	<i>Peltophorum pterocarpum</i>	Peltofoum	200
3	<i>Millettia pinnata</i>	Karanj	100
4	<i>Delonix regia</i>	Gulmahor	200
5	<i>Alstromia schollaris</i>	Saptparni	100
6	<i>Terminalia catapa</i>	Badam	100
7	<i>Plumaria obtusa</i>	Chmapo	100
8	<i>Ceaslpinia pulcherima</i>	Galtoro	100
9	<i>Bauhinia racemosa</i>	Kachnar	200
10	<i>Tabubia rosea</i>	tabubia	100
11	<i>Terminalia arjuna</i>	Arjun	100
12	<i>Cassia fistula</i>	Garmalo	200
	Gap Fillings		2050

Site: Opposite 15-16th Berth

Sr. No.	Scientific Name	Local Name	No. of Plants
1	<i>Conocarpus</i>	Conocarpus	4000
2	<i>Peltophorum pterocarpum</i>	Peltofoum	450
3	<i>Millettia pinnata</i>	Karanj	400
4	<i>Delonix regia</i>	Gulmahor	400
5	<i>Mimusops elengi</i>	Borssalii	300
6	<i>Ceaslpinia pulcherima</i>	Galtoro	450
7	<i>Tabubia rosea</i>	tabubia	400
8	<i>Cassia fistula</i>	Garmalo	300
9	<i>Bauhinia racemosa</i>	Kachnar	300
	Gap fillings		1650



Fig. 4 Digging Out Trench for Plantation



Fig. 5 Transportation of Plants to Site



Fig. 6 Fertile Soil for Better Survival of Plants



Fig. 7 Soil Filling in Plantation Pits


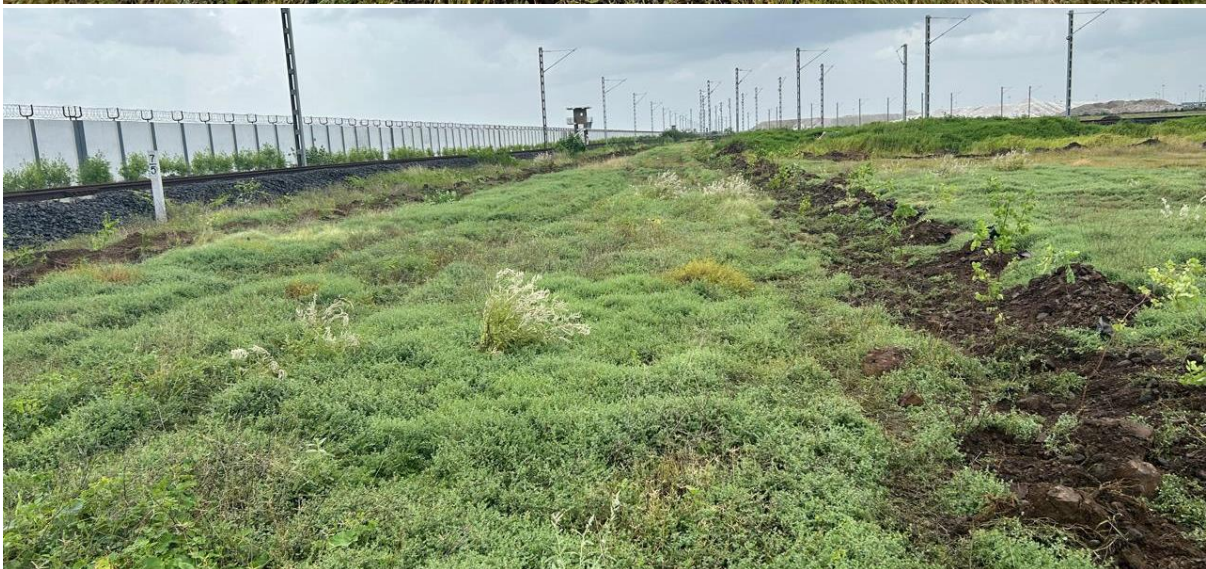


Fig. 8 Organic Manure for Better Growth and Survival



Fig. 9 Regular Watering of the Plants by Tanker

Gap Filling (September 2024)

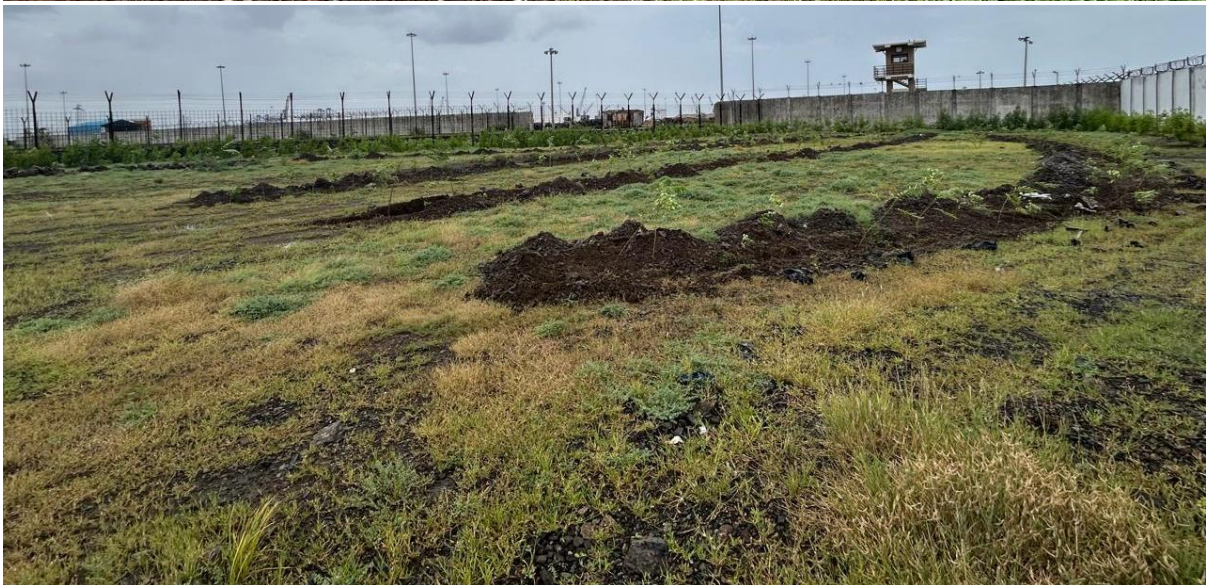

Current Status of plantation at RoB site



Current Status of plantation opp: 15-16 Berth



Annexure -2

**Monitoring the implemental Safe guards
Ministry of Environment, Forests & Climate Change
Regional office, Gandhinagar
Monitoring Report (For the period up to September, 2024)**

DATA SHEET

1. Project type: River valley/ Mining/Industry/ thermal/nuclear/Other (specify)	Infrastructure and Miscellaneous Projects + CRZ
2. Name of the project	Construction of 13 th to 16 th Cargo Berth at Kandla Port by M/s Deendayal Port Authority (Erstwhile: Deendayal Port Trust) (Under Ministry of Ports, Shipping & Waterways, GoI).
3. Clearance Letter (s). OM no and date	Environment Clearance was issued by the Govt. of India, Ministry of Environment & Forest – New Delhi vide letter No. 11-70/2006-IA-III Dated September 2008. Further, the Ministry of Environment & Forest – New Delhi, Govt. of India, extended the Environmental Clearances validity for five years, i.e. up to 30/09/2018, vide letter No. F.NO.11 – 70/ 2006 – IA.III dated 7 th February 2014.
4. Location a) District (s) b) State (s) c) Location/latitude/longitude	District: Kutch State : Gujarat Location: Deendayal Port Authority, 22°58'33.08"N and 70°13'16.28"E
5. Address for Correspondence a) address of Concerned Project Chief Engineer(with pin code &telephone/telex/fax numbers) b) Address of Executive project Engineer/manager/(with pin code fax numbers)	Chief Engineer, Deendayal Port Authority, A.O. Building Post Box No.-50, Gandhidham- Kutch. Gujarat Pin – 370201 Tel: 02836-233192, Fax-02836-220050. Superintending Engineer (Harbour), Office of the Superintending Engineer (Harbour), Nirman Building, New Kandla (Kutch) Pin 370 210. Gujarat
6. Salient features of the project	All the 4 berths, i.e., 13th to 16th Cargo berths, are under operation. 1. The dimension of each berth is 300m x 55m, consisting of a quay and transit area resting on 1200mm and 1000mm R.C.C.

<p>b) Salient features of the Environmental management plan</p>	<p>bored cast-in-situ piles. (Total 1200m x 55m wide for 4 berths).</p> <ol style="list-style-type: none"> 2. The backup area of size 21.7 Hectares/berth for 13th, 14th, 15th&16th CB, including all facilities, roads, railways & other required infrastructure (Total area: 102.17 ha. + 42 Ha. (1200 m X 350 m) = 144.17 ha.) 3. The Capacity of each Berth is 4.5 MMTPA (As approved by the Tariff Authority of Major Ports). 4. The drawing showing all berths viz. 13th to 16th has already been submitted with an earlier compliance report. <p>NIOT, Chennai, had already suggested an Environmental Management Plan for the project's construction & operation phases, as cited in the EIA study report by NIOT, Chennai. A copy of the same has already been communicated with earlier compliance reports submitted.</p>
<p>7. Breakup of the project area</p> <ol style="list-style-type: none"> a) Submergence area: forest & non-forest b) Others 	<p>Nil</p> <p>Nil</p>
<p>8. Breakup of the project affected population with enumeration of those losing houses/dwelling units only agricultural land & landless labourers/artisen</p> <ol style="list-style-type: none"> a) SC. ST/Adivasis b) Others <p>(Please indicate whether these figures are based on any scientific and systematic survey carried out or only provisional figures, if a survey is carried out give details and years of survey).</p>	<p>Nil</p> <p>Nil</p> <p>It is based on the EIA report prepared by M/s NIOT, Chennai.</p>
<p>9. Financial details</p> <ol style="list-style-type: none"> a) Project cost as originally planned and subsequent revised estimates and the year of prices reference. b) Allocation made for environmental management plans with item wise and year wise breakup 	<p>Block estimated cost of Rs. 442.90 crores (Dec. 2005); Revised Block estimated cost of Rs. 755.5 crores (Apr 2009).</p> <p>Estimated cost revised (The year 2017) for Berth No. 14 C.B.: 253 Crore & Berth No. 16 C.B.: 278 Crore. The Deendayal Port Authority operates all the 4 berths.</p> <p>The allocation made under the scheme of "Environmental Services & Clearance thereof other related Expenditure" during BE 2024-25 is Rs. 657 Lakhs.</p>

<p>c) Benefit cost ratio/Internal rate of Return and the year of assessment Whether (c) includes the cost of environmental management plans so far.</p> <p>d) Actual expenditure incurred on the project</p> <p>e) Actual expenditure incurred on the Environmental management plans so far.</p>	<table border="0"> <tr> <td>FIRR</td> <td>EIRR</td> </tr> <tr> <td>13.61%</td> <td>14.62%</td> </tr> <tr> <td colspan="2">Berth No. 14 C.B.: 253 Crore</td> </tr> <tr> <td>FIRR</td> <td>EIRR</td> </tr> <tr> <td>15.32%</td> <td>17.42%</td> </tr> <tr> <td colspan="2">Berth No. 16 C.B.: 278 Crore</td> </tr> <tr> <td>FIRR</td> <td>EIRR</td> </tr> <tr> <td>14.23%</td> <td>16.17%</td> </tr> </table> <p>Yes</p> <p>13thC.B: 300.23 Crore</p> <p>15thC.B: 252.45 Crore</p> <p>Berth No. 14thC. B internal resources DPT: 138.28 Crore (Awarded cost berth & Back up area)</p> <p>Berth No. 16thC.B internal resources DPT: 149.56 Crore (awarded cost berth & backup area).</p> <p>The expenditure made under the "Environmental Services & Clearance of other related Expenditure" is Rs. 172 Lakhs from up to September 2024.</p>	FIRR	EIRR	13.61%	14.62%	Berth No. 14 C.B.: 253 Crore		FIRR	EIRR	15.32%	17.42%	Berth No. 16 C.B.: 278 Crore		FIRR	EIRR	14.23%	16.17%
FIRR	EIRR																
13.61%	14.62%																
Berth No. 14 C.B.: 253 Crore																	
FIRR	EIRR																
15.32%	17.42%																
Berth No. 16 C.B.: 278 Crore																	
FIRR	EIRR																
14.23%	16.17%																
<p>10. Forest land requirement</p> <p>a) The status of approval for diversion of forest land for non-forestry use</p> <p>b) The status of clear felling</p> <p>c) The status of compensatory afforestation, if any</p> <p>d) Comments on the viability &</p>	<p>Nil</p> <p>Not Applicable.</p> <p>NIL</p> <p>A) Mangrove Plantation Plan carried out:</p> <ol style="list-style-type: none"> 1) Year 2005-06 – 20 hectares 2) Year 2008-09 - 50 hectares 3) Year 2010-11 – 100 hectares 4) Year 2011-12 – 200 hectares 5) Year 2012-13 – 300 hectares 6) Year 2013 -14 – 330 hectares 7) Year 2015-17 - 300 hectares 8) Year 2018-19 - 50 hectares 9) Year 2019-20 – 50 Hectares 10) Year 2020-21– 100 Hectares 11) Year 2022-23- 100 Hectares <p style="text-align: center;">Total - 1600 hectares</p> <p>As per the directions of the GCZMA and MoEF&CC,</p>																

<p>sustainability of compensatory forestation programmed in the light of actual field experience so far</p>	<p>GoI, to date, DPA has undertaken a Mangrove Plantation in an area of 1600 Hectares since the year 2005.</p> <p>The final report by GUIDE, Bhuj, was submitted along with the compliance report submitted in November 2019.</p> <p>Subsequently, DPA awarded the work for monitoring the mangrove plantation to M/s GUIDE, Bhuj, via a work order dated 3/5/2021 (Period 2021-2022). M/s GUIDE, Bhuj submitted its final report for the said project in May 2022, and the copy has already been communicated with earlier compliance report submitted.</p> <p>Further DPA has assigned work to M/s GUIDE, Bhuj vide work order dated 10/06/2024 for "Monitoring of Mangrove Plantation 1600 Ha carried out by DPA" for the Period of 10/06/2024 to 09/06/2025.</p> <p>Further, DPA has appointed the Gujarat Institute of Desert Ecology (GUIDE) for "Green belt development in Deendayal Port Authority and its Surrounding Areas, Charcoal site' (Phase-I) (5000 plants)" vide Work Order No.EG/WK/4757/Part [Greenbelt GUIDE, dated 31st May 2022. The work is completed.</p> <p>Further, DPA assigned work to GUIDE, Bhuj, via a work order dated 23/06/2023 for "Green belt development in Deendayal Port Authority and its Surrounding Areas (Phase II) (10000 plants). The final report is submitting along with this compliance.</p>
<p>11. The status of clear felling in non-forest areas (such as submergence area of reservoir, approach roads), if any with quantitative information.</p>	<p>Nil</p>
<p>12. Status of construction a) Date of commencement (Actual and/or planned) b) Date of completion (Actual and/or planned)</p>	<p>All the 4 berths are under operation.</p> <p>13th CB: Under operation since 18/02/2013. 15th CB: Under Operation since 16/11/2013. 14th CB: Under Operation since 08/04/2019. 16th CB: Under Operation since 10/03/2019.</p>
<p>13. Reasons for the delay if the Project is yet to start</p>	<p>All the 4 berths are under operation.</p> <p>13th CB: Under operation since 18/02/2013. 15th CB: Under Operation since 16/11/2013.</p>

	14 th CB: Under Operation since 08/04/2019. 16 th CB: Under Operation since 10/03/2019.
Date of site visited	
a) The dates on which the project was monitored by the regional office on pervious occasion. if any	29/12/2016
b) The date site visit for this monitoring report	-----